



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2303904

INV Date 19/06/2023

Reference CC4/LPC22011520/Aya3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMY 9261T
Insured Veh. YQ 1594K
Claim No. 21/22/22/VC05/026584
Policy No. Z21VC05009269
Accident Date 16/11/2022
Inspection Date 17/11/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22011520/Aya3q2 Date: 19/06/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YQ 1594K	Veh. Inspected	SMY 9261T	
Policy No.	Z21VC05009269	Coverage (\$)	0.00	
Claim No.	21/22/22/VC05/026584	Excess (\$)	0.00	
Assign From	ENG HUEY NI	Assign Date	16/11/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALPHARD	c.c	2493	
Engine No.	HIDDEN	Year of Reg.	2021	
Chassis No.	AYH300097347	Colour	BLACK	
Odometer	56223 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/55 R18	HABILEAD	6 mm	
L/H Front Tyre	235/55 R18	HABILEAD	6 mm	
R/H Rear Tyre	235/55 R18	HABILEAD	6 mm	
L/H Rear Tyre	235/55 R18	HABILEAD	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/11/2022	Inspection Date	17/11/2022	
Survey held at	HD PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMY 9261T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	662.10	662.10
2	REAR BUMPER TOWING COVER @\$24.20	N/S DEFORMED	48.40	24.20
2	REAR BUMPER REFLECTOR @\$59.80	NOT NECESSARY	119.60	-
2	REAR BUMPER SIDE INNER GARNISH @\$290.70	NOT NECESSARY	581.40	-
2	REAR BUMPER SIDE RETAINER @\$103.40	NECESSARY	206.80	206.80
2	REAR BUMPER BRACKET @\$165.00	N/S DENTED	330.00	165.00
4	REVERSE SENSOR @\$417.80	DAMAGED (2PCS ONLY)	1,671.20	590.00
4	REVERSE SENSOR RING HOLDER @\$24.10	NECESSARY	96.40	96.40
1	REVERSE SENSOR WIREHARNES	SNAPPED	288.10	288.10
1	TAILGATE	DISTORTED	2,040.50	2,040.50
1	TAILGATE OUTER MOULDING (CHROME)	CRACKED	680.80	680.80
2	TAILGATE LAMP @\$687.40	CUT	1,374.80	1,374.80
1	TAILGATE OUTER SWITCH BUTTON	NOT NECESSARY	248.20	-
2	TAILGATE NUMBER PLATE LAMP @\$290.60	NOT NECESSARY	581.20	-
1	TAILGATE WIRE HARNESS	NOT NECESSARY	342.60	-
1	TAILGATE LOGO	NECESSARY	78.20	78.20
1	TAILGATE EMBLEM 'ALPHARD'	NECESSARY	75.60	75.60
1	TAILGATE EMBLEM 'HYBRID'	NECESSARY	68.30	68.30
1	TAILGATE EMBLEM 'E-FOUR'	NECESSARY	65.20	65.20
1	TAILGATE LOCK DETECTOR	DAMAGED	194.70	194.70
1	TAILGATE LOCK DETECTOR WIRE HARNESS	NOT NECESSARY	269.60	-
2	TAIL GATE DAMPER @\$125.60	NOT NECESSARY	251.20	-
1	TAIL GATE TOP LOCK	DAMAGED	800.70	420.00
1	TAILGATE LOWER LOCK	NOT NECESSARY	55.70	-
1	TAILGATE INNER TRIM	CRACKED	734.85	734.85
2	TAILGATE INNER SIDE TRIM @\$123.80	NOT NECESSARY	247.60	-
1	TAILGATE INNER TOP TRIM	CUT	234.60	234.60
1	TAILGATE INNER HOLDER	NOT NECESSARY	52.10	-
1	TAILGATE WEATHER STRIP	CUT	324.72	324.72
4	TAILGATE STOPPER @\$25.10	NOT NECESSARY	100.40	-

Report Ref No. CC4/LPC22011520/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	TAILGATE SIDE STOPPER @\$85.00	NOT NECESSARY	170.00	-
1	TAILGATE SPOILER	TO REPAIR SEE LABOUR	963.70	-
1	TAILGATE WINDSCREEN C/W MOULDING	SHATTERED	1,297.40	1,297.40
1	REAR AIR CON BLOWER MOTOR	NOT NECESSARY	1,869.70	-
2	REAR FENDER INNER TRIM @\$2024.20	CRACKED	4,048.40	1,900.00
2	REAR FENDER INNER COWLING @\$236.80	NOT NECESSARY	473.60	-
2	REAR CORNER PANEL @\$290.30	DEFORMED	580.60	580.60
2	REAR CORNER PANEL RETAINER @\$98.20	NOT NECESSARY	196.40	-
2	TAILLAMP @\$689.20	CUT	1,378.40	1,378.40
2	TAILLAMP PANEL (OUTER) @\$187.20	TO REPAIR SEE LABOUR	374.40	-
2	TAILLAMP PANEL (INNER) LOWER @\$178.90	NOT NECESSARY	357.80	-
1	REAR END PANEL (OUTER)	DENTED	781.10	781.10
1	REAR END PANEL (INNER)	TO REPAIR SEE LABOUR	964.60	-
1	REAR END PANEL TOP GARNISH	DEFORMED	167.90	167.90
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	818.20	-
2	REAR FLOOR PANEL TOP BOARD (SIDE) @\$489.10	DEFORMED	978.20	978.20
1	REAR FLOOR PANEL TOP BOARD (CENTER)	DEFORMED	281.90	281.90
1	REAR FLOOR SIDE GARNISH	DEFORMED	155.70	155.70
1	REAR FLOOR PANEL TRAY (CENTER)	DEFORMED	358.20	358.20
2	REAR SEAT RAILWAY (CENTER) @\$1230.10	N/S BENT	2,460.20	1,230.10
2	REAR SEAT RAILWAY CENTER COVER GARNISH @ \$209.80	DEFORMED	419.60	419.60
4	REAR SEAT RAILWAY CENTER COVER GARNISH JOINT @\$48.20	NOT NECESSARY	192.80	-
	LESS 25% DISCOUNT		-8,028.59	-4,463.49
			24,085.78	13,390.48
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	BENT	80.00	50.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	80.00	50.00
1	TAILGATE SEALANT (SN)	NOT NECESSARY	150.00	-
1	SET TAILGATE INNER TRIM CLIP (SN)	NECESSARY	80.00	30.00

Report Ref No. CC4/LPC22011520/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET TAILGATE INNER SIDE TRIM CLIP (SN)	NOT NECESSARY	80.00	-
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NECESSARY	60.00	30.00
1	TAILGATE WINDSCREEN SOLAR FILM (SN)	NECESSARY	650.00	250.00
1	SET TAILLAMP CLIPS (SN)	NECESSARY	30.00	20.00
2	TAILLAMP PANEL (INNER) LOWER SEALANT @\$80.00 (SN)	NOT NECESSARY	160.00	-
1	SET REAR FENDER INNER TRIM CLIP (SN)	NECESSARY	80.00	60.00
1	SET REAR FENDER INNER COWLING CLIP (SN)	NOT NECESSARY	80.00	-
1	REAR END PANEL (OUTER) SEALANT (SN)	NECESSARY	150.00	60.00
1	REAR END PANEL (INNER) SEALANT (SN)	NOT NECESSARY	150.00	-
1	SET REAR END PANEL TOP GARNISH CLIP (SN)	NECESSARY	60.00	20.00
1	REAR FLOOR PANEL SEALANT (SN)	NOT NECESSARY	350.00	-
1	REAR SEAT RAILWAY CENTER COVER GARNISH CLIP (SN)	NECESSARY	80.00	20.00
1	SET REAR SEAT RAILWAY CENTER COVER GARNISH JOINT CLIP (SN)	NOT NECESSARY	80.00	-
1	VIDEO RECORDER (SN)	MISSING	880.00	500.00
1	REVERSE CAMERA (SN)	DAMAGED	550.00	400.00
			3,910.00	1,530.00
	LABOUR			
	TO PANEL BEAT, REMOVE AND REPLACE PARTS. INCLUSIVE OF THE REPAIR OF TAILGATE SPOILER, TAILLAMP PANEL (OUTER), REAR END PANEL (INNER) AND REAR FLOOR PANEL.		2,800.00	1,200.00
	TO SPRAY PAINT AFFECTED AREA.		1,800.00	1,000.00
	REMOVE AND REFIX CUSHION SEAT / UPHOLSTRY AND ROOF LINNING TO FACILITATE REPAIR.		650.00	150.00
	TUFF COAT.		250.00	150.00
	REMOVE AND REPLACE REAR WIREHARNES.		480.00	120.00
	REMOVE & REFIX UPHOLSTERY TO FACILITATE REPAIR.		350.00	120.00
	REMOVE & REFIX REVERSE SENSOR & DISTANCE SETTING.		80.00	50.00
	REMOVE & REFIX REVERSE CAMERA & DISTANCE SETTING.		80.00	50.00
	REMOVE AND REFIX REAR AIRCON BLOWER AND REFILL AIRCON GAS.	NOT NECESSARY	350.00	-

Report Ref No. CC4/LPC22011520/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	VACUUM AND CLEAN TAIL GATE AND QUARTER GLASS SPLINTER.		250.00	100.00
	REAR CHASSIS ALIGNMENT.	NOT NECESSARY	250.00	-
	REMOVE AND REFIX TAILGATE SPOILER.	NOT NECESSARY	120.00	-
	TRANSFER TAILGATE MECHANISM.		80.00	80.00
	REMOVE & REFIX VIDEO RECORDER.		180.00	50.00
	REMOVE & REFIX TAILGATE WINDSCREEN.		120.00	120.00
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	80.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT / CONTROL UNITS, RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	450.00	-
			8,370.00	3,190.00
GRAND TOTAL			36,365.78	18,110.48

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			14,500.00
---	--	--	------------------

Report Ref No. CC4/LPC22011520/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMY 9261T

INSPECTION

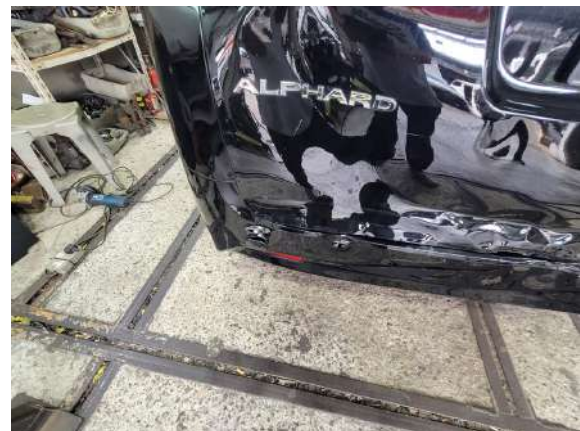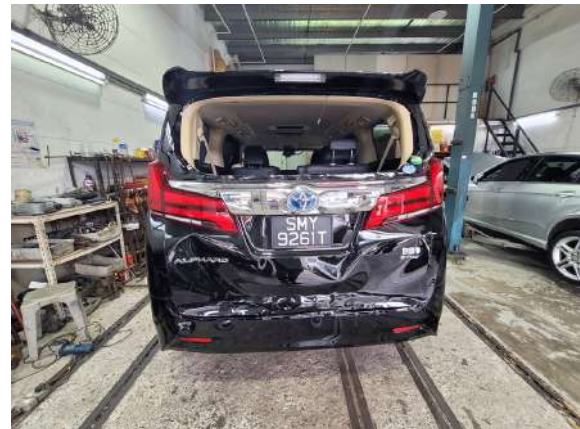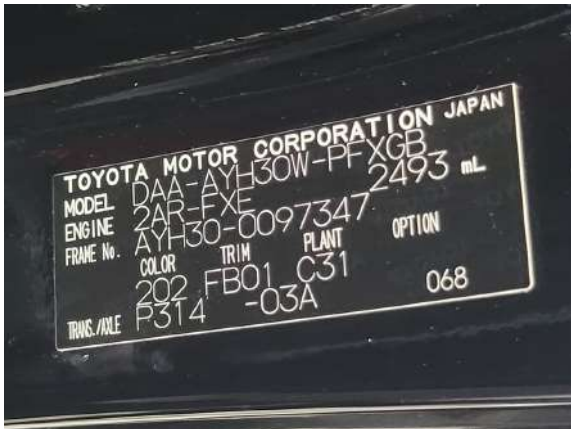



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMY 9261T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

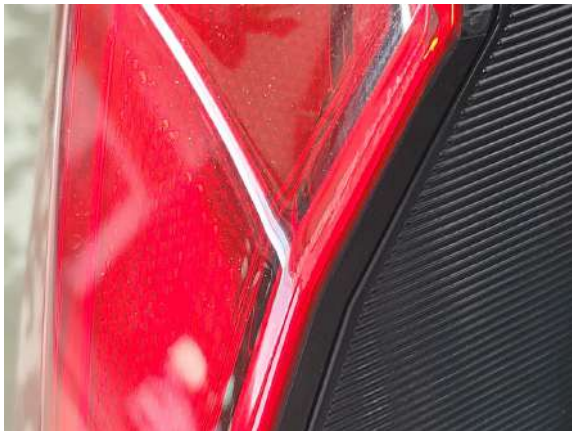



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

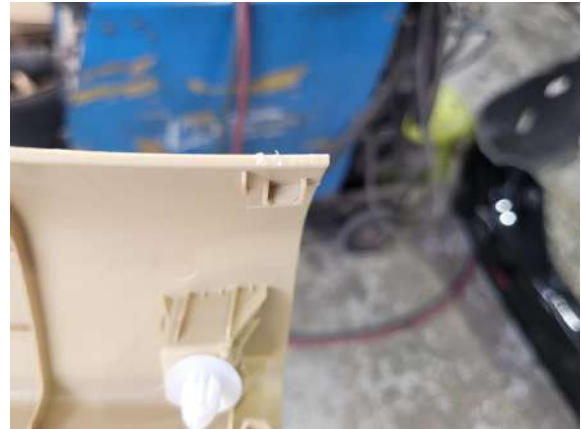



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

