



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2303809

INV Date 15/06/2023

Reference CC4/LPC22012030/Upa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJT 9195M
Insured Veh. GBB 8704R
Claim No. 22/22/22/VC05/026622
Policy No. Z22VC05012093
Accident Date 23/11/2022
Inspection Date 01/12/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC22012030/Upa3q2 Date: 15/06/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBB 8704R	Veh. Inspected	SJT 9195M	
Policy No.	Z22VC05012093	Coverage (\$)	0.00	
Claim No.	22/22/22/VC05/026622	Excess (\$)	0.00	
Assign From	CHARMAINE KONG	Assign Date	01/12/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA WISH (A)	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	ZGE200025827	Colour	WHITE	
Odometer	213116 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	MICHELIN	6 mm	
L/H Front Tyre	195/65 R15	MICHELIN	6 mm	
R/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
L/H Rear Tyre	195/65 R15	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/11/2022	Inspection Date	01/12/2022	
Survey held at	EURO SUCCESS SERVICES PTE LTD 1 KAKI BUKIT AVENUE 6 #02-03 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 9195M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	BADLY DENTED	1,370.22	1,370.22
2	TAILGATE WEATHERSTRIP	TWISTED	297.60	297.60
1	TAILGATE INNER BOARD	DEFORMED / TORN	461.00	461.00
1	SET TAILGATE INNER BOARD CLIP	NECESSARY	35.00	35.00
1	TAILGATE LOGO	NECESSARY	72.30	72.30
1	TAILGATE LOCK	DAMAGED / SHORTED	376.20	376.20
1	TAILGATE LOCK ACTUATOR	NOT NECESSARY	226.40	-
1	TAILGATE OUTER CHROME	SCRATCHED / CRACKED	267.00	267.00
1	TAILGATE WIPER MOTOR	NOT NECESSARY	422.30	-
2	TAILGATE REFLECTOR @\$421.30	O/S CRACKED	842.60	381.10
1	REAR WINDSCREEN	NOT NECESSARY	1,467.30	-
1	REAR WINDSCREEN MOULDING	NECESSARY	214.00	140.80
1	REAR BUMPER	DISTORTED	1,077.30	703.60
2	REAR BUMPER BRACKET @\$108.25	O/S BENT	216.50	108.25
2	REAR BUMPER REFLECTOR @\$105.00	NOT NECESSARY	210.00	-
2	REAR BUMPER SPACER	NO SUCH PARTS	11.40	-
2	REAR BUMPER SIDE RETAINER @\$95.90	O/S BENT	191.80	95.90
1	REAR BUMPER SIDE HOLDER @\$65.00	O/S BENT	130.00	65.00
1	SET REAR BUMPER CLIP	NECESSARY	48.00	48.00
1	REAR END PANEL	BADLY DENTED	1,150.00	638.90
1	REAR END TOP GARNISH	TWISTED	355.80	355.00
2	TAILLAMP ASSEMBLY @\$981.30	O/S CRACKED	1,962.60	565.30
2	TAILLAMP PANEL @\$882.60	TO REPAIR SEE LABOUR	1,765.20	-
2	TAILLAMP INNER PANEL @\$721.00	NOT NECESSARY	1,442.00	-
1	REAR FENDER INNER TRIM O/S	DEFORMED / WARPED	575.20	575.20
1	EXHAUST END PIPE	TO REPAIR SEE LABOUR	1,072.00	-
3	EXHAUST MOUNTING @\$54.00	NOT NECESSARY	162.00	-
1	REAR BUMPER INNER PIPE COVER	NOT NECESSARY	85.50	-

Report Ref No. CC4/LPC22012030/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER INNER AIR-CON PIPE	NOT NECESSARY	255.50	-
	LESS 25% DISCOUNT		-4,190.68	-1,639.09
			12,572.04	4,917.28
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	70.00	40.00
1	REAR PANEL SEALANT (SN)	NECESSARY	80.00	50.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	380.00	200.00
1	REAR NUMBER WITH HOLDER (SN)	SCRATCHED	60.00	40.00
			590.00	330.00
	<u>LABOUR</u>			
	REAR LABOUR CHARGE.INCLUSIVE OF THE REPAIR OF TAILLAMP PANEL AND EXHAUST END PIPE .		1,400.00	900.00
	REAR SPRAY PAINTING.		1,200.00	1,100.00
	TO REMOVE & REFIT REAR WINDSCREEN .		160.00	120.00
	TO REMOVE & REFIT REAR FITTINGS AND ATTACHMENT GARNISH .		150.00	80.00
	ANTI RUST TREATMENT.		120.00	60.00
	TO CHECK WIRING FOR PROPER FUNCTION .		100.00	20.00
			3,130.00	2,280.00
GRAND TOTAL			16,292.04	7,527.28
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,000.00

Report Ref No. CC4/LPC22012030/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 9195M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 9195M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

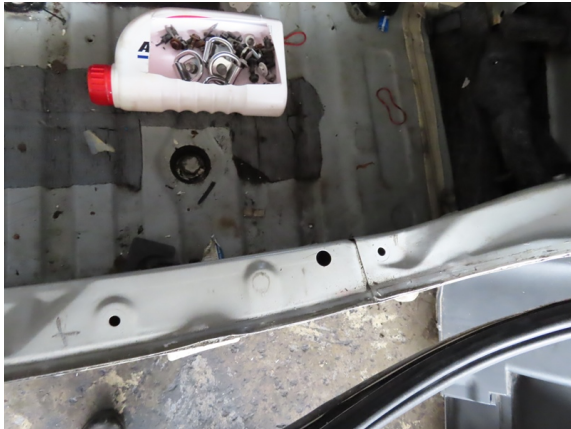



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJT 9195M

RE-INSPECTION

