



**PRO
PLUS
AUTOMOBILE
ENGINEERS**

221, Balestier Road #10-01, Rocca Balestier, Singapore 322992
Tel: +65 6707 8932 Fax: +65 6352 6802
Mobile: +65 9673 0595 / +65 9788 9809
E-mail: ethan88@singnet.com.sg Email: ethan88@gmail.com
Company Registration No. 40156500M

*Consultants to Motor Industry, Automobile
Engineers, Claims Investigators, Accident
Reconstruction Specialists, Insurance Loss
Assessors/ Adjusters, Valuers And
Licensed Appraisers.*

Our Ref: PP/ET/AA.9311.TP.01-22
08 April 2022

Goh Ting Kiat
c/o Blk 5034 Ang Mo Kio Ind. Park 2
#01-331
Singapore 569537

Dear Sir,

**Re: Third Party Claim
Vehicle Registration No. SY9311L**

We refer to your instruction to appraise the above-mentioned vehicle on 24 January 2022

A physical inspection was carried out and our report is enclosed for your perusal. The estimate cost of repair submitted by M/s **Teck Siang Motor Service** for **\$6,566.39** as per our attached schedule has been examined thoroughly and we have adjusted and revised as accordingly against the actual damaged found on the said vehicle.

Our revised quotation for the repair is **\$4,674.89**. In our opinion, we consider it to be excessive. We, therefore, recommend a contract lump sum repair cost. This is more economical than to have the vehicle repaired on a parts by/for parts basis. Invariably, the repairer has the prerogative/option for the recommended replacement components to either be repaired or be replaced.

We have negotiated with the repairer and they have agreed with the repair for **\$3,800.00 Nett** which, in our opinion is fair and reasonable. The repairer has agreed to undertake the repairs at our recommended adjusted amount and to their's owner's satisfaction. However, we have not given any instructions or authorisation to the repairer to proceed with the repairs.

The entire repair of the vehicle should be completed within a reasonable period of **03 (three)** days, excluding weekends and public holidays.

We are reverting the matter to you for a decision, and enclosed is our invoice for services rendered.

Kindly notify us immediately if there is any queries/discrepancy in this report, otherwise we treated it as correct. The survey was conducted on a "**Without Prejudice**" basis.

Very truly yours,

PROPLUS AUTOMOBILE ENGINEERS

ANDREW AW PO HUAT

Licensed Appraiser & Automobile Engineer

Dip (Mechanical Engineering)/Dip (Shipping & Marine Offshore)

CGI (Certificate in General Insurance)

VEHICLE INSPECTION REPORT

Our Ref : PP/ET/AA.9311.TP.01-22

Date : 08 April 2022

Goh Ting Kiat

c/o Blk 5034 Ang Mo Kio Ind. Park 2

#01-331

Singapore 569537

Date of Accident : 20 January 2022

Date of Inspection : 24 January 2022

Follow-up Date : 25 January 2022

Re-Inspection Date :

Name of Workshop : Teck Siang Motor Service

Place of Inspection : c/o Blk 5034 Ang Mo Kio Ind. Park 2

#01-331

Singapore 569537

PARTICULARS OF VEHICLE

Registration Number : SY9311L
Make/Model : Mercedes Benz C180 Avantgarde
Registration Date : 12 August 2015
Chassis Number : WDD2050402R083591
Engine Number : 27491030411098
Odo-meter Reading : 107437
Class/Type : Passenger (Saloon)
Colour : Metallic Silver

STATIC CHECK


General Condition : Good
Paintwork : Good
Foot/Hand brake : Serviceable
Steering : Serviceable
Undercarriage : Serviceable

TYRE CONDITION


Front o/s & n/s	4	mm/size	225/50 R17	Made	Goodyear
Rear o/s & n/s	4	mm/size	225/50 R17	Made	Goodyear
Type of wheels	:	Sport (Alloy)			
Photographs taken	:	17 Copies			

IMPACT OF VEHICLE

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered onto the rear end portion.

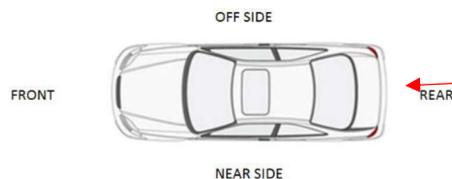

SYNOPSIS OF DAMAGED RESULTANT FROM THE ACCIDENT

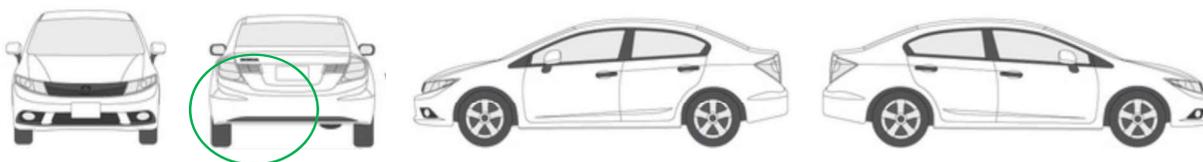

Damages sustained were consistent with the subject vehicle - rear bumper, lower, chrome moulding, rear bumper reinforcement, brackets, inner garnishes, retainers, brackets, rear end panel, rear sensors. (Bent/Dented/Cut/Cracked)

REVISED ESTIMATE

The estimate submitted by the repairer as per schedule attached has been revised and scrutinised as accordingly against the actual damages found on the siad vehicle. In our opinion, we consider the adjustment below is fair and reasonable.

	Repairer's Estimate	Our Revised Estimate
Spare Parts :	\$5,066.39	\$3,714.89
Labour Charges :	\$800.00	\$500.00
Paint Works :	\$600.00	\$400.00
Other :	\$100.00	\$60.00
Total :	\$6,566.39	\$4,674.89

TOTAL REPAIR COST RECOMMENDED \$3,800.00 (LUMP SUM REPAIR)

Note: The repairer has agreed to carry out the repair on a LUMP SUM basis. This means that they have the discretion to replac any damaged parts with either used or re-conditioned parts rather than new parts. They may also at their discretion to repair or re-instate any damaged parts to their pre-accident condition during the course of repairs.

SCHEDULE

PROPLUS AUTOMOBILE ENGINEERS

Sheet 1

Reg No : SY9311L

Our Ref : PP/ET/AA.9311.TP.01-22

No	Qty	Description	Comments /Condition	Repairer's Estimate	Revised Amount	
		<u>LIST ITEMS</u>		S\$	S\$	
1	1	Rear bumper	Bent/Torn/Cut	1,392.00	1,392.00	✓
2	1	Rear bumper lower	Torn	382.00	382.00	✓
3	1	Rear bumper lower chrome moulding	Cut/Bent	256.00	256.00	✓
4	2	Rear bumper retainers	Necessary	161.10	161.10	✗ nn
5	2	Rear bumper side retainers	Necessary	104.00	104.00	✓
6	1	Rear bumper tow cover	Not necessary	62.00	0.00	✗ nn
7	1	Rear bumper reinforcement	Bent	756.00	756.00	✗ nn
8	1	Rear bumper inner core	Dented	398.00	398.00	✗ nn
9	4	Rear bumper sensor	2 pcs damaged	1,036.00	518.00	✓
10	1	Rear n/s bumper inner lower cover	Bent	105.00	105.00	✓
11	1	Rear end panel	Dented/Repair	855.00	0.00	✗ repair
				-----	-----	
				5,507.10	4,072.10	
			Less 10%	550.71	407.21	2757 -10% 2481.30
				-----	-----	
				4,956.39	3,664.89	
		<u>S.NETT ITEMS</u>				
1	1	Rear bumper clips/fasteners	Necessary	50.00	30.00	✓
2	1	Rear bumper secure rivets	Necessary	60.00	20.00	✓
						50
Sub-Total (S\$)				5,066.39	3,714.89	

SCHEDULE

PROPLUS AUTOMOBILE ENGINEERS

Sheet 2

Reg No : SY9311L

Our Ref : PP/ET/AA.9311.TP.01-22

No	Description	Repairer's Estimate	Revised Amount
		S\$	S\$
	<u>LABOUR & OTHER CHARGES</u> c/f	5,066.39	3,714.89
1	To disconnect, check electrical wiring, harness wires, sockets, replace damaged lamps, connectors, rear sensors, reconnect and test for proper functioning.	100.00	60.00 ✓
2	To remove and replace the above damaged parts, straighten, knock out, re-align and reshape including cut and weld body panels repairs, re-position and re-adjust to the original position using power tools, jigs and other gas or electrical equipments.	800.00	500.00 400 ✓
3	To putty and spray paint the replace and repaired parts, prepare spray such as masking tape the unaffected areas with papers, cleaning and sanding of surfaces, final polishing and waxing are also necessary.	600.00	400.00 ✓
	-END-		
			860
Total (S\$)		6,566.39	4,674.89

3391.30

L/S - 2713.04
= 2700

PROPLUS AUTOMOBILE ENGINEERS



ANDREW AW PO HUAT

Licensed Appraiser & Automobile Engineer

Dip (Mechanical Engineering)/Dip (Shipping & Marine Offshore)

CGI (Certificate in General Insurance)



Photo 1



Photo 2



Photo 3



Photo 4



Photo 5



Photo 6



Photo 7



Photo 8



Photo 9



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17