

ASS. REC. BY:

REF:

C72/23008481kp

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

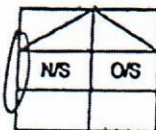

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.: Yes or No

Lump Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHB 1076 U

Yr Regn:

12.19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Tag

Priv

c.c.

1780

Colour

M. Brown

A/C: Insured / Std / NI / NA

Sp. Reading

226748

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

J70K B3FU 6030 89019

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Pailun

Front

Rear

R/Bal.

4

mm

R/Bal.

8

mm

L/Bal.

4

mm

L/Bal.

8

mm

D.O.A.

2/1/23

D.O.I.

3/1/2023

Survey held at

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or

N/S body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

S - RS - SI

F - RS

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / LB.I: (\$

TOTAL

Not Whisker
L1 Sy @
4 days



Case Details

Case Reference Number : TAX/01/23/2001
Type of Repair : Accident Repair
Vehicle Registration Number : SHB1078U

Company Type : Strides Taxi Pte Ltd
Estimation ID : EST-20170-ID
Assigned By : Taxi Claims Manager Team

Insurance Company Name : China Taiping Insurance (Singapore) Pte Ltd
Accident Date and Time : 02/01/2023 03:41 PM
Vehicle Age(In Months) : 37

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

SMRT Recommendation														Date:	Surveyor Approval
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks	
Standard	Main			FENDER SUB-ASSY, FR , LH	1	1,060.70	1,060.70	25.00	795.53	Replace	1	795.53	Replace ▾	By ✓	
Standard	Main			EMBLEM, SIDE PANEL (HYBRID)	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace ▾	Mr ✓	
Standard	Main			LINER, FR FENDER, LH	1	227.80	227.80	25.00	170.85	Replace	0	0	Not Give ▾	✓	
Standard	Main			RETAINER, FR WHEEL RH	1	3.50	3.50	25.00	2.63	Replace	0	0	Not Give ▾	✓	
Standard	Main			PROTECTOR, FR FENDER LH	1	101.80	101.80	25.00	76.35	Replace	0	0	Not Give ▾	✓	
Standard	Main			PAD, FR WHEEL LH	1	65.00	65.00	25.00	48.75	Replace	0	0	Not Give ▾	✓	
Standard	Main			APRON SUB-ASSY, FRONT FENDER , LH	1	1,060.90	1,060.90	25.00	795.68	Replace	0	0	Not Give ▾	✓	
Standard	Main			PILLAR, FRONT BODY, LH	1	378.90	378.90	25.00	284.17	Replace	0	0	Not Give ▾	✓	
Standard	Main			COVER, OUTER MIRROR, LH	1	117.80	117.80	25.00	88.35	Replace	0	0	Check ▾	✓	
Standard	Main			MOULDING ASSY, BODY ROCKER PANEL , LH	1	649.10	649.10	25.00	486.83	Replace	1	0	Repair ▾	✓	
Standard	Main			PILLAR, CENTER BODY, OUTER LH	1	349.50	349.50	25.00	262.13	Replace	0	0	Not Give ▾	✓	
Standard	Main			PANEL SUB-ASSY, FRONT DOOR LH	1	1,407.80	1,407.80	25.00	1,055.85	Replace	1	1,055.85	Replace ▾	By ✓	
Standard	Main			CHECK ASSY, FRONT DOOR	1	199.40	199.40	25.00	149.55	Replace	0	0	Not Give ▾	✓	
Standard	Main			WEATHERSTRIP, FRONT DOOR LH	1	250.70	250.70	25.00	188.02	Replace	0	0	Check ▾	✓	

Total Spare Part Cost 9,543.13

Surveyor Total 3,324.39

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 7,634.50

Final Sur Total 2,659.51

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Surveyor Approval

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			LOCK ASSY, FRONT DOOR LH	1	607.90	607.90	10.00	547.11	Replace	0	0	Not Give	X
Standard	Main			DOOR LOCK STRIKER	1	42.60	42.60	25.00	31.95	Replace	0	0	Not Give	X
Standard	Main			DOOR OUTER HANDLE FRONT LH	1	423.20	423.20	25.00	317.40	Replace	1	317.40	Replace	PA ✓
Standard	Main			HINGE ASSY, FRONT DOOR UPPER LH	1	105.50	105.50	25.00	79.13	Replace	0	0	Check	
Standard	Main			HINGE ASSY, FRONT DOOR LOWER LH	1	120.00	120.00	25.00	90.00	Replace	0	0	Check	
Standard	Main			DOOR FRONT WINDOW REGULATOR SUB-ASSY, LH	1	257.80	257.80	25.00	193.35	Replace	0	0	Check	
Standard	Main			DOOR FRONT MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	996.60	996.60	10.00	896.94	Replace	0	0	Check	
Standard	Main			STICKER STRIDES TAXI (DOOR)	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	me ✓
Standard	Main			WIRE, FRONT DOOR, LH	1	513.50	513.50	10.00	462.15	Replace	0	0	Not Give	
Standard	Main			PANEL SUB-ASSY, REAR DOOR, LH	1	1,401.70	1,401.70	25.00	1,051.28	Replace	1	1,051.28	Replace	PA ✓
Standard	Main			CHECK ASSY, REAR DOOR	1	199.40	199.40	25.00	149.55	Replace	0	0	Not Give	
Standard	Main			HINGE ASSY, REAR DOOR, UPPER LH	1	107.00	107.00	25.00	80.25	Replace	0	0	Not Give	
Standard	Main			HINGE ASSY, REAR DOOR, LOWER LH	1	93.90	93.90	25.00	70.43	Replace	0	0	Not Give	
Standard	Main			DOOR REAR MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	996.60	996.60	10.00	896.94	Replace	0	0	Not Give	
Standard	Main			DOOR REAR WINDOW REGULATOR SUB-ASSY, LH	1	223.50	223.50	25.00	167.63	Replace	0	0	Not Give	
Total Spare Part Cost									9,543.13	Surveyor Total 3,324.39				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)				
Final Spare Part Cost									7,634.50	Final Sur Total 2,659.31				

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR LH PORTION	1,352.00	600	
Total:			1,352.00	600.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY FRONT FENDER LH	378.00	200	
2	Main	TO RESPRAY APRON PANEL LH	180.00	0	
3	Main	TO RESPRAY FRONT PILLAR LH	180.00	0	
4	Main	TO RESPRAY FRONT DOOR LH	378.00	200	
5	Main	TO RESPRAY VIEW MIRROR	180.00	50	
6	Main	TO RESPRAY ROCKER PANEL MOULDING	180.00	150	
7	Main	TO RESPRAY SILL MEMBER LH	180.00	0	
8	Main	TO RESRAY REAR DOOR LH	378.00	200	
9	Main	TO RESPRAY CENTRE PILLAR LH	180.00	0	
10	Main	TO RESPRAY DOOR HANDLE	180.00	40	
Total:			2,394.00	840.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO WASH AND VACUUM	60.00	0	
2	Main	TO CHECK WIRING AND SYSTEM FUNCTION	120.00	20	
3	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	80	
4	Main	TO TRANSFER DOOR MECHANISM	240.00	120	
5	Main	TO REPLACE SUNDRY PARTS	100.00	0	
Total:			620.00	230.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	7,634.50	2,659.51
Total Labour Cost	1,352.00	600.00
Total Spray Painting	2,394.00	840.00
Other	620.00	230.00

1/3/23, 1:43 PM

https://vacsweb.smr.com.sg/Estimation.aspx

	Estimator Assessment(\$)	Surveyor Assessment(\$)
Overall Total	12,000.50	4,329.51
Lump Sum Repair Option	☐	☒
Lump Sum Total	12,000.00	4,350.00
Surveyor Approved Amount		4,350.00
No of Repair Days*	8	4
Remarks	-	LUMPSUM REPAIR / AFTER PAINT PHOTOS, FOR CHECK ITEM and REPLACE ITEM PLEASE CALL SURVEYOR Kenneth Kong (LKK)
Surveyor Name		Kenneth Kong (LKK)
Signature		
		Save Clear
Survey Date	03/01/2023	