



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2303668

INV Date 09/06/2023

Reference CC4/LPC23000281/Apa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJV 8998J
Insured Veh. XE 3952Y
Claim No. 22/22/23/VC05/026806
Policy No. Z22VC05011298
Accident Date 05/01/2023
Inspection Date 11/01/2023

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC23000281/Apa3q2 Date: 09/06/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 3952Y	Veh. Inspected	SVJ 8998J	
Policy No.	Z22VC05011298	Coverage (\$)	0.00	
Claim No.	22/22/23/VC05/026806	Excess (\$)	0.00	
Assign From	CHARMAINE KONG	Assign Date	09/01/2023	
2. Vehicle Particulars & Condition				
Make & Model	AUDI A4	c.c	1395	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	WAUZZZF46HA025175	Colour	GOLD	
Odometer	113459 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	YOKOHAMA	6 mm	
L/H Front Tyre	205/60 R16	YOKOHAMA	6 mm	
R/H Rear Tyre	205/60 R16	YOKOHAMA	6 mm	
L/H Rear Tyre	205/60 R16	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/01/2023	Inspection Date	11/01/2023	
Survey held at	PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1 . SINGAPORE 408699			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJV 8998J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER (SN)	DISTORTED	2,515.00	2,515.00
1	FRONT BUMPER FIXING PARTS (SN)	NOT NECESSARY	641.00	-
2	FRONT BUMPER SECURING STRIP -LH/RH (SN)	NOT NECESSARY	84.00	-
1	FRONT BUMPER GRILLE -CENTER (SN)	NOT NECESSARY	231.00	-
1	FRONT BUMPER CLOSING ELEMENT -LOWER CENTRE (SN)	NOT NECESSARY	269.00	-
1	FRONT BUMPER AIR GUIDE - RH (SN)	NOT NECESSARY	75.00	-
1	RADIATOR GRILLE (SN)	CRACKED	1,310.00	1,310.00
1	FRONT BUMPER AIR GUIDE GRILLE - RH (SN)	NOT NECESSARY	159.00	-
1	FRONT BUMPER FOAM FILLER PIECE (SN)	NOT NECESSARY	147.00	-
1	FRONT BUMPER REINFORCEMENT BEAM (SN)	NOT NECESSARY	953.00	-
1	FRONT BUMPER GUIDE SECTION - RH (SN)	NOT NECESSARY	43.00	-
1	FRONT BUMPER TOP COVER (SN)	NOT NECESSARY	151.00	-
1	CAUTION SIGN STICKER (SN)	NOT NECESSARY	17.00	-
1	AIR CONDITIONER STICKER (SN)	NOT NECESSARY	9.00	-
1	FRONT BUMPER BRACKET (SN)	DAMAGED	163.00	162.50
2	FRONT BUMPER SUPPORT - LH / RH (SN)	NOT NECESSARY	68.00	-
1	HORN LOW TONE - RH (SN)	NOT NECESSARY	149.00	-
1	HORN BRACKET - RH (SN)	NOT NECESSARY	35.00	-
1	BONNET (SN)	DENTED	3,489.00	3,489.00
1	BONNET ATTACHMENT PARTS (SN)	NOT NECESSARY	455.00	-
1	BONNET IMPACT PROTECTION - CENTER (SN)	NECESSARY	34.00	33.60
2	BONNET IMPACT PROTECTION - LH / RH (SN)	NECESSARY	67.00	66.40
2	BONNET STRIKER - LH / RH (SN)	NOT NECESSARY	120.00	-
2	BONNET LOCK - LH / RH (SN)	NOT NECESSARY	481.00	-
1	BONNET BOWDEN CABLE (SN)	NOT NECESSARY	67.00	-
1	BONNET RELEASE LEVER (SN)	NOT NECESSARY	16.00	-
1	BONNET BOWDEN CABLE - CENTER (SN)	NOT NECESSARY	67.00	-
1	BONNET RELEASE CABLE COVER (SN)	NOT NECESSARY	12.00	-
1	FRONT FENDER LEDGE COVER - RH LONG (SN)	NOT NECESSARY	27.00	-
1	HEADLIGHT - RH (SN)	CUT	8,787.00	8,787.00

Report Ref No. CC4/LPC23000281/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LIFT CYLINDER - RH (SN)	NOT NECESSARY	244.00	-
1	LIFT CYLINDER CORRUGATED PIPE (SN)	NOT NECESSARY	111.00	-
1	OUTSIDE TEMPERATURE SENSOR BRACKET (SN)	NOT NECESSARY	22.00	-
1	RADIATOR AIR GUIDE - RH INNER (SN)	NOT NECESSARY	38.00	-
2	RADIATOR AIR GUIDE - LH / RH OUTER (SN)	CRACKED	50.00	24.90
1	RADIATOR AIR GUIDE - UPPER (SN)	NOT NECESSARY	25.00	-
1	RADIATOR AIR GUIDE - LOWER (SN)	NOT NECESSARY	38.00	-
1	INTAKE AIR DUCT - RH (SN)	NOT NECESSARY	38.00	-
1	ENGINE AIR INTAKE HOSE (SN)	NOT NECESSARY	67.00	-
1	INTAKE HOSE (SN)	NOT NECESSARY	114.00	-
1	AIR FILTER (SN)	NOT NECESSARY	443.00	-
1	LOCK CARRIER (SN)	NOT NECESSARY	1,569.00	-
6	READY-MIX COOLANT (SN)	NOT NECESSARY	326.00	-
1	FRONT NO PLATE (SN)	NECESSARY	60.00	60.00
1	SUNDRIES (SN)	NOT NECESSARY	400.00	-
			24,186.00	16,448.40
	LABOUR			
	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.		360.00	360.00
	TO REMOVE AND TRANSFER RHS HEADLIGHT'S CONTROL UNIT AND POWER MODULE.		350.00	350.00
	TO REMOVE AND REINSTALL AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	NOT NECESSARY	1,400.00	-
	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET AND RHS HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.		4,200.00	1,400.00
	TO RESPRAY FRONT BUMPER AND BONNET.		2,000.00	1,500.00
	TO CARRY OUT DIAGNOSTIC CHECK.		192.00	192.00
			8,502.00	3,802.00
	GRAND TOTAL		32,688.00	20,250.40

Report Ref No. CC4/LPC23000281/Apa3q2



RECOMMENDED COST OF REPAIRS			20,250.40
-----------------------------	--	--	-----------

Report Ref No. CC4/LPC23000281/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJV 8998J

INSPECTION

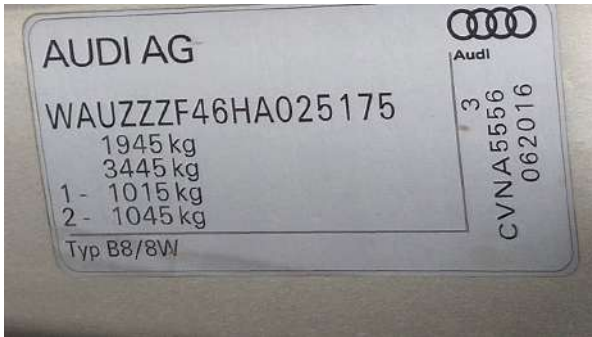



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJV 8998J

RE-INSPECTION

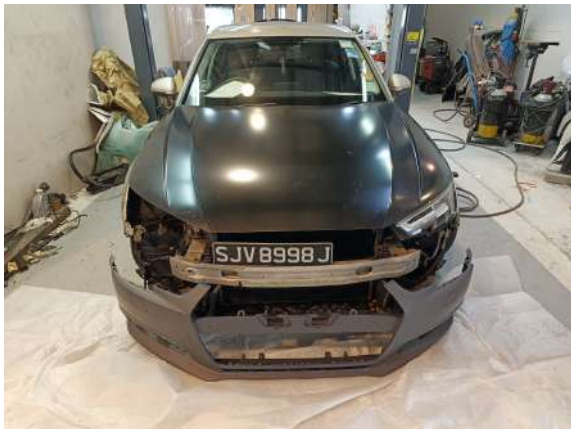



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

