

6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148 reg no: 53058468m

Claim Reference Insured Vehicle No. Thirty Party Veh No. Officer-In-Charge

Our Reference : KAAS/TA/6445/6424/TP/08.22

Date : 06 October 2022

To: Hua Hong Pte Ltd c/o 8 Kaki Bukit Ave 4

#06-31, Premier @ Kaki Bukit

Singapore 415875

VEHICLE APPRAISAL REPORT

Name of Workshop

: Oohray Rental Pte Ltd

Place of inspection

: 8 Kaki Bukit Ave 4 #06-31, Premier @ Kaki Bukit, Singapore 415875

Date of Assignment

: 08 August 2022

Date of Accident

; 06 August 2022

Date of Inspection

: 08 August 2022

PARTICULARS OF INSPECTED VEHICLE

Registration No.

: SMM 6424Z

Chassis Frame No.

: MMBSTA13AKH002111

Make / Model

Engine No. (Logcard)

: 3A92UHT5556

Year of Manufacture/Reg

Mitsubishi Attrage 1.2 CVT

Odometer Reading

: 17,300 KM

: 2019 Colour

: Silver

Class / Type Saloon

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition

: Very Good

Paintwork

Very Good

Market Value

Ü -

Scrap Value

CONDITION OF TYRES ON VEHICLE

		<u>Make/Size</u>	Thread Balance
Front	L	WANLI 195 / 50 R15	8 mm
Front	R	WANLI 195 / 50 R15	8 mm
Rear	L	WANLI 195 / 50 R15	8 mm
Rear	R	WANLI 195 / 50 R15	8 mm

^{*}The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148 reg no: 53058468m

Our Reference Vehicle Number : KAAS/TA/6445/6424/TP/08.22

: SMM 6424Z

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's	Revised	
				Estimate	Amount	
		LIST ITEMS:-				
1	1 pc	r/h rear door	buckled	\$ 976.0		
2	1 pc	r/h rear door inner lock	jammed	\$ 312.0		
3	1 pc	r/h rear door checker	bent	\$ 97.0		
4	1 pc	r/h rear door weatherstrip	deformed	\$ 188.0		
5	1 pc	r/h rear door window regulator w/ motor	damaged	\$ 562.0		
6	1 pc	r/h rear door window outer seal	deformed	\$ 110.0		
7	1 pc	r/h rear door inner trim board	broken	\$ 552.0		
8	1 pc	r/h rear door inner trim control panel	broken	\$ 124.0		
9	1 set	r/h rear door inner trim board clips	necessary	\$ 32.0		
10	2 pcs	r/h rear door hinges @S\$55.00	bent	\$ 110.0		
11	1 pc	r/h rear door qtr glass w/ moulding	damaged	\$ 565.00		
12	1 pc	r/h rear door speaker	not working	\$ 243.00		
13	1 pc	r/h front door	buckled	\$ 992.0		
14	1 pc	r/h side skirt	deformed	\$ 627.0		
15	1 pc	r/h rocker panel	buckled	repair	repair	
				\$ 5,490.00	\$ 5,490.00	
		Less 10%			\$ 549.00	
				\$ 5,490.00	\$ 4,941.00	
				1	1	
					1	
- 1						
				1		
				1		
				1		
		1				
				l .		
			Sub - Total	\$ 5,490.00	\$ 4,941.00	



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148 reg no: 53058468m Our Reference Vehicle Number : KAAS/TA/6445/6424/TP/08.22

: SMM 6424Z

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 5,490.00	\$ 4,941.00
		LABOUR & OTHER CHARGES:-			
1		To panel beat and renewal of all necessary damaged body parts		\$ 1,400.00	\$ 1,200.00
2		To check wiring and rewire		\$ 60.00	\$ 50.00
3		To remove and reinstall front door components		\$ 80.00	\$ 60.00
4		To remove and reinstall rear door components		\$ 80.00	\$ 60.00
5		To apply anti-rust		\$ 80.00	\$ 60.00
6		To putty and spray-paint of affected areas		\$ 1,200.00	\$ 1,000.00
				\$ 2,900.00	\$ 2,430.00
\perp			Sub - Total	\$ 8,390.00	\$ 7,371.00





6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148 reg no: 53058468m Our Reference Vehicle Number : KAAS/TA/6445/6424/TP/08.22

r : SMM 6424Z

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered Squarely to the RH Side portion of the vehicle.



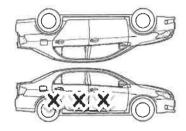



The general area of damages is at the

RH Side portion

(Please refer to the parts list and photographs as attached for more information)

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs

Oohray Rental Pte Ltd

\$ 8.390.00

We have adjusted the cost to

7,371.00 and the repairer has agreed to undertake the repairs at a

Contract Lump Sum of

\$ 5,900.00 to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of

working days.

56 photographs were taken at the time of static inspection.

This report is strictly done in a Without Prejudice Basis.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. we thank you for engaging our services.

6445

for our services rendered and

KELVIN AUTOMOTIVE APPRAISING SERVICES



KELVIN TEO

Licensed Automotive Appraiser
Nitec in Automotive Technology
Cert. Crash Investigation & Reconstruction
Dip MS
MSAAA, AM SAE-A

NOTE: This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.





































