16 January 2023



51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL: (065) 62563561 FAX: (065) 67414108

Your Ref: Honda Engine

(number L15A3676352)

Our Ref: CI/TP23000502/D

Loke Wai Kwong

Block 168A Queensway #11-224 Singapore 140168

INSPECTION REPORT OF A HONDA ENGINE WITH NUMBER L15A3676352

- 1. I refer to your request on 12 January 2023 to conduct a physical inspection of a Honda engine.
- 2. The purpose of this inspection was to primarily determine whether the Honda engine is a Honda L15A model engine.
- 3. Following the request, I had carried out a physical inspection of the Honda engine on 13 January 2023 at the premises of Miracle Workz Pte Ltd, 48 Toh Guan Road East #04-130 Enterprise Hub, Singapore 608586.
- 4. Measurements of the bore and stroke of the Honda engine were obtained and thereafter compared with the bore and stroke measurements as stated in the technical specifications of a Honda L15A model engine.
- 5. I now set out below my observations and comments regarding this inspection.

Inspection of the Honda Engine

- 6. Firstly, I had noted that the Honda engine was a used engine and not fitted on any motor car at the time of my inspection. It was observed to be a complete assembly with all mechanical parts still intact, within the engine housing. The engine number engraved on the housing was L15A3676352.
- 7. My visual examination of the engine housing revealed the housing to be of serviceable/satisfactory condition. There was no crack and/or hole observed on the engine housing.
- 8. Upon my request, the Honda engine was dismantled, specifically the top block was separated from the bottom block. This was to enable me to carry out measurements of its cylinders, in particular the bore and stroke measurements of each cylinder, which typically can be used to determine the engine displacement or more commonly referred to as engine cc or engine size. See photo 1 4 below.



Photo 1 shows a general view of the Honda engine that I had inspected. The Honda engine was observed to be a used engine and was not fitted on any motor car. It was also observed to be a complete assembly with all mechanical parts still intact, within the engine housing.



Photo 2 shows another view of the Honda engine that I had inspected. My visual examination of the engine housing revealed the housing to be of serviceable/satisfactory condition. There was no crack and/or hole observed on the engine housing.

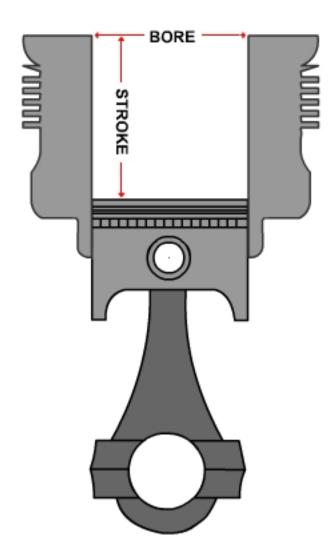


Photo 3 shows a closer view of the Honda engine that I had inspected. My visual examination of the engine housing revealed the housing to be of serviceable/satisfactory condition. There was no crack and/or hole observed on the engine housing.



Photo 4 shows the engine number engraved on the housing of the Honda engine that I had inspected. The engine number was L15A3676352.

9. The bore refers to the measurement of the inside diameter of the cylinder while the stroke refers to the distance the piston moves in one direction of upward or downward movement in the cylinder. See diagram below for illustration purposes.



10. The bore and stroke measurements of the 4 cylinders of the Honda engine are set out in the table below. Photo 5-21 thereafter shows the photographs taken during the measurements.

	Bore (mm)	Stroke (mm)
Cylinder 1	72.22	88.97
Cylinder 2	72.26	89.16
Cylinder 3	72.25	89.22
Cylinder 4	72.38	88.99

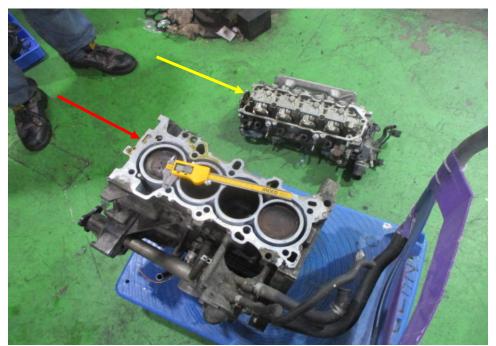


Photo 5 shows the top block (yellow arrow) of the Honda engine separated from its bottom block (red arrow). This was to enable me to carry out measurements of its cylinders, in particular the bore and stroke measurements of each cylinder, which typically can be used to determine the engine displacement or more commonly referred to as engine cc.

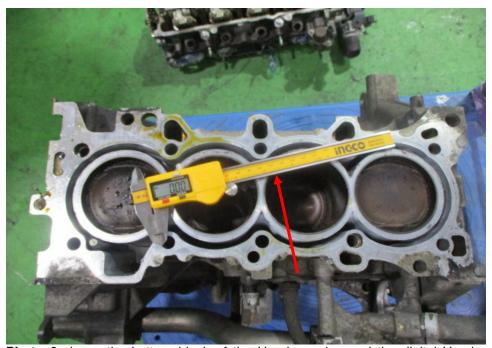


Photo 6 shows the bottom block of the Honda engine and the digital Vernier Caliper (arrowed) that was used to measure the bore and stroke measurements of each cylinder, which typically can be used to determine the engine displacement or more commonly referred to as engine cc. The digital Vernier Caliper was calibrated before the start of the measurements.



Auto



Photo 7 shows measurement being carried out to the bore (arrowed) of cylinder 1 of the Honda engine. The bore measurement of cylinder 1 was recorded to be 72.22mm.

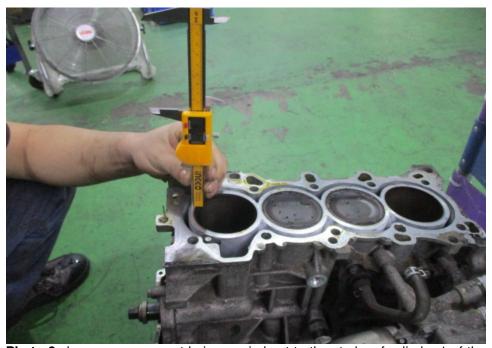


Photo 8 shows measurement being carried out to the stroke of cylinder 1 of the Honda engine. The bore and stroke measurements of the Honda engine were carried out using a digital Vernier Caliper that was calibrated before the start of the measurements.





Photo 9 shows measurement being carried out to the stroke (arrowed) of cylinder 1 of the Honda engine. The bore and stroke measurements of the Honda engine were carried out using a digital Vernier Caliper that was calibrated before the start of the measurements.



Photo 10 shows the stroke measurement of cylinder 1, which was recorded to be 88.97mm.

Auto





Photo 11 shows measurement being carried out to the bore (arrowed) of cylinder 2 of the Honda engine. The bore and stroke measurements of the Honda engine were carried out using a digital Vernier Caliper that was calibrated before the start of the measurements.

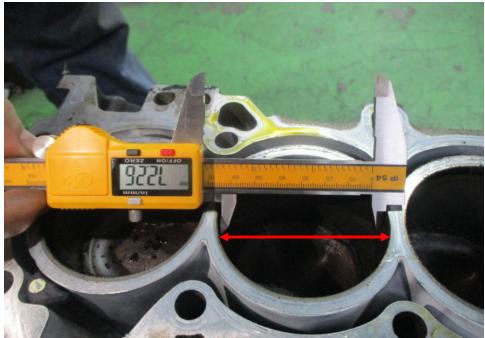


Photo 12 shows measurement being carried out to the bore (arrowed) of cylinder 2 of the Honda engine. The bore measurement of cylinder 2 was recorded to be 72.26mm.

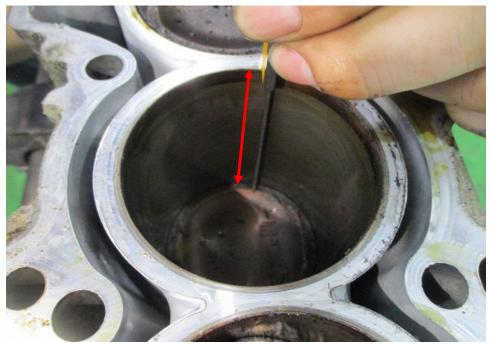


Photo 13 shows measurement being carried out to the stroke (arrowed) of cylinder 2 of the Honda engine. The bore and stroke measurements of the Honda engine were carried out using a digital Vernier Caliper that was calibrated before the start of the measurements.



Photo 14 shows the stroke measurement of cylinder 2, which was recorded to be 89.16mm.



Photo 15 shows measurement being carried out to the bore (arrowed) of cylinder 3 of the Honda engine. The bore measurement of cylinder 3 was recorded to be 72.25mm.



Photo 16 shows measurement of the stroke of cylinder 3 of the Honda engine that I had inspected. The bore and stroke measurements of the Honda engine were carried out using a digital Vernier Caliper that was calibrated before the start of measurements.



Photo 17 shows measurement being carried out to the stroke (arrowed) of cylinder 3 of the Honda engine. The bore and stroke measurements of the Honda engine were carried out using a digital Vernier Caliper that was calibrated before the start of the measurements.



Photo 18 shows the stroke measurement of cylinder 3, which was recorded to be 89.22mm.



Photo 19 shows measurement being carried out to the bore (arrowed) of cylinder 4 of the Honda engine. The bore measurement of cylinder 4 was recorded to be 72.38mm.

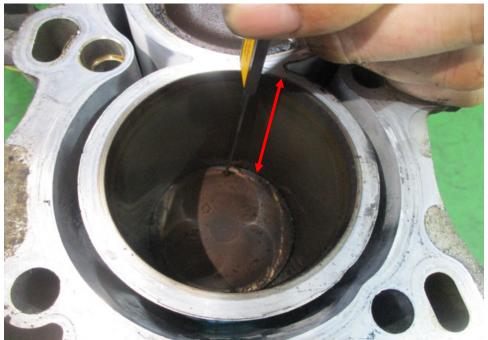


Photo 20 shows measurement being carried out to the stroke (arrowed) of cylinder 4 of the Honda engine. The bore and stroke measurements of the Honda engine were carried out using a digital Vernier Caliper that was calibrated prior to the start of measurements.



Photo 21 shows the stroke measurement of cylinder 4, which was recorded to be 88.99mm.

Honda L15A Engine Technical Specifications

- 11. In order to determine whether the Honda engine that I had inspected was a Honda L15A model engine, I had compared the measurements of the bore and stroke of the Honda engine with the bore size and stroke size of the Honda L15A model engine, as stated in its technical specifications. According to the technical specification of the Honda L15A model engine, the bore size and stroke size was 73.00mm and 89.40mm respectively.
- 12. Upon comparison, I note that the bore and stroke measurements of the Honda engine that I had inspected (shown in paragraph 10 above) had corresponded to the bore size and stroke size as stated in the technical specifications of a Honda L15A model engine. The measurements recorded from the Honda engine were all slightly lesser (at maximum 0.78mm lesser). This difference can be attributed to carbon accumulation within the cylinders, as the Honda engine that I had inspected was a used engine.
- 13. Since the bore and stroke of the Honda engine had corresponded to a Honda L15A model engine, the engine displacement of the Honda engine that I had inspected would then be 1496cc. See technical specifications of Honda L15A model engines below.



Engine Code: L15A

Fuel type: Petrol

Honda PGM-Fuel Fuel System:

Injection fuel injection

Lubrication: Wet sump

Engine Cooling:

Engine Alignment: Transverse

- Engine capacity:

Engine size - Displacement 1496 cm3 / 91.3 cu-in

Bore x Stroke : 73.00 x 89.40 mm

Number of valves: 16 Valves

Aspiration: N/A

Conclusion

14. In summary, the Honda engine that I had inspected was a Honda L15A model engine. The engine number engraved on the housing of this Honda engine was L15A3676352. The engine displacement of the Honda engine is 1496cc as per the technical specification.



Ang Bryan Tani

AMSOE, AMIRTE, AFF SAE, M.MATAI, AFF.Inst.AEA Senior Technical Investigator

Technical Investigation & Accident Reconstructionist (SAE-A)

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.