



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2303470

INV Date 01/06/2023

Reference CC4/LPC23000869/Uya3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMM 7867Y
Insured Veh. GBE 943D
Claim No. 22/23/23/VC05/026879
Policy No. Z22VC05012445
Accident Date 26/01/2023
Inspection Date 26/01/2023

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC23000869/Uya3q2 Date: 01/06/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBE 943D	Veh. Inspected	SMM 7867Y	
Policy No.	Z22VC05012445	Coverage (\$)	0.00	
Claim No.	22/23/23/VC05/026879	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	26/01/2023	
2. Vehicle Particulars & Condition				
Make & Model	HONDA JAZZ (A)	c.c	1318	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JHMGK3850KS218028	Colour	YELLOW	
Odometer	32483 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	175/65 R15	YOKOHAMA	7 mm	
L/H Front Tyre	175/65 R15	YOKOHAMA	7 mm	
R/H Rear Tyre	175/65 R15	YOKOHAMA	7 mm	
L/H Rear Tyre	175/65 R15	YOKOHAMA	7 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION & REAR WINDSCREEN SHATTERED. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	26/01/2023	Inspection Date	26/01/2023	
Survey held at	KAH MOTOR CO SDN BERHAD 15 UBI ROAD 4 SINGAPORE 408610			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMM 7867Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	GLASS SETRR.WINDSHIELD (SN)	SHATTERED	469.20	469.20
1	RUBBER CWINDSHIELD DAMPER (SN)	NECESSARY	9.22	9.22
2	RUBBERWINDSHIELD DAMPER (SN)	NECESSARY	11.40	11.40
1	DAMPERSTD 5X5 (SN)	NECESSARY	6.82	6.82
1	WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
1	TAIL GATE COMP (SN)	BADLY DENTED	586.57	586.57
1	EMBLEMRR (SN)	NECESSARY	9.37	9.37
1	WEATHERSTRIP TAILGATE (SN)	TORN	69.22	69.22
1	LOCK ASSY ,TAILGATE (SN)	SERVICEABLE	68.32	-
1	PANEL COMPRR (SN)	BADLY DENTED	257.17	257.17
1	LINING ASSY ,RR.PANEL (SN)	CUT	45.60	45.60
1	LIGHT ASSYHIGH MOUNT STOP (SN)	NOT NECESSARY	69.00	-
1	TAILLIGHT ASSY,R (SN)	NOT NECESSARY	193.80	-
1	TAILLIGHT ASSYL (SN)	NOT NECESSARY	193.80	-
1	GARNISH ASSY,RR LICENCE (SN)	CRACKED	84.67	84.67
1	LID ASSYSPARE TIRE (SN)	NOT NECESSARY	152.32	-
1	BOX ASSY ,CARGO FLOOR GATE (SN)	NOT NECESSARY	94.27	-
1	LINING ASSYTAILGATE LOWER (SN)	NOT NECESSARY	46.42	-
4	ACT RR SENSOR (SN)	SERVICEABLE	320.00	-
1	SOLAR FILM ON REAR WINDSCREEN (SN)	NECESSARY	300.00	300.00
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
1	FACE ,RR BUMPER (SN) (ADDITIONAL)	DENTED / DEFORMED	372.67	372.67
1	GARNISH,RR.BUMPER (SN) (ADDITIONAL)	GRAZED	30.75	30.75
1	DVR ,VUEROID 2 CHANNEL (SN) (ADDITIONAL)	DAMAGED	343.93	343.93
1	LINING ASSYTAILGATE LOWER (SN) (ADDITIONAL)	CUT	46.42	46.42
			3,890.94	2,723.01
<u>LABOUR</u>				
	INSPECT RR LIGHTING MECHANISMS .PERFORM WATER		180.00	160.00
	REMOVE & RENEW REVERSE SENSORS.		200.00	160.00

Report Ref No. CC4/LPC23000869/Uya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	BODY JOINT SEALANT .	NOT NECESSARY	100.00	100.00
	BODY UNDERSIDE COATING .		100.00	100.00
	APPLY BODY UNDERSIDE COATING.		250.00	250.00
	REMOVE & INSTALL REAR COMPARTMENT LININGS.		650.00	400.00
	REMOVE INSTALL & CALIBRATE REAR VIEW CAMERA.		450.00	350.00
	RESET VEHICLE SMART ENTRY SYSTEM.		450.00	350.00
	TO VACUUM & CLEAR SHATTERED GLASS .		450.00	-
	REMOVE & TRANSFER ITEMS TO NEW TAILGATE ADJUST &.		650.00	450.00
	REPLACE RR WINDSCREEN.		650.00	650.00
	CUT OFF & RENEW RR PANEL ,STRAIGHTEN ALIGN.		3,400.00	2,275.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS .		3,300.00	2,600.00
	RENEW 2-CH IN CAR CAMERA. (ADDITIONAL)		325.00	325.00
	TOWING SERVICE .(ADDITIONAL)		100.00	100.00
			11,255.00	8,270.00
GRAND TOTAL			15,145.94	10,993.01
RECOMMENDED COST OF REPAIRS				10,993.01

Report Ref No. CC4/LPC23000869/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 7867Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

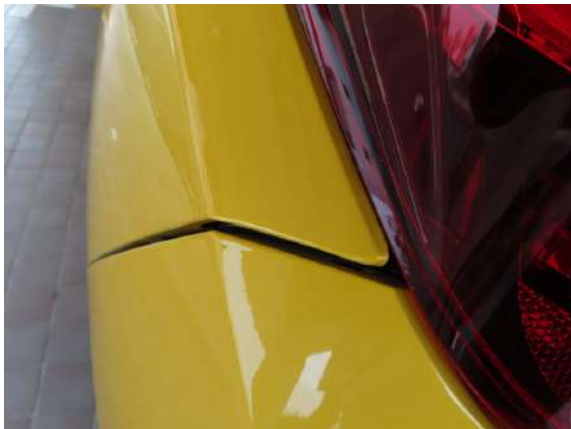



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

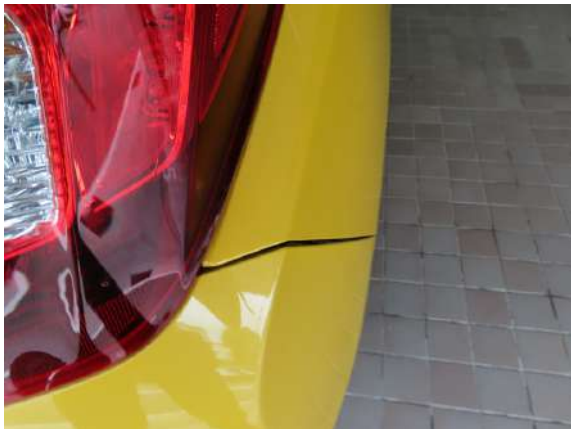



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 7867Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 7867Y

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

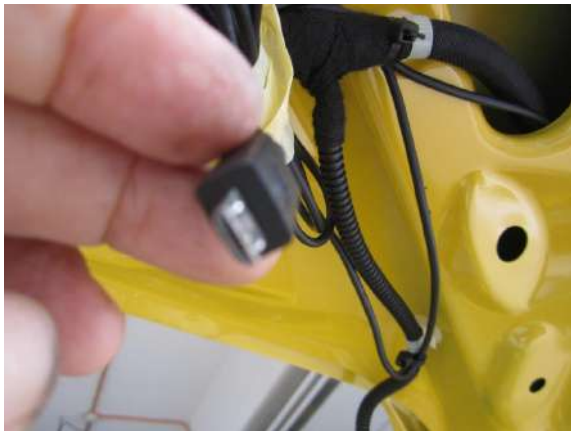



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

