

(08/11/13) wet

ASS - REC. BY: James

REF:

CC4/MS23001357/Rpa3

10617

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLZ 4321Tat Workshop m/s MOVAof 1008, BUKIT MERAH W3 # 01-04

Insured:

AIS

Policy No.

Claims No.

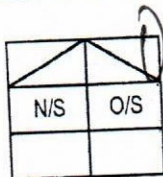
Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

72K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lump Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SLZ 4321T

Yr Regn:

2018 / MayType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Hyundai ELANTRA 1.6 GLS AT c.c. 1591

Colour:

GREY

A/C: Insured / Std / NI / NA

Sp. Reading

117063

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

KMH0841 CMJU 688035

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

03/02/23

D.O.I.

08/03/23

Survey held at

MOVA

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S Fac

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

REPAIR LIMIT - 44K

Date/Time, File Pass to?

☐

: Preli. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Report Format :

Lump Sum / I.B.I: (\$

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL



Main Office : No. 22, Jalan Kilang, Singapore 159419
Tel: 6476 3333 Fax: 6271 5891

Service Centre : Block 1008, Bukit Merah Lane 3,
#01-04/06/08/115, Singapore 159722
Tel: (65) 6476 3333 (8 Lines) Fax: (65) 6270 8314
www.mova.com.sg
GST Reg. No: M2-0088864-2

Mova Spray Centre
2K Oven Spray Painting System

Power-M Automotive Pte Ltd
Specialise In Car Air-con Services,
Car Audio & Hi-Fi System.

Hilton Car Rental Centre
Hilton Auto Trading

Dealing In New/Used Cars, Hire Purchase & Insurance.



TP INSURER:
UNKNOWN

Allianz Insurance Singapore Pte. Ltd. (HQ)

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:		Date of Loss:	03/02/2023
Vehicle Reg. No.:	SLZ4321T	Driveable?	
Party At Fault:	UNKNOWN		
Make/Model:	HYUNDAI ELANTRA, 1.6 (A)	Vehicle Reg. Date:	03/05/2018
Vehicle Colour:	SILVER	Chassis No:	KMHD841CMJU688035
Engine No:	G4FGJU188498		
Odometer:	0 KM		
Paint Type:	NO		
Total Loss?	7		
Est. Duration of Repair (day)			
Present Location:	MOVA AUTOMOTIVE PTE LTD (BUKIT MERAH)		

COST OF CLAIMS

	Amount
Parts	4,372.80
Miscellaneous Items	0.00
Labour	1,960.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$\$)	6,332.80
+ GST 8.00% (\$\$)	506.62
Nett Amount (\$\$)	6,839.42

This claim is handled by: BILLY

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG

Version: 1.0 (Last Synchronised: 06 Feb 2023)

Parts: 143

HYUNDAI ELANTRA 1.6 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's

(Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SLZ4321T)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*BONNET <i>bt</i>	0.00	0.00	*750.00 F ✓
2	1		*BONNET STICKER <i>ne</i>	0	0.00	<i>30/30</i> *58.00 FS
3	1		*BONNET TRIM <i>ne</i>	0	0.00	<i>30/30</i> *55.00 FS
4	1		*HEADLAMP ASSY RH <i>bn</i>	0.00	0.00	*25.00 F ✓
5	1		*HEADLAMP LOWER BRACKET RH <i>bn</i>	0.00	0.00	*95.00 F ✓
6	1		*WASHER TANK <i>de</i>	0.00	0.00	*400.00 F ✓
7	1		*FRONT BUMPER <i>de</i>	0.00	0.00	*18.00 F ✓
8	1		*FRONT BUMPER RETAINER RH <i>cut</i>	0.00	0.00	*20.00 F ✓
9	10		*FRONT BUMPER CLIPS <i>ne</i>	0.00	0.00	*30.00 F ✓
10	1		*FRONT BUMPER GRILLE RH <i>mis</i>	0.00	0.00	*25.00 F ✓
11	1		*FRONT BUMPER AIR DUCT RH <i>mis</i>	0	0.00	*45.00 FS ✓
12	1		*FRONT BUMPER TRIM <i>mis</i>	0.00	0.00	*400.00 F X
13	1		*SUPPORT PANEL <i>bn</i>	0.00	0.00	*450.00 F ✓
14	1		*FRONT FENDER RH <i>bt</i>	0.00	0.00	*55.00 F ✓
15	1		*FRONT FENDER COWLING RH <i>bn</i>	0.00	0.00	*20.00 F ✓
16	10		*FRONT FENDER COWLING CLIPS <i>ne</i>	0	0.00	<i>30/30</i> *58.00 FS
17	1		*FRONT FENDER LAMP STICKER <i>ne</i>	0	0.00	<i>30/30</i> *380.00 FS
18	1		*FRONT SPORT RIM RH <i>cut</i>	0.00	0.00	*205.00 F ✓
19	1		*FRONT KNUCKLE HUB BEARING RH <i>bt</i>	0.00	0.00	*240.00 F ✓
20	1		*FRONT KNUCKLE ARM RH <i>bt</i>	0.00	0.00	*165.00 F X
21	1		*FRONT LOWER ARM RH <i>bn</i>			
Sub Total (S\$)						<i>2883.00</i> 4,028.00
+ Margin on L,N Items 10.00% (S\$)						<i>+ 288.30</i> 344.80
Total Parts (S\$)						<i>3171.30</i> 4,372.80

F=Franchise part, S=Spocell.

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS*1) 3656.20*

2/6/23, 2:21 PM

Estimate Report

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	TO KNOCK & STRAIGHTEN FRONT BODY MEMBER, REMOVE & REPLACE ACCIDENT DAMAGED PARTS, REALIGN ALL CONNECTION	New	600 800.00
2	SPRAY PAINT BONNET, FRONT BUMPER, FRONT FENDER RH, FRONT FENDER INNER PANEL RH	New	700 800.00
3	REMOVE & REPLACE A/C CONDENSER, PIPE, HOSE & RECHARGE A/C GAS	New	X 120.00
4	REMOVE & REPLACE FRONT UNDER CARRIAGE SUSPENSION RH	New	80 150.00
5	COMPUTER WHEEL ALIGNMENT	New	60.00
6	RUST PROOF AFFECTED AREAS	New	30.00

Gross Labour Cost (\$\$) 21470.00 1,960.00

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

1) PARTS 3656.30
2) LABOUR 1470.00
5126.30
- 1025.26 less 20%
4101.04

Grand Sum \$ 4100.00
PLEASE ADVISE
THANK YOU
BILLY LAM.

Rene
Hp 90010068
6 days
L/S
08/03/23 @ 11:30
Rene after repair

Tyre Warehouse Pte. Ltd

BLK. 1002, Bukit Merah Lane 3
#01-89, Singapore 159719

Phone Number: 8828 7733 / 8866 7733 / 68163089
Fax Number:

Customer:
Company:
License NO: SLZ 4321 T
Odometer:

Date: 8/3/2023 2:30 PM
VIN
Technician:
Order NO:

VEHICLE ALIGNMENT REPORT HYUNDAI, ELANTRA, 11-11 (Customised)

Primary Angles			Initial	Specifications		Final
				Min.	Max.	
Front	Caster	Left	---	3°49'	4°49'	---
		Right	---	3°49'	4°49'	---
	Camber	Left	-0°23'	-1°00'	0°00'	-0°23'
		Right	-0°20'	-1°00'	0°00'	-0°20'
	Toe	Left	-0.28°	-0.14°	0.14°	-0.29°
		Right	-2.84°	-0.14°	0.14°	-2.84°
Rear	Camber	Total	-3.12°	-0.27°	0.27°	-3.13°
		Left	-1°14'	-1°30'	-0°30'	-1°14'
	Toe	Right	-1°11'	-1°30'	-0°30'	-1°11'
		Left	0.19°	0.00°	0.26°	0.18°
	Max Thrust Angle	Right	0.18°	0.00°	0.26°	0.17°
		Total	0.37°	0.00°	0.53°	0.35°
			0°00'	---	---	-0°01'
Secondary Angles			Initial	Specifications		Final
				Min.	Max.	
SAI	Included Angle	Left	---	12°52'	13°52'	---
		Right	---	12°52'	13°52'	---
Toe Out On Turns	Max Turn Inside	Left	---	---	---	---
		Right	---	---	---	---
Toe Curve Change	Setback	Left	---	---	---	---
		Right	---	---	---	---
Track Width Diff.	Wheel Base Diff.	Front	0.31"	---	---	0.31"
		Rear	-0.24"	---	---	-0.24"
Front Ride Height	Rear Ride Height	Left	-0.18"	---	---	-0.18"
		Right	0.54"	---	---	0.54"
Frame Angle		Left	---	---	---	---
		Right	---	---	---	---