

# PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/Adjusters Cargo Surveyors & Licensed Appraisers  
227 Simei St 4 #06-42 Singapore 520227 Fax: 64444886 Company Registration No. 53139926E



## AUTOMOBILE INSPECTION REPORT

To:

**KIM YONG WEI, LUTHER**  
**C/O 27A JURONG PORT ROAD**  
**#01-29 SINGAPORE 619101**

### INSURANCE DETAILS

Insured : -  
Policy No. / Claim No. : -  
Sum Insured : -  
Excess Clause : -  
Windscreen Coverage : -  
Type of Claims : Third Party Claims  
Third Party Insurer : -  
Third Party Policy No. : -

### REFERENCE

Assigned By : As above  
Accident Date : 15 December 2022  
Assignment Date : 16 December 2022  
Inspection Date : 16 November 2022  
Our Reference No. : PAS/HH/230108/TP

**Inspection Report Date : 30 January 2023**

**Workshop Name :**

**HUP HUP WORKSHOP PTE LTD**

**Inspection Address :**

**27A JURONG PORT ROAD #01-29**  
**SINGAPORE 619101**

### PARTICULARS OF VEHICLE

Registration No. : SMQ9215U  
Make/Model : HONDA CIVIC 1.6 VTI CVT  
Yr of Manuf/Regn : 10 Dec 2019  
Carrying Capacity : 4Seater  
Chassis No. : MRHFC5650KT001171  
Engine No. : R16B25511344  
Colour : Metallic Blue  
Class : Passenger (Private)

Mileage : 18747 Km/h  
Radio/Cassette : Fitted  
CD Disc Player : Fitted  
Air Conditioner : Fitted  
Clock : Fitted  
Seat Belt : Fitted  
Wing Mirror : Fitted  
Other Accessories : Fitted

### PRE-ACCIDENT CONDITION (Static Check Only)

Body Work : Good  
Paint Work : Good  
Handbrake : Serviceable  
Footbrake : Serviceable  
Steering : Serviceable  
Any Apparent : None  
Eng Modifications : None

### VEHICLE VALUE

Market Value : -  
Wreck Value (Part) : -

### TYRE SIZE & CONDITION

Front N/s Size : 215/55R16 80 %  
Make : HANKOOK  
Rear N/s size : 215/55R16 80 %  
Make : HANKOOK  
Spare Size : 215/55R16 80 %  
Make : HANKOOK

Front O/s Size : 215/55R16 80 %  
Make : HANKOOK  
Rear O/s Size : 215/55R16 80 %  
Make : HANKOOK  
Spare Size :  
Make :  
Jack & Tools : Intact

**Type of Wheel Rims: Alloy**


**Note: The above percentage % represent the estimated remaining tyre threads.**

# PRECISION APPRAISAL SERVICES

Insurance Loss Assessors / Adjusters Cargo Surveyors & Licensed Appraisers

VEHICLE REGISTRATION NO. : SMQ 9215 U


APPENDIX A

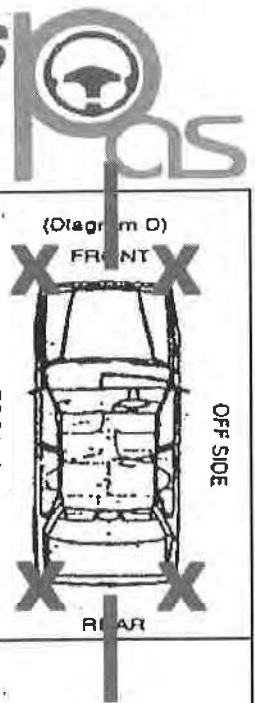

## POINT OF IMPACT (Diagram A)

Direction of impact/damage marked (→) (X)


The vehicle sustained impact on its Front & Rear Portion (see Diagram D)

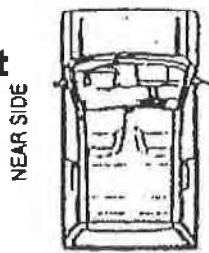

REAR

(Diagram B)


FRONT

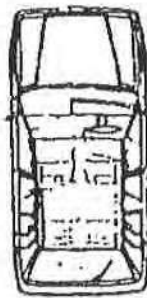

REAR

(Diagram C)


FRONT

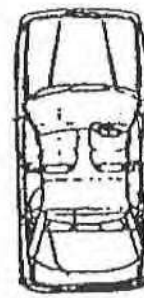

REAR

(Diagram D)

FRONT

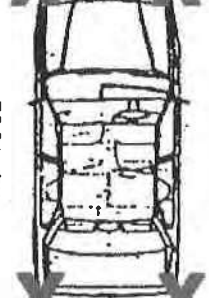

REAR

## GENERAL DESCRIPTION OF DAMAGES

Parts damaged were: The front and rear bumpers, both front and rear fenders and chassis, rear panel and reinforcement, front support panel were dented.

## ADJUSTMENTS & RECOMMENDATIONS

A static inspection was carried out on 16/12/2022 & our report is here with enclosed for your perusal. The Repairs Estimate submitted by M/s HUP HUP WORKSHOP PTE LTD as per attached Appraisement Schedule have been revised and scrutinised thoroughly by us & in our opinion, we consider it to be fair and reasonable. The repairer has agreed to effect repairs to the owners satisfaction & to roadworthy condition on an agreed Part - By - Part Repair Basis of \$8,824.40 after deducting the Policy Excess Clause of \$ NA. As instructed, we have not authorised any of the repairs on your behalf.

	Repairer's		Our	
	Estimate	Amount	Revised	Amount
Spares Parts	6845	50	5524	40
Towing Charges	X	X	X	X
PB Labour Charges	1600	00	1200	00
Others Misc Charges	720	00	500	00
Paintwork	2000	00	14600	00
Total	\$ 11165	50	\$ 8824	40

Under normal circumstances, the duration of repairs should not exceed Thirty - Two(32) days including Pre-Repair Inspection ( PRI ) / Pre - Repair Survey ( PRS ) waiting time frame.

Attached photographs taken during inspection One Hundred & Seventy (170) Photographs.

## SPECIAL REMARKS

1. The inspection was conducted on a 'without prejudice' basis
2. On 22/12/2022, we examined the extent of damages
3. On 10/01/2023, we examined the new replacement parts
4. On 16/01/2023, we examined the repaired vehicle.

Yours Faithfully,



T F PHILIP FOO  
AIMI CAE, AMIMI  
AIA ME, AMSA E-A  
Licensed Appraiser/Adjuster

Inspection Report Date: 30 January 2023

VEHICLE REGN NO : SMQ 9215 U  
 OUR REFERENCE : PAS/HH/230108/TP  
 INSPECTION REPORT DATE : 30-Jan-23

**APPRAISEMENT SCHEDULE**

CONTINUATION SHEET NO :

1

S/No	Qty	Parts / Labour Descriptions	Remarks / Condition	Repairer's Estimate Amount	Recommendation / Revised Amount
		<u>PARTS SUPPLY - LIST ITEMS</u>		\$ cts	\$ cts
1	1pc	Front bumper	Badly Dented/Torn	679.10	679.10 579 ✓
2	8pcs	Front bumper clips@\$40	Necessary ✓	30.00	30.00 X-na
3	1pc	N/s Headlamp	Cracked	868.50	868.50 675 ✓
4	1pc	O/s Headlamp	Cracked	868.50	868.50 675 ✓
5	1pc	N/s Headlamp top garnish chrome	Cracked	105.80	105.80 ✓
6	1pc	O/s Headlamp top garnish chrome	Cracked	105.80	105.80 ✓
7	1pc	Front grille	Cracked	511.70	511.70 ✓
8	1pc	Front grille logo	Necessary	85.00	85.00 ✓cra
9	1pc	Bootlid	Badly Dented	824.40	824.40 554 ✓
10	1pc	Boot rubber	Torn/Deformed	89.10	89.10 ✓
11	1pc	Rear end panel	Badly Dented	398.40	398.40 ✓
12	1pc	Rear end panel reinforcement w bracket	Badly Dented	325.50	325.50 188 ✓
13	1pc	Bootlid upper lock	Bent	115.40	115.40 ✓
14	1pc	Rear bumper	Badly Dented	717.50	717.50 ✓
15	8pcs	Rear bumper clips@\$5	Necessary	40.00	40.00 30 ✓
16	1pc	Rear bumper lower spoiler w chrome	Badly Dented	228.50	228.50 ✓
17	1pc	Rear end panel top garnish	Bent/Warped	60.30	60.30 ✓
18	1pc	Rear bumper reflector garnish o/s	Dented	50.30	50.30 ✓
19	1set 2 pcs	Rear bumper reverse sensor	Dented/Jammed	501.70	501.70 298 ✓
			149 x 2	5466.80	
		Less: 20% Discount		-20%	1321.10
				4373.44	5284.40
		<u>SPECIAL NETT ITEMS</u>			
1	1set	Front no. plate and garnish	Dented	120.00	120.00 80
2	1set	Rear no. plate and garnish	Dented	120.00	120.00 45 25
				115 125	5524.40
		<u>LABOUR &amp; MISC. CHARGES</u>			
1		Remove the necessary affected parts, straighten both front and rear chassis, both front and rear fenders, front support panel and replace parts	105	1600.00	1200.00 1000
2		Putty and Spraypaint on all affected parts		2000.00	1600.00 1000
3		Check electrical		20.00	20.00 ✓
4		Remove and refit bootlid components		150.00	120.00 50
5		Rewire rear portion		50.00	30.00 ✓
6		Remove and refit rear bumper sensors		100.00	60.00 30
7		Rewire front portion and refocus both headlamp beam		100.00	60.00 30
8		Remove and refit LTA front and rear number plate seal including transportation		200.00	150.00 100
9		Remove and rewire reverse camera		100.00	60.00 30
			2290 2690		
				1165.50	8824.40

8 days

SUB / GRAND TOTAL

P/P - 6778.44

6792.44

7188.44

L/S - 5750.75

5750

PRECISION APPRAISAL SERVICES

*Ce.*