

(08/11/13) wef

ASS. REC. BY: Tayfiche

REF:

CS

053 / MCS23001814 / T9y3

ASSIGNMENT

Front: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 6 days Res.: Yes or No

Lump Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SLT 7956ZYr Regn: 2017 / NovType: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Mercedes BenzGLC 250

c.c

1991Colour: BlackA/C: Insured / Std / NI / NASp. Reading: 139629T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WDC 2533462 F3 * 13 141Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 235/55 R17R: ~ ~BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mm

D.O.A. _____

D.O.I. 21/02/23C 1045Survey held at Boss GarageDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

LS \$9350, 6 days (Red \$750, 7%)

Date/Time, File Pass to?

☐

Preli. Report

1) 06/07 Typist

☐

Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 6

Resurvey No. of Trip: _____

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Report Format : TPLump Sum ~~H.B.~~ (\$ 9350)

UNITED Appraisal And Management Pte Ltd

Motor Vehicle Appraiser and Insurance Loss Adjuster
No. 10 Kaki Bukit Ave 4 #06-75 Premier @ Kaki Bukit Singapore 415874
Handphone No. : +65 9146 1186 Email : united.appraisal@live.com.sg
Business Registration Nos. : 200817301N

VEHICLE INSPECTION REPORT

To : Lin Jin Hui

Our ref. : UAM23.02.16-AK-STP-CHH-SLT7956Z

Date : 16 May 2023

REFERENCE

Assign by	: Lin Jin Hui	Insured	: To be advice
Assign on	: 21 Feb 2023	Policy no.	: To be advice
Inspection on	: 21 Feb 2023	Claim no.	: To be advice
Accident on	: 07 Feb 2023	Sum insured	: To be advice
Workshop name	: Car Hub Holdings Pte Ltd	Excess	: Not applicable
Inspection at	: 143 Bukit Timah Road	3rd party Veh.	: To be advice
	Shell Petrol Station (Shell Autoserv)	3rd party ins.	: To be advice
	Singapore 229843		

PARTICULARS OF DAMAGED VEHICLE

Registration no.	: SLT7956Z	Odometer	: 139629 km
Make / Model	: Mercedes Benz GLC250 4matic Coupe	Chassis no.	: WDC2533462F313141
Regn. date	: 13 Nov 2017	Engine no.	: 27492031169655
Body colour	: Black	Engine cap.	: 1991 cc

PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)

Steering	: In order	Paintwork	: Good
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Good

TYRE CONDITION ON VEHICLE

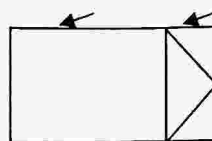
	Make	Size	Tread depth	Type of road wheel
Front N/S	: Michelin	235/55R19	70%	Alloy
Front O/S	: Michelin	235/55R19	70%	Alloy
Rear N/S	: Michelin	255/50R19	70%	Alloy
Rear O/S	: Michelin	255/50R19	70%	Alloy

NOTE: The above percentages represent the estimated remaining life of tyre threads.

* Denotes damaged component/s

POINT OF IMPACT

On the near side in the direction from front to rear.

**SYNOPSIS OF DAMAGES RESULTANT FROM THE ACCIDENT**

The impact of the collision has damaged / affected the n/s front fender, front door, wing mirror, rear door, rear fender and etc...

Please refer to Annex A (Appraisalment Schedule) for a detailed account of the damages and photographs taken.

Note: Reinspection vehicle on 22 Feb 2023 for repair in progress.

RECOMMENDATION

The estimate cost of repair submitted by Messrs Car Hub Holdings Pte Ltd as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairers have agreed to undertake the repairs to the owner's satisfaction at our revision. We have not authorised the repairs.

Our adjusted cost of repair is SGD 10,100.00 to carry out the repairs. Please refer to Annex A (Appraisalment Schedule) for a detailed account of the cost estimates.

REMARKS

We have not authorised the repair. However, for information, under normal circumstances, the repair would takes approximately 6 (Six) working days to complete.

In accordance to your instruction, we have **NOT AUTHORISED** the repair to the damaged vehicle and the survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

Yours faithfully,
United Appraisal & Management Pte Ltd



Ananda K. Biswas Marc
Motor Vehicle Appraiser

9096106
260
2375
472606
4589350
#6 days

APPRAISEMENT SCHEDULE

Annex A

Registration no. : SLT7956Z

Our reference : UAM23.02.16-AK-STP-CHH-SLT7956Z

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
<u>LIST ITEMS</u>					
1	1	Front fender n/s	Serviceable	895.20	0.00
2	1	Front door n/s	Refer To Labour	0.00	0.00 XR
3	1	Front door outer trim moulding upper n/s	Serviceable	274.00	0.00
4	1	Front door outer trim moulding lower n/s	Distorted	251.80	251.80
5	1	Wing mirror assy n/s	Damaged	1895.30	1895.30
6	1	Wing mirror outer cover n/s	Deep Grazed	320.00	320.00
7	1	Rear door n/s	Dented	2165.00	2165.00
8	1	Rear door applique trim n/s (black)	Bent	310.86	310.86
9	1	Rear door outer trim moulding lower n/s	Cut/Snapped	236.00	236.00
10	1	Rear door quarter glass n/s	Shattered	534.10	534.10
11	1	Rear door quarter glass trim moulding n/s	Deep Grazed	233.92	233.92
12	1	Rear fender n/s	Dented	3238.00	3238.00
13	1	Rear fender quarter glass n/s	Shattered	605.00	605.00
14	1	Rear fender quarter glass trim moulding n/s	Distorted	316.75	316.75
				11275.93	10106.73
Less 0% / 10%				0.00	1010.67
				11275.93	9096.06

SPECIAL NETT ITEMS

1	1	Sundries	Necessary	50.00	30.00
2	1set	Front fender wheel arch garnish clips n/s	Necessary	45.00	45.00 Xnn.
3	1set	Rear door trimboard clips n/s	Necessary	65.00	65.00 Xnn
4	1	Rear door sealant n/s	Necessary	120.00	100.00 50
5	1	Rear fender wheel arch garnish clips n/s	Necessary	45.00	45.00 30
6	1	Rear fender inner trim clips n/s	Necessary	75.00	75.00 Xnn.
7	1	Rear fender quarter glass primer & cleaner n/s	Necessary	100.00	80.00 60
8	1	Rear fender quarter glass inner seal n/s	Necessary	100.00	80.00 40
9	1	Rear fender quarter glass sealant n/s	Necessary	80.00	60.00 50
				680.00	580.00
TOTAL				11955.93	9676.06 260

LABOUR & MISC CHARGES

1	To dismantle / renew the accident damaged portion. To panel beating, reshape, straighten, orientate and align repair / replacement parts.	SGD350.00/day	1400.00	1050.00 900
2	To disconnect rear wire harness of electrical component to facilitate repairs, reconnect and check functions including taillamp lighting.		100.00	80.00 50
3	To remove and refit interior upholstery to facilitate the repair.		200.00	180.00 100

APPRAISEMENT SCHEDULE

Annex A

Registration no. : SLT7956Z

Our reference : UAM23.02.16-AK-STP-CHH-SLT7956Z

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
4		To remove and refit n/s rear door component to repair n/s rear door, check and alignment.		180.00	150.00 60
5		To remove and refit n/s rear fender glass for replacement.		150.00	80 120.00
6		To apply undercoating on the accident repair and replaced panel for rust protection.		200.00	60 180.00
7		Supply spray paint material and necessary items to respray n/s front fender, front door, rear door, rear fender and other affected area / panel.	SGD300.00/pnl	1500.00	1120 1200.00
TOTAL				3730.00	2370 2960.00
Total Parts and Labour Cost of Repair				15685.93	12636.06
Less (Lumpsum repair adjustment)					2536.06
Adjustment Parts and Labour Cost of Repair					10100.00

9096.06
 260
 2370
 11726.06
 11589350
 06 days
 #