

ASS. REC. BY:

REF:

08/AU 23001908/D 27³

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

Bel. or Market Value: _____

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 14 days Res.: Yes or No

Lum Sum: 9/P % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SME 2476S Yr Regn: Dec, 2017

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover / Truck / Trailer or

Make: Renault Grand Scenic c.c 1461

Colour: Red A/C: Insured / Std / NI / NA

Sp. Reading: N/A T/Radio: Insured / Std / NI / NA

Eng/No: K9KF649D021403

C/No: VF1RFA00059238203

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/55 R20
R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or Greenlander

Front _____ Rear _____

R/Bal. 5 mm R/Bal. 5 mm

L/Bal. 5 mm L/Bal. 5 mm

D.O.A. 13/02/2023 D.O.I. 21/02/2023

Survey held at Vin's Motor Sin Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or Rnd.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>Allianz OD</u>
	<u>MV 78k</u>
	<u>LTA 29.1k</u>
	<u>48.9k</u>

15/03/23 Resurvey and found 2 front chassis bent. Recommended to be total loss as structure affected.

15/3/23 Submit total loss report due to structure damage.

Date/Time, File Pass to? : Prel. Report : Final Report

Date/Time, File Return to? _____

Report Format: MER-OD/TL-C

Series: _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: : Site Insp (\$ _____)

: Interview (\$ _____)

: Tech. Inve (\$ _____)

Survey Fee: _____

Transportation: S + RS _____ \$

Photos: _____

Others: _____

Vin's

Vin's Motor Pte Ltd
160 Sin Ming Drive
#03-03 Sin Ming Autocity
Singapore 575722
Tel : 6453 2121 Fax : 6459 9795
GST Registration No. 199906067G

Estimated Cost of Repair

Attention To : Allianz Insurance Singapore Pte Ltd
79 Robinson Road
#09-01
Singapore 068897

Claim Details
Case Ref. No. : OD/022023/5984
Date : 13-02-2023
Accident Date : 13-02-2023

Vehicle Details

Make & Model : Renault GRAND SCENIC IV 1.5
DCI AT EU6
Chassis No : VF1RFA00059238203
Registration No : SME2476S

S/N	Description	Qty	Amount (\$\$)	
1	FRONT BONNET <i>bone</i>	1.00	\$1,150.00	✓
2	FRONT BONNET RH HINGE <i>bt</i>	1.00	\$110.00	✓
3	FRONT BONNET LH HINGE <i>bt</i>	1.00	\$110.00	✓
4	FRONT BONNET RH RUBBER <i>su</i>	1.00	\$60.00	X
5	FRONT BONNET LH RUBBER <i>su</i>	1.00	\$60.00	X
6	FRONT BONNET INSULATOR <i>crumpled</i>	1.00	\$150.00	✓
7	FRONT BONNET LOCK <i>bt</i>	1.00	\$200.00	✓
8	FRONT GRILLE BASE <i>broken</i>	1.00	\$400.00	✓
9	FRONT GRILLE OUTER CHROME GARNISH <i>crack</i>	1.00	\$290.00	✓
10	FRONT GRILLE MOULDING <i>bt</i>	1.00	\$190.00	✓
11	FRONT GRILLE LOWER CHROME MOULDING <i>crack</i>	1.00	\$270.00	✓
12	FRONT GRILLE EMBLEM <i>broken</i>	1.00	\$190.00	✓
13	FRONT RH HEADLAMP <i>broken</i>	1.00	\$770.00	✓
14	FRONT LH HEADLAMP <i>mounty crack</i>	1.00	\$770.00	✓
15	FRONT RH HEADLAMP BRACKET <i>bt</i>	1.00	\$50.00	✓
16	FRONT LH HEADLAMP BRACKET <i>mt</i>	1.00	\$50.00	X
17	FRONT BUMPER <i>toen</i>	1.00	\$1,450.00	✓
18	FRONT BUMPER LOWER PAD <i>distorted</i>	1.00	\$400.00	✓
19	FRONT BUMPER CENTRE LOWER GRILLE <i>deformed</i>	1.00	\$390.00	✓
20	FRONT BUMPER TOWING COVER <i>cut</i>	1.00	\$30.00	✓
21	FRONT BUMPER RH FOG LAMP <i>dislodged</i>	1.00	\$170.00	✓
22	FRONT BUMPER LH FOG LAMP <i>mt</i>	1.00	\$170.00	X
23	FRONT BUMPER RH FOG LAMP COVER <i>dislodged</i>	1.00	\$170.00	✓
24	FRONT BUMPER LH FOG LAMP COVER <i>mt</i>	1.00	\$170.00	X
25	FRONT BUMPER RH SIDE RETAINER <i>distorted</i>	1.00	\$110.00	✓
26	FRONT BUMPER LH SIDE RETAINER <i>mt</i>	1.00	\$110.00	X
27	FRONT BUMPER RH INNER PAD <i>broken</i>	1.00	\$90.00	✓
28	FRONT BUMPER LH INNER PAD <i>mt</i>	1.00	\$90.00	X
29	FRONT BUMPER SPONGE <i>broken</i>	1.00	\$80.00	✓
30	FRONT BUMPER REINFORCEMENT <i>bt</i>	1.00	\$630.00	✓

Vin's

Vin's Motor Pte Ltd
 160 Sin Ming Drive
 #03-03 Sin Ming Autocity
 Singapore 575722
 Tel : 6453 2121 Fax : 6459 9795
 GST Registration No. 199906067G

31	FRONT BUMPER REINFORCEMENT RH BRACKET <i>yt</i>	1.00	\$140.00	✓
32	FRONT BUMPER REINFORCEMENT LH BRACKET <i>yt</i>	1.00	\$140.00	✓
33	FRONT BUMPER UNDER COVER <i>crack</i>	1.00	\$450.00	✓
34	FRONT BUMPER CLIPS <i>huc</i>	10.00	\$30.00	✓
35	FRONT SUPPORT PANEL <i>broken</i>	1.00	\$1,050.00	✓
36	FRONT SUPPORT PANEL TOP COVER <i>broken</i>	1.00	\$130.00	✓
37	FRONT SUPPORT PANEL TOP COVER CLIPS <i>huc</i>	10.00	\$30.00	✓
38	AIRCON CONDENSER <i>yt</i>	1.00	\$880.00	✓
39	AIRCON CONDENSER DISCHARGE PIPE <i>yt</i>	1.00	\$350.00	✓
40	AIRCON CONDENSER RECEIVER PIPE <i>yt</i>	1.00	\$280.00	✓
41	AIRCON CONDENSER SUCTION PIPE <i>yt</i>	1.00	\$380.00	✓
42	RADIATOR <i>yt</i>	1.00	\$690.00	✓
43	RADIATOR TOP HOSE <i>deformed</i>	1.00	\$60.00	✓
44	RADIATOR LOWER HOSE <i>huc</i>	1.00	\$60.00	X
45	RADIATOR FAN MOTOR <i>broken</i>	1.00	\$870.00	✓
46	TURBO COOLER <i>Deformed</i>	1.00	\$780.00	✓
47	TURBO COOLER DUCT <i>broken</i>	1.00	\$150.00	✓
48	AIR CLEANER BOX <i>broken</i>	1.00	\$210.00	✓
49	AIR CLEANER BOX HOSE <i>deformed</i>	1.00	\$50.00	✓
50	ALTERNATOR ?	1.00	\$800.00	?
51	AIRCON COMPRESSOR ?	1.00	\$2,000.00	?
52	FAN BELT ?	1.00	\$60.00	?
53	WIPER TANK <i>huc</i>	1.00	\$160.00	X
54	FRONT RH FENDER <i>broken</i>	1.00	\$550.00	✓
55	FRONT RH FENDER INNER SHIELD <i>turn</i>	1.00	\$310.00	✓
56	FRONT RH FENDER INNER SHIELD CLIPS <i>huc</i>	10.00	\$30.00	X
57	FRONT LH FENDER <i>huc</i>	1.00	\$550.00	X
58	DASHBOARD <i>broken</i>	1.00	\$3,100.00	✓
59	DASHBOARD COVER <i>huc</i>	1.00	\$800.00	X
60	STEERING AIRBAG <i>activated</i>	1.00	\$950.00	✓
61	PASSENGER AIRBAG <i>activated</i>	1.00	\$1,000.00	✓
62	STEERING CLOCK SPRING SENSOR <i>activated</i>	1.00	\$600.00	✓
63	AIRBAG SENSOR <i>activated</i>	1.00	\$220.00	✓
64	AIRBAG ECU <i>activated</i>	1.00	\$1,200.00	✓
65	FRONT RH SEAT BELT <i>activated</i>	1.00	\$630.00	✓
66	FRONT LH SEAT BELT <i>activated</i>	1.00	\$630.00	✓
67	REAR RH SEAT BELT <i>activated</i>	1.00	\$730.00	✓
68	REAR LH SEAT BELT <i>activated</i>	1.00	\$730.00	✓
			\$30,660.00	
			\$3,066.00	
			\$33,726.00	
69	FRONT NO. PLATE <i>cut / scratched</i>	1.00	\$40.00	

Margin: 10%

Vin's


Vin's Motor Pte Ltd
160 Sin Ming Drive
#03-03 Sin Ming Autocity
Singapore 575722
Tel : 6453 2121 Fax : 6459 9795
GST Registration No. 199906067G

70	COOLANT 44	1.00	\$80.00 44
71	TO REFILL AIRCON GAS	1.00	\$150.00 120/-
72	TO RESET HEADLAMP SYSTEM AND ECU	1.00	\$280.00 7150/-
73	TO RESET AIRBAG SYSTEM AND ECU	1.00	\$380.00 350/-
74	TO REMOVE AND REPLACE DASHBOARD	1.00	\$380.00 180/- 250/-
75	TO REPAIR FRONT DAMAGES	1.00	\$980.00 900/-
76	TO SPRAY PAINTING	1.00	\$1,200.00 800/-
Subtotal w/o GST:			\$37,216.00

21/02/2023 @ 1630h

Mr Andrew

P/Pant.

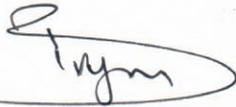

Excess ISA.

LKK club

- Photos after
repair with
damaged parts.

- No spare parts.
Need to indent.



LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Issued by Iswan

This is a computer-generated document. No signature is required.

Estimated Cost of Repair (Supplementary)

Attention To : Allianz Insurance Singapore Pte Ltd 79 Robinson Road #09-01 Singapore 068897	Claim Details Case Ref. No. : OD/022023/5984 Date : 13-02-2023 Accident Date : 13-02-2023
---	--

Vehicle Details

Make & Model : Renault GRAND SCENIC IV 1.5 DCI AT EU6
Chassis No : VF1RFA00059238203
Registration No : SME2476S

S/N	Description	Qty	Amount (\$\$)
1	FRONT SUPPORT PANEL AIR DUCT - INNER <i>broken</i>	1.00	\$270.00 ✓
2	FRONT SUPPORT PANEL AIR DUCT - OUTER <i>broken</i>	1.00	\$620.00 ✓
3	FRONT SUPPORT PANEL TOP RH BRACKET <i>bt</i>	1.00	\$360.00 ✓
4	FRONT SUPPORT PANEL TOP LH BRACKET <i>bt</i>	1.00	\$350.00 ✓
5	FRONT SUPPORT PANEL LOWER RH BRACKET <i>bt</i>	1.00	\$130.00 ✓
6	FRONT SUPPORT PANEL LOWER LH BRACKET <i>bt</i>	1.00	\$130.00 ✓
7	RADIATOR AIR DEFLECTOR AIR DUCT <i>broken</i>	1.00	\$160.00 ✓
8	RH HORN <i>broken</i>	1.00	\$260.00 ✓
9	ENGINE ECU COVER <i>broken</i>	1.00	\$170.00 ✓
10	THROTTLE BODY AIR HOSE <i>torn</i>	1.00	\$550.00 ✓
11	AIR CLEANER BOX AIR HOSE DUCT <i>broken</i>	1.00	\$950.00 ✓
12	RH FENDER BRACKET <i>bt</i>	1.00	\$190.00 ✓
13	BONNET LOCK CABLE <i>broken</i>	1.00	\$260.00 ✓
14	BONNET LOCK RELEASE HANDLE <i>broken</i>	1.00	\$90.00 ✓
15	ENGINE OIL DIPSTICK <i>broken</i>	1.00	\$240.00 ✓
16	RH WIPER GRILLE SIDE COVER <i>cut</i>	1.00	\$240.00 ✓
17	PARKING SENSOR <i>Dem</i>	1.00	\$750.00 ✓
18	PARKING SENSOR WIRE HARNESS <i>torn</i>	1.00	\$270.00 ✓
19	AIRCON TEMPERATURE SENSOR <i>dislodged</i>	1.00	\$170.00 ✓
20	BONNET COVER -BLACK <i>bt</i>	1.00	\$760.00 ✓
21	FRONT RH CHASSIS <i>Demol</i>	1.00	\$2,500.00 ✓
22	FRONT LH CHASSIS <i>bt</i>	1.00	\$2,500.00 ✓

\$11,920.00

Margin: 10%

\$1,192.00

\$13,112.00

Vin's


Vin's Motor Pte Ltd
160 Sin Ming Drive
#03-03 Sin Ming Autocity
Singapore 575722
Tel : 6453 2121 Fax : 6459 9795
GST Registration No. 199906067G

Subtotal w/o GST:


\$13,112.00

08/03/2023 @ 1000am

Hot Andrew

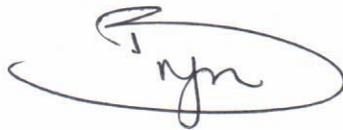

LKK Andrew

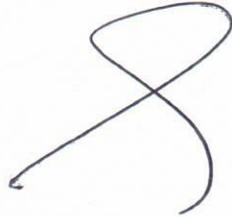

2 front chassis
affected.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Issued by Raymond Teo

This is a computer-generated document. No signature is required.