



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2303682

INV Date 12/06/2023

Reference CC4/LPC23002121/Upa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMK 5617B
Insured Veh. YP 430L
Claim No. 22/23/23/VC05/027034
Policy No. Z22VC05015041
Accident Date 27/02/2023
Inspection Date 27/02/2023

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC23002121/Upa3q2 Date: 12/06/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YP 430L	Veh. Inspected	SMK 5617B	
Policy No.	Z22VC05015041	Coverage (\$)	0.00	
Claim No.	22/23/23/VC05/027034	Excess (\$)	0.00	
Assign From	ENG HUEY NI	Assign Date	27/02/2023	
2. Vehicle Particulars & Condition				
Make & Model	HONDA JAZZ (A)	c.c	1318	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JHMGK3850KS213723	Colour	GREY	
Odometer	112791 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	175/65 R15	YOKOHAMA	7 mm	
L/H Front Tyre	175/65 R15	YOKOHAMA	7 mm	
R/H Rear Tyre	175/65 R15	YOKOHAMA	7 mm	
L/H Rear Tyre	175/65 R15	YOKOHAMA	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	27/02/2023	Inspection Date	27/02/2023	
Survey held at	KAH MOTOR CO SDN BERHAD 15 UBI ROAD 4 SINGAPORE 408610			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			11 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMK 5617B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	GLASS SETRR.WINDSHIELD (SN)	SHATTERED	469.20	469.20
1	RUBBER CWINDSHIELD DAMPER (SN)	NECESSARY	9.22	9.22
2	RUBBERWINDSHIELD DAMPER (SN)	NECESSARY	11.40	11.40
1	DAMPERSTD 5X5 (SN)	NECESSARY	6.82	6.82
2	WINDSCREEN SEALANT (SN)	NECESSARY	120.00	120.00
1	TAIL GATE COMP (SN)	BADLY DENTED	586.57	586.57
1	WEATHERSTRIPTAILGATE (SN)	SERVICEABLE	69.22	-
1	LOCK ASSY, TAILGATE (SN)	SERVICEABLE	68.32	-
1	FACE ,RR.BUMPER (SN)	DISTORTED	372.67	372.67
7	CLIP,BUMPER (SN)	NECESSARY	12.07	12.07
1	SPACER,L.RR.BUMPER SIDE (SN)	BENT	13.57	13.57
1	SPACER,R.RR.BUMPER SIDE (SN)	BENT	13.57	13.57
1	GARNISH,RR.BUMPER (SN)	CUT	30.75	30.75
1	COVER,L.RR.BUMPER (SN)	NOT NECESSARY	16.57	-
1	COVER,R.RR.BUMPER (SN)	CUT	16.57	16.57
4	ACT RR.SENSOR (SN)	SERVICEABLE	320.00	-
1	LINING ASSY,RR.PANEL (SN)	NOT NECESSARY	45.60	-
1	LINING ASSYL.TRUNK (SN)	NOT NECESSARY	135.60	-
1	LINING ASSYR.TRUNK (SN)	NOT NECESSARY	135.60	-
1	LID ASSYSPARE TIRE (SN)	NOT NECESSARY	152.32	-
1	SHELF ASSY,RR (SN)	NOT NECESSARY	181.35	-
1	PANEL COMPRR (SN)	BADLY DENTED	257.17	257.17
1	GUTTER COMP,R.RR.PILLAR (SN)	BADLY DENTED	71.17	71.17
1	PANEL SETR.R.OUTSIDE (SN)	BUCKLED	458.02	458.02
2	RUBBERRR QTR W/SHIELD (SN)	NECESSARY	15.60	15.60
1	CLIP A,QUARTER WINDSHIELD (SN)	NECESSARY	2.77	2.77
1	CLIP B,QUARTER WINDSHIELD (SN)	NECESSARY	2.92	2.92
1	CLIP C,QUARTER WINDSHIELD (SN)	NECESSARY	1.87	1.87
1	STIFFENER COMP ,R.RR (SN)	NOT NECESSARY	69.75	-
1	FRAME BR.RR (SN)	NOT NECESSARY	39.67	-
1	FLANGE ,RR.FRAME END (SN)	NOT NECESSARY	8.85	-

Report Ref No. CC4/LPC23002121/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DVR ,VUEROID 2 CHANNEL (SN)	MISSING	343.93	343.93
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
1	CAPPIVOT (SN) (ADDITIONAL)	TORN	4.35	4.35
1	TAILLIGHT ASSY,R (SN) (ADDITIONAL)	CRACKED	193.80	193.80
1	GARNISH ASSY,RR LICENCE (SN) (ADDITIONAL)	CUT	84.67	84.67
			4,391.53	3,118.68
	LABOUR			
	SUPPLY & INSTALL SOLAR FILM ON REAR WINDSCREEN		300.00	300.00
	INSPECT RR LIGHTING MECHANISMS PERFORM WATER		180.00	180.00
	REMOVE & REFIX REVERSE SENSORS .		200.00	160.00
	BODY JOINT SEALANT .		200.00	200.00
	BODY UNDERSIDE COATING .		100.00	100.00
	APPLY BODY UNDERSIDE COATING .		250.00	150.00
	REMOVE & INSTALL RR .R QTR GLASS .		450.00	300.00
	REMOVE & INSTALL REAR COMPARTMENT LININGS.		450.00	325.00
	RESET VEHICLE SMART ENTRY SYSTEM.		450.00	325.00
	REMOVE INSTALL & CALIBRATE REAR VIEW CAMERA.		450.00	325.00
	INSTALL IN-CAR DASHCAM.		450.00	325.00
	REMOVE & TRANSFER ITEMS TO NEW TAILGATE ADJUST & .		650.00	540.00
	REMOVE & INSTALL RR.WINDSCREEN .		650.00	650.00
	CUT & RENEW RR PANEL ,GUTTER AND RR FENDER .		6,800.00	4,550.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS .		3,200.00	3,100.00
			14,780.00	11,530.00
GRAND TOTAL			19,171.53	14,648.68
RECOMMENDED COST OF REPAIRS				14,648.68

Report Ref No. CC4/LPC23002121/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 5617B

INSPECTION

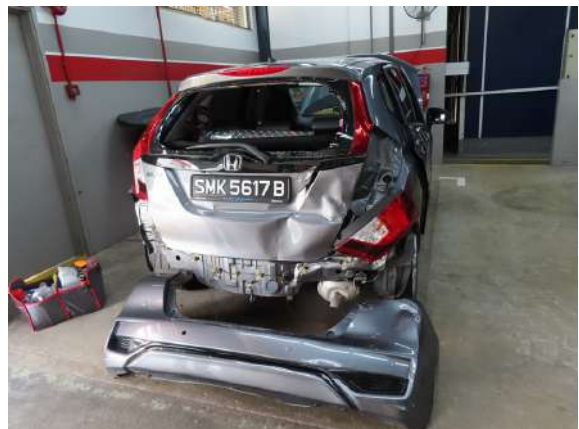



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

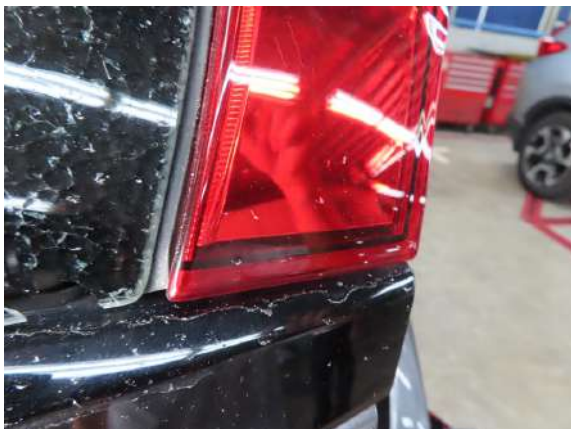



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

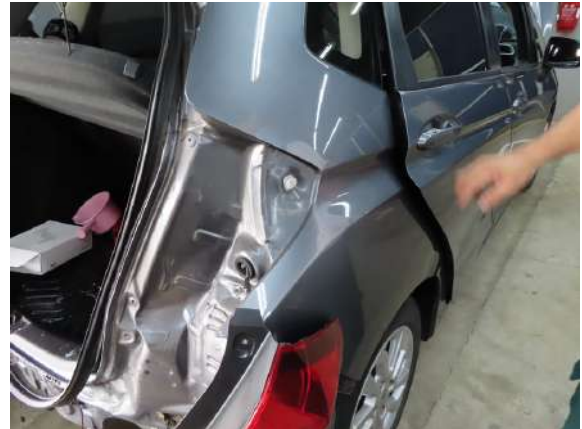




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

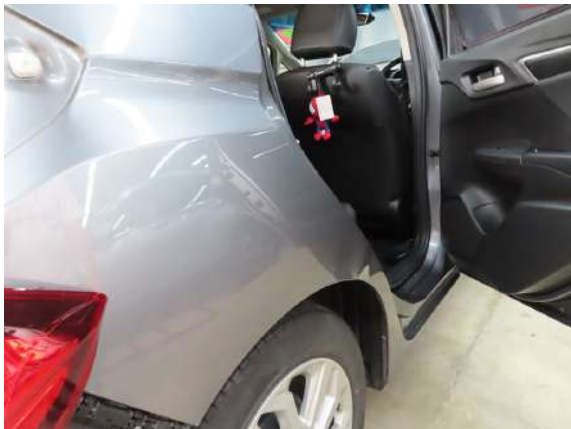




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

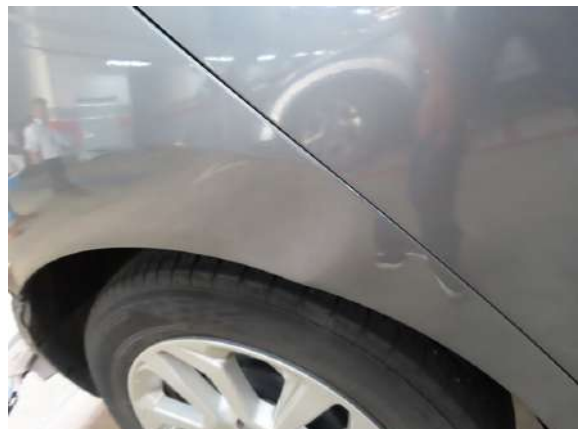



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMK 5617B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

