

Tommie Lim Appraisal

Block 126 Bishan Street 12 #08-147 Singapore 570126
Handphone No. : +65 97475163 Email : tommie126@yahoo.com.sg
ROC: 53448442E

VEHICLE INSPECTION REPORT

To : GO-LEASE PTE LTD
c/o : Team AutoPro Pte Ltd
160 Sin Ming Drive #02-12
Sin Ming AutoCity
Singapore 575722

REFERENCE

Ref. no.	: TLA/2022/12/009	3rd party Veh.	: QX1209G
Accident on	: 11 Dec 2022	Claim tyre	: Third Party
Assign on	: 13 Dec 2022	Claim number	: To be advice
Inspection on	: 13 Dec 2022	Policy number	: To be advice
Workshop name	: Team AutoPro Pte Ltd	Finalize on	: 17 Dec 2022
Inspection at	: 160 Sin Ming Drive #02-12 Sin Ming AutoCity Singapore 575722	Final report on	: 19 Dec 2022

PARTICULARS OF DAMAGED VEHICLE

Vehicle number	: SLQ3540G	Registration date	: 5 Jul 2017
Make	: HONDA	Chassis number	: RU31249576
Model	: VEZEL HYBRID	Engine number	: LEB5949594
Body colour	: WHITE	Engine capacity	: 1496 CC
Odometer	: 85079 KM	Transmission	: AUTOMATIC

PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)


Steering	: In order	Paintwork	: Good
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Good

TYRE CONDITION ON VEHICLE

	Make	Size	Tread depth	Type of road wheel
Front N/S	: Bridgestone	225/45R18	70%	Alloy
Front O/S	: Bridgestone	225/45R18	70%	Alloy
Rear N/S	: Nexen	225/50R18	80%	Alloy
Rear O/S	: Nexen	225/50R18	80%	Alloy

NOTE: The above percentages represent the estimated remaining life of tyre threads.

POINT OF IMPACT

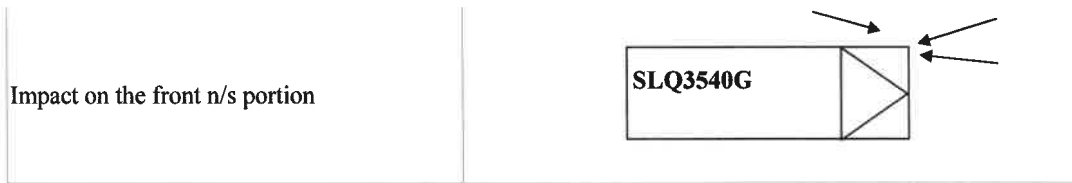

SYNOPSIS OF DAMAGES RESULTANT FROM THE ACCIDENT

The impact of the collision has damaged/affected the front n/s head lamp. Front bumper assy and etc...

Please refer to Annex A and Annex B (Appraisement Schedule) for a detailed account of the damages and photographs taken.

Note: Reinspection of the vehicle on 14/12/2022 for repair is in progress.

RECOMMENDATION

The estimate cost of repair submitted by Messrs Team AutoPro Pte Ltd as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairers have agreed to undertake the repairs to the owner's satisfaction at our revision. We have not authorised the repairs.

Our adjusted cost of repair is SGD 3,400.00 to carry out the repairs. Please refer to Annex A (Appraisement Schedule) for a detailed account of the cost estimates.


REMARKS

We have not authorised the repair. However, for information, under normal circumstances, the repair would takes approximately 4 (four) working days to complete.

In accordance to your instruction, we have **NOT AUTHORISED** the repair to the damaged vehicle and the survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

Yours faithfully,
Tommie Lim Appraisal



Tommie Lim
Motor Vehicle Appraiser

APPRAISEMENT SCHEDULE



Registration no. : SLQ3540G

Vehicle Model : HONDA
VEZEL HYBRID

S/N	Qty	Description	Condition	Estimate by Wshop SGD	Adjusted Amt SGD
-----	-----	-------------	-----------	--------------------------	---------------------

LIST ITEMS

1	1	Front bumper	Deformed	1,050.10	1,050.10
2	2	Front bumper side retainer	N/S Cracked	144.40	72.20
3	1	Front bumper fog lamp LH	Cracked	456.70	456.70
4	1	Front bumper fog lamp garnish LH	Cracked	126.20	126.20
5	1	Front bumper lower diffuser	Serviceable	485.60	0.00
6	1	Front bumper reinforcement	Serviceable	486.10	0.00
7	1	Head lamp LH	Cracked	2,145.90	2,145.90
8	1	Head lamp lower bracket LH	Cracked	76.10	76.10
9	1	Front grille	Serviceable	582.30	0.00
10	1	Front grille emblem logo	Serviceable	89.10	0.00
11	1	Front grille side bracket	Cracked	87.30	87.30
12	1	Front grille base	Serviceable	413.60	0.00
13	1	Front grille moulding	Serviceable	368.10	0.00
14	1	Front fender LH	Serviceable	756.10	0.00
15	1	Front fender inner shield LH	Serviceable	134.20	0.00
16	1	Front fender emblem HYDRID LH	Serviceable	117.40	0.00
17	1	Front fender arch garnish LH	Cracked/Deformed	128.90	128.90
18	1	Front support panel	Serviceable	898.10	0.00
19	1	Front support panel top garnish	Serviceable	185.10	0.00

Sub-total	8,731.30	4,143.40
Less 20%	1,746.26	828.68
Total	6,985.04	3,314.72

SPECIAL NETT ITEMS

1	1	Sundries	Not Necessary	100.00	0.00
2	1set	Front bumper clips	Cracked/Deformed	50.00	30.00
3	1set	Front grille clips	Cracked/Deformed	50.00	30.00
4	1set	Front fender inner shield clips	Cracked/Deformed	50.00	30.00
5	1set	Front support panel top garnish clips	Cracked/Deformed	50.00	30.00

300.00	120.00
--------	--------

TOTAL FOR SPARE PARTS	7,285.04	3,434.72
------------------------------	----------	----------

APPRAISEMENT SCHEDULE

Registration no. : SLQ3540G

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
<u>LABOUR & MISC CHARGES</u>					
1		To check the wiring system to facilitate the repair and refit the same		100.00	30.00
2		Diagnostic & reset fault code		300.00	200.00
3		Remove and refit the radiator and conduct a pressure test		200.00	0.00
4		Remove and refit the air condenser and refill the aircon gas		200.00	0.00
5		To remove, renew and refit all accident-damaged parts. Cut, weld, panel beat, and straighten all accident damage areas and fit the above same		100.00	300.00
6		To spray anti-rust on accident-affected panel		100.00	0.00
7		To putty and spray paint on all accident damage parts and other accident-affected areas		1,000.00	300.00
TOTAL FOR LABOUR AND SPRAY PAINTING				2,000.00	830.00

SUMMARY

Total Parts and Labour Cost of Repair	9,285.04	4,264.72
Less 20% (Lumpsum repair adjustment)		852.94
		3,411.78
ADJUSTED PARTS AND LABOUR COST OF REPAIR		3,400.00


















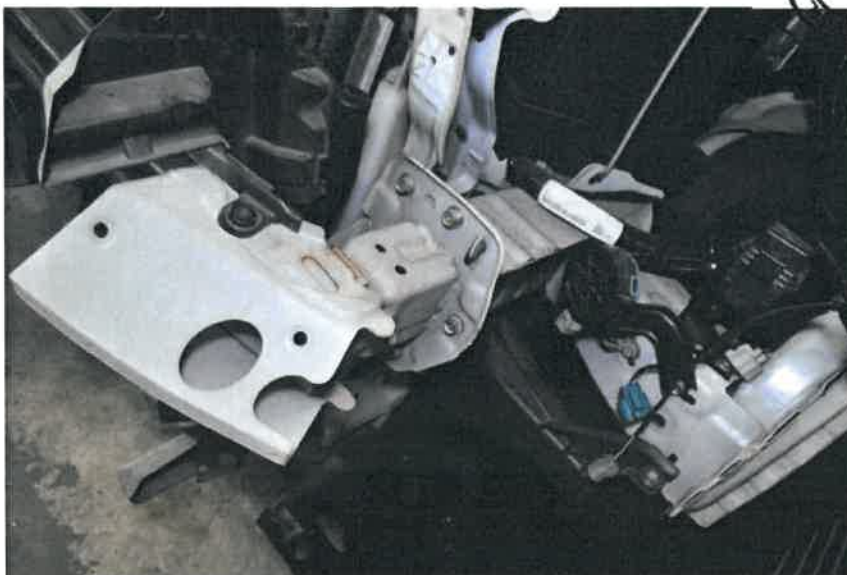

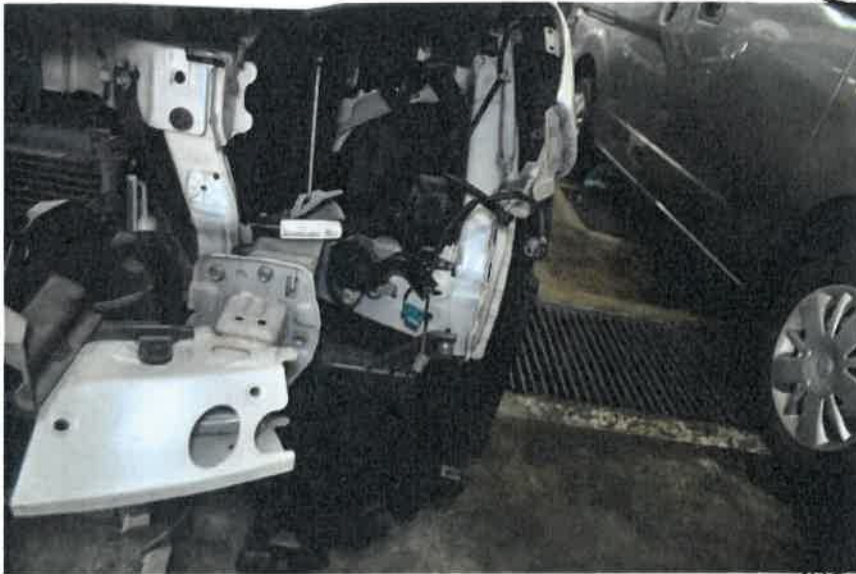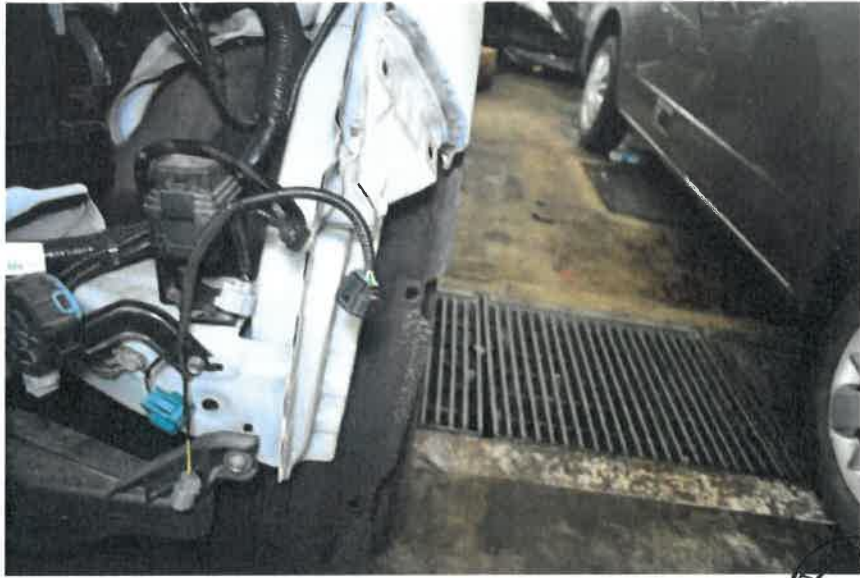

SLQ
3540G

