

Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 110A Arab Street Singapore 199806

Mobile: 98586761 / 96786893 Fax: 62970270

Mailing Address : 161 Alexandra Post Office Singapore 911506

Email: ttrajan.stappraisal@gmail.com

Date : 1st Nov 2022

Our Ref : TP / ATP SLB8630B/ 05.14/22

Your Ref :

M/s AL Autorent Pte Ltd
210 Turf Club Road
Lot B1 The Grand Stand
Singapore 287995

DAMAGED VEHICLE (SLB 8630 B) INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows:-

(A) Reference

Name of Claimant	: M/s AL Autorent Pte Ltd	Date of Request	: 8 th Jul 2022
		Referred By	: Person In charge
Policy No.	: Please Advice	Date of Inspection	: 8 th Jul 2022
Claim No.	: Please Advice	Date of Re-inspection	:
Accident Date	: 14 th May 2022	Sum Insured	: NA
Repairer	: M/s AT Performance	Excess Amount	: NA
	160 Sin Ming Drive #07-19	3 rd Party Vehicle	: Please Advice
	Sin Ming Autocity, Singapore 575722	3 rd Party Insurer	: Please Advice

(B) Particulars of Vehicle

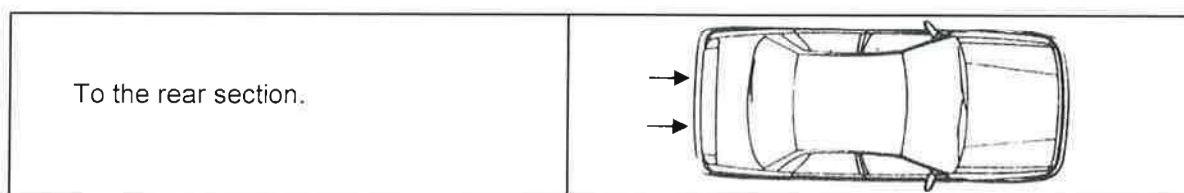
Registration No	: SLB 8630 B	Mileage	: 309318 Km
Make & Model	: TOYOTA COROLLA 1.6L	Engine No	: 1ZRX560144
Date of Registration	: 25 th Apr 2016	Chassis No.	: MR053REH104547945
Colour	: Brown	Engine Capacity	: 1,598 cc

(C) Pre-Accident Condition (Static Test Only)

Steering	: Serviceable	Paint Work	: Good
Foot-brake	: Serviceable	Modification	: NIL
Hand-brake	: Serviceable	General Condition	: Good

(D) Tyre Condition

	Tread Depth	Make	Size
Front Left	60 %	RAPID	205/55 R16
Front Right	60 %	RAPID	205/55 R16
Rear Left	60 %	RAPID	205/55 R16
Rear Right	60 %	RAPID	205/55 R16

(E) Point of Impact**(F) General Description of Damages**

The impact of the collision has damaged/affected the rear bumper, rear bumper parking sensor, rear bumper reinforcement and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken.

(G) Recommendation

We have inspected thoroughly the actual damages found on the vehicle, before we arrived at our recommendation as to whether the parts needed replacement or repairs.

Our adjusted cost of lump sum repair is **\$2,800.00** and an estimated **4** days is required to repair the vehicle. Please refer to the Annex for a detailed account of the cost estimates.

(H) Remarks

We have not authorised the repairs. However for information, under normal circumstances, the repairs should not exceed **4** days.

This inspection was conducted on a “**without prejudice**” basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

ST Appraisal Services

T T RAJAN
MVI, ITC (Mechanical), NTC (Motor Vehicle)
ASIET, MSAAA, Assessor/Appraiser
AD041-2007532D

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS FOR VEHICLE NO: SLB 8630 B

Adjustment of Spare Parts Costs for Repairs

Item	Qty	Vehicle parts description	Condition / Remark	Estimated by workshop	Disc. (%)	Adjusted cost (\$S)
1	1	Rear bumper	cut/damaged	684 ✓ 891.24	25	668.43
2	2	Rear bumper side holder	affected	142.86 ✓	25	107.15
3	2	Rear bumper side retainer	affected	188.40 ✓	25	141.30
4	1	Rear bumper reinforcement	dented	399 ✓ 627.40	25	470.55
5	2	Rear bumper reflector	cracked	149.08	25	111.81 X nn
6	1 set	Rear bumper clip	necessary	28.00 ✓	25	21.00
7	2	Rear bumper sensor	malfunction	292.00 ✓	25	219.00
8	1	Rear end panel	to repair	774.60	100	0.00 X R
9	1	Bootlid lock sensor	damaged	178.60 ✓	25	133.95
10	1	Bootlid	to repair	-		- X R
				1912.86		
				-25%		
				1434.64		
		<u>Special Nett Items</u>				
1	1	Sundries	necessary	40.00		30.00 ✓
			30			
				3312.18		1903.19

Adjustment of Labour Costs for Repairs

To remove and replace damaged parts including straightening and repositioning replacement parts.	750.00	550.00	400
Supply paint material and necessary items. To respray replaced and other affected panels.	850.00	700.00	600
To remove and refit boot compartment fittings & attachments to facilitate repair.	150.00	100.00	X
To carry out anti rust treatment.	120.00	80.00	30
To check electrical systems for proper functions.	100.00	60.00	30
To install rear bumper sensor.	80.00	60.00	30
	2554.64		
	L/S - 2043.71		
	= 2050		
4 days			
Total labour	2050.00	1550.00	

Adjustment Parts and Labour Costs of Repairs

	Estimated by workshop	Adjusted cost
TOTAL PARTS COSTS	3312.18	1903.19
TOTAL LABOUR COSTS	2050.00	1550.00
TOTAL REPAIR COSTS	5362.18	3453.19

ADJUSTED REPAIR COST

2800.00