

UNITED Appraisal And Management Pte Ltd

Motor Vehicle Appraiser and Insurance Loss Adjuster
No. 10 Kaki Bukit Ave 4 #06-75 Premier @ Kaki Bukit Singapore 415874
Handphone No. : +65 9146 1186 Email : united.appraisal@live.com.sg
Business Registration Nos. : 200817301N

VEHICLE INSPECTION REPORT

To : Tan Cher Chay

Our ref. : UAM22.10.03-MF-STP-HMS-SFL3131B

Date : 21 Nov 2022

REFERENCE

Assign by	: Tan Cher Chay	Insured	: To be advice
Assign on	: 05 Oct 2022	Policy no.	: To be advice
Inspection on	: 05 Oct 2022	Claim no.	: To be advice
Accident on	: 02 Oct 2022	Sum insured	: To be advice
Workshop name	: Hong Motor Service	Excess	: Not applicable
Inspection at	: Blk 5035 Ang Mo Kio Ind. Park 2 #01-365 Singapore 569538	3rd party Veh.	: To be advice
		3rd party ins.	: To be advice

PARTICULARS OF DAMAGED VEHICLE

Registration no.	: SFL3131B	Odometer	: 191064 km
Make / Model	: Toyota Camry 2.0 Auto Abs Airbag	Chassis no.	: MR053BK4107020292
Regn. date	: 02 Jan 2008	Engine no.	: 1AZE069992
Body colour	: Silver	Engine cap.	: 1998 cc

PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)

Steering	: In order	Paintwork	: Good
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Good

TYRE CONDITION ON VEHICLE

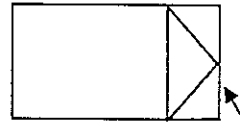
	Make	Size	Tread depth	Type of road wheel
Front N/S	: Bridgestone	215/60R16	70%	Alloy
Front O/S	: Bridgestone	215/60R16	70%	Alloy
Rear N/S	: Bridgestone	215/60R16	70%	Alloy
Rear O/S	: Bridgestone	215/60R16	70%	Alloy

NOTE: The above percentages represent the estimated remaining life of tyre threads.

* Denotes damaged component/s

POINT OF IMPACT

On the front in the direction from right to left.

**SYNOPSIS OF DAMAGES RESULTANT FROM THE ACCIDENT**

The impact of the collision has damaged / affected the front bumper, front grille, brace panel and etc...

Please refer to Annex A (Appraisal Schedule) for a detailed account of the damages and photographs taken.

Note: Reinspection vehicle on 18 Oct 2022 for repair in progress.

RECOMMENDATION

The estimate cost of repair submitted by Messrs Hong Motor Service as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairers have agreed to undertake the repairs to the owner's satisfaction at our revision. We have not authorised the repairs.

Our adjusted cost of repair is SGD 3,000.00 to carry out the repairs. Please refer to Annex A (Appraisal Schedule) for a detailed account of the cost estimates.

REMARKS

We have not authorised the repair. However, for information, under normal circumstances, the repair would takes approximately 4 (Four) working days to complete.

In accordance to your instruction, we have **NOT AUTHORISED** the repair to the damaged vehicle and the survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

Yours faithfully,
United Appraisal & Management Pte Ltd



M. Farez
Motor Vehicle Appraiser

APPRAISEMENT SCHEDULE

Annex A

Registration no. : SFL3131B

Our reference : UAM22.10.03-MF-STP-HMS-SFL3131B

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
<u>LIST ITEMS</u>					
1	1	Front bumper	Deformed 641 ✓	1157.00	1157.00
2	2	Front bumper side retainer @ SGD 131.60 65 x 2	Necessary 130 ✓	263.20	263.20
3	1	Front bumper reinforcement	Serviceable	520.40	0.00 X nn
4	1	Front bumper inner sponge	Torn 105 ✓	288.30	288.30
5	1	Front bumper centre lower grille	Cut/Deformed 191 ✓	275.00	275.00
6	1	Front bumper lower cover o/s	Cut	195.30	195.30 X nn
7	1	Front bumper lower cover n/s	Cut	187.55	187.55 X nn
8	1	Front grille	Cracked	504.20	504.20 ✓
9	1	Front grille logo	Necessary	65.50	65.50 ✓
10	1	Front brace panel	Bent	217.00	217.00 X nn
				1636.70	
				-25%	
				1227.52	
				Less 0% / 25%	
				0.00	788.26
				3673.45	2364.79
<u>SPECIAL NETT ITEMS</u>					
1	1	Sundries	Necessary	50.00	30.00 ✓
2	1set	Front bumper clips	Necessary	80.00 30 ✓	80.00
3	1set	Front grille clips	Necessary	40.00 15 ✓	40.00
4	1	Front number plate with casing	Necessary	70.00	65.00 ✓
				140	
				240.00	215.00
TOTAL				3913.45	2579.79
<u>LABOUR & MISC CHARGES</u>					
1		To dismantle / renew the accident damaged portion. To panel beating, reshape, straighten, orientate and align repair / replacement parts.	SGD 350.00/day	600.00	350.00 250
2		To disconnect wire harness of electrical component to facilitate repairs, reconnect and check functions.		80.00	60.00 30
3		To apply undercoating on the accident repair and replaced panel for rust protection.		200.00	180.00 20
4		Supply spray paint material and necessary items to respray bonnet front bumper and other affected area / panel.	SGD 300.00/pnl 550	900.00	600.00 250
TOTAL				1780.00	1190.00
Total Parts and Labour Cost of Repair				5693.45	3769.79
Less (Lumpsum repair adjustment)					769.79
Adjustment Parts and Labour Cost of Repair					3000.00

3 days

1917.52

Page 1 of 1

L/S - 1534.02
= 1550