

ASS. REC. BY: TaughnREF: CS/CT123005562/Tup3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: 169

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \$30K

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: GBD 3793E Yr Regn: 2014 1 Sep

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Dyna c.c. 2982Colour: Silver A/C: Insured / Std / NI / NASp. Reading: 466569 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: STFAT 35920-K 203946

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: NI / S/Rim / STD A/Rim orTyre Size: F: 195/95R: 155/92BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. _____ D.O.I. 5/4/25Survey held at Vins AutoDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐ : Preli. Report1) _____
Date/Time, File Return to?☐ : Final Report

2) _____

Rep. Format: _____

Lump Sum / L.B.A. (\$) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

\$ + RS. \$ _____

Photos _____

Others _____

TOTAL



Estimated Cost of Repair

Attention To : China Taiping Insurance
(Singapore) Pte Ltd
3 Anson Road
#15-00 Springleaf Tower
Singapore 079909

Claim Details

Case Ref. No. : OD/032023/6093
Date : 28-03-2023
Accident Date : 27-03-2023

Vehicle Details

Make & Model : TOYOTA TOYOTA DYNA 150
MANUAL
Chassis No : JTFAT35Y20K203446
Registration No : GBD3793E

S/N	Description	Ref No.	Qty	Amount (S\$)
1	FRONT WIPER PANEL	0418	1.00	bt \$140.00
2	FRONT WIPER PANEL LOWER PROTECTOR	0413	1.00	cut \$170.00
3	FRONT RH WIPER ARM	1454	1.00	X \$80.00
4	FRONT LH WIPER ARM	1453	1.00	bt \$80.00
5	FRONT WIPER LINKAGE	1461	1.00	? \$160.00
6	FRONT WIPER MOTOR	1450	1.00	*? \$460.00
7	FRONT LH WIPER NOZZLE	1445	1.00	mis \$30.00
8	FRONT PANEL - OUTER	0931	1.00	bt \$260.00
9	FRONT PANEL - INNER	1000	1.00	Rx \$520.00
10	FRONT PANEL "DYNA" EMBLEM	0433	1.00	nr \$30.00
11	FRONT GRILLE	0410	1.00	avr \$210.00
12	FRONT GRILLE EMBLEM	0431	1.00	wc \$40.00
13	FRONT GRILLE RUBBER	0419	1.00	X \$20.00
14	LH TOP CORNER PANEL	1001	1.00	mis \$70.00
15	LH LOWER CORNER PANEL	0887	1.00	bt \$90.00
16	LH CORNER PANEL LOWER PROTECTOR	1002	1.00	mis \$60.00
17	RH HEADLAMP	0572	1.00	avg? \$400.00
18	LH HEADLAMP	0571	1.00	avg \$400.00
19	FRONT BUMPER	0281	1.00	bc \$250.00
20	FRONT WINDSCREEN GLASS	1401	1.00	avr \$600.00
21	FRONT WINDSCREEN RUBBER	1410	1.00	nr \$100.00
22	"ERP" BRACKET	1003	1.00	nr \$26.00
23	LH FRONT PILLAR	0911	1.00	Rx \$270.00
24	LH SIDE MIRROR ASSY	1737	1.00	dis \$350.00
25	LH SIDE MIRROR TOP COVER	1004	1.00	mis \$20.00
26	FRONT LH DOOR	1481	1.00	bt \$850.00
27	FRONT LH DOOR OUTER MOULDING	2417	1.00	X \$70.00
28	FRONT LH DOOR TOP HINGE	1487	1.00	? \$50.00
29	FRONT LH DOOR LOWER HINGE	1495	1.00	? \$50.00
30	FRONT LH DOOR INNER TRIMBOARD	1711	1.00	X \$400.00

Vin's

Vin's Motor Pte Ltd
160 Sin Ming Drive
#03-03 Sin Ming Autocity
Singapore 575722
Tel : 6453 2121 Fax : 6459 9795
GST Registration No. 199906067G

31	LH STEP GARNISH	2205	1.00	x	\$160.00
32	DASHBOARD	4331	1.00	?	\$700.00
33	DASHBOARD REINFORCEMENT	4330	1.00	?	\$370.00
34	AIRCON BLOWER ASSY	1005	1.00	?	\$620.00
					<hr/>
					\$8,106.00
35	FRONT NO. PLATE	1006	1.00	3061-	\$40.00
36	WINDSCREEN GUM	1007	1.00	wy-	\$80.00
37	TO RESET HEADLAMP SYSTEM	1008	1.00	x	\$280.00
38	TO REMOVE AND REPLACE DASHBOARD	1009	1.00	200?	\$380.00
39	TO REMOVE AND REPLACE FRONT WINDSCREEN	1010	1.00	120.	\$180.00
40	TO REPAIR DAMAGES		1.00	-	\$1,226.40
41	TO SPRAY PAINTING		1.00	-	\$818.56

Subtotal w/o GST: \$11,110.96

Tanpin 97495749/62563561
Not Authorise
Ex: to be advise
5/4/23 @ 4pm
Tanpin @ khantow.com
8 days
No 2nd hand part
P/P Resurvey before paint

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Issued by Eric Sin

This is a computer-generated document. No signature is required.

Vin's Motor Pte Ltd
#03-03, Sin Ming AutoCity, 160 Sin
Ming Drive
575722

Vin's

Insurer Reference:
Repairer Reference: OD/032023/6093
Date calculated: 30/03/2023 3:32 PM

Full Report
Registration: GBD3793E
Printed: 30/03/2023 3:32 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Khong Keng Leng	Currency:	SGD
Claim Reference:		Date of Incident:	27/03/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	DYNA
Sub Model:	BASE MODEL
Model Sheet Number:	70 1C 01
Registration:	GBD3793E
VIN number:	JTFAT35Y20K203446
Odometer:	

Model Specs

STANDARD CAB	TWO COAT METALLIC	PREPARE OFF VEHICLE
--------------	-------------------	---------------------

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

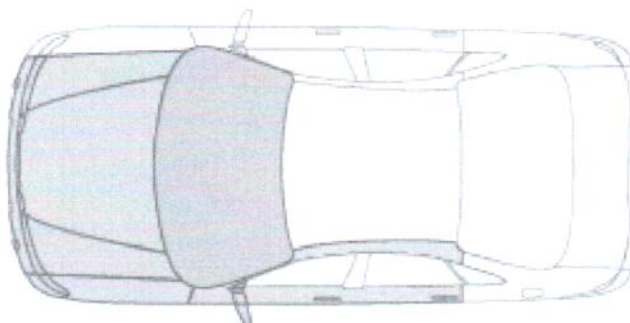

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	
Spare Tyre Brand	Tread (Spare), mm						

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	RENEW ENGINE COVER		60.0	252.00
NO NUMBER	R + R BADGE "DYNA"		2.0	8.40
NO NUMBER	R + R L/F WHEELHOUSE COVER		2.0	8.40
610101)	R + R LEFT FRONT MUD FLAP		1.0	4.20
520011	RENEW FRONT BUMPER		10.0	42.00
	INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS			
751011	R + R RADIATOR GRILLE		3.0	12.60
810051)	R + R L/HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
	DOES NOT INCLUDE: ADJUST HEADLAMP			
810051)	R + R R/HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
	DOES NOT INCLUDE: ADJUST HEADLAMP			
810151A	ADJUST HEADLAMPS		3.0	12.60
NO NUMBER	RENEW FRONT PANEL		20.0	84.00
554011)	R + R WINDSCREEN		30.0	126.00
	INCLUDES: R + R SUN VISORS, UPPER FRONT			

Code	Description	WU	Price SGD
743511)	PANEL AND A-PILLAR TRIMS		
	DETACH + REFIT FRONT FLOOR CARPET	2.0	8.40
	INCLUDES: R + R FRONT SEATS.		
NO NUMBER	RENEW L/A-PILLAR	80.0	336.00
NO NUMBER	R + R L/F STEP	3.0	12.60
670051	RENEW L/F DOOR	14.0	58.80
	INCLUDES: R + R DOOR,		
	CONVERT ALL ATTACHED PARTS,		
	ADJUST DOOR		
670201)	R + R L/F DOOR HINGE/S	1.0	4.20
670051)	R + R RIGHT FRONT DOOR	3.0	12.60
743201)	DETACH + REFIT HEADLINING	4.0	16.80
711041 ZAX	R + R L/SEAT	2.0	8.40
883621)	R + R HEATING CPL	21.0	88.20
550451)	R + R INSTRUMENT PANEL	9.0	37.80
550451)	RENEW INSTRUMENT PANEL (REMOVED)	4.0	16.80
NO NUMBER	R + R INSTRUMENT PANEL CARRIER (REMOVED)	2.0	8.40
850161)	R + R WIPER MOTOR (WIPER UNIT REMOVED)	7.0	29.40
NO NUMBER	DRAIN + REFILL COOLANT	3.0	12.60
441101	R + R STEERING WHEEL	4.0	16.80
1008	HEADLAMP SYSTEM TO RESET		280.00*
1009	REPLACE DASHBOARD TO REMOVE AND		380.00*
1010	REPLACE WINDSCREEN TO REMOVE AND		180.00*
Labour Cost		Hrs	WU
Panel / Mechanical Labour		29.20	292.0
Alignment			
Fixed Rate			840.00
Total of Labour			2,066.40

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	ENGINE FIREWALL NEW PART PAINTING	30.0
	OUTER ENG FIREWALL NEW PART PAINTING	8.0
	L/OUTER A-PILLAR NEW PART PAINTING	18.0
	FRONT PANEL SURFACE PAINT	5.0
	LEFT FRONT DOOR NEW PART PAINTING	16.0
	FRONT BUMPER NEW PART PAINT K1R	7.0
	R/END MOULDING NEW PART PAINT K1G/P	5.0
	L/F BUMPER BRACKET REPAIR PAINTING >50%	9.0
	L/F COVER PANEL SURFACE PAINT	4.0
	R/F COVER PANEL SURFACE PAINT	4.0
	L/SIDE REINFORCEMENT SURFACE PAINT	4.0
	R/SIDE REINFORCEMENT SURFACE PAINT	4.0

Paint Material Per Part

Code	Description	Price SGD
0413	ENGINE FIREWALL NEW PART PAINTING	41.25
0418	OUTER ENG FIREWALL NEW PART PAINTING	10.32
0911	L/OUTER A-PILLAR NEW PART PAINTING	19.25

Paint Material Per Part

Code	Description	Price SGD
0931	FRONT PANEL SURFACE PAINT	4.98
1481	LEFT FRONT DOOR NEW PART PAINTING	45.92
0281	FRONT BUMPER NEW PART PAINT K1R	26.57
0888	R/END MOULDING NEW PART PAINT K1G/P	5.40
0293	L/F BUMPER BRACKET REPAIR PAINTING >50%	1.19
0939	L/F COVER PANEL SURFACE PAINT	1.49
0940	R/F COVER PANEL SURFACE PAINT	1.49
2237	L/SIDE REINFORCEMENT SURFACE PAINT	1.00
2238	R/SIDE REINFORCEMENT SURFACE PAINT	1.00

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		114.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.80	8.0	33.60
Total	10 WU/h	147.0	617.40

Material Cost - Paint

	Price SGD
New Part Painting	116.74
New Part Painting - Plastic K1R	26.57
New Part Painting - Plastic K1G/PUR	5.40
Repair Painting	1.19
Surface-/Blend Paint	9.96
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	201.16

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
0431	BADGE	75315 37080	Original	ndc	40.00
0433	BADGE MODEL	75311 37160	Original	ndc	30.00
1005	BLOWER ASSY	AIRCON	Original	?	620.00
1003	BRACKET	"ERP"	Original	ndc	26.00
1001	CORNER PANEL	LH TOP	Original	bt	70.00
0413	ENGINE FIREWALL	55700 37440	Original	act	170.00
0281	FRONT BUMPER	52111 37301	Original	bt	250.00
0931	FRONT PANEL	57408 37274	Original	bt	260.00
0419	FRT CONNECT PNL SEAL	55738 37080	Original	x	20.00
0410	GRILLE	53111 37891	Original	cur	210.00
4331	INSTRUMENT PANEL	55301 37090C0	Original	?	700.00
4330	INSTRUMENT SUPPORT	55330 37180	Original	?	370.00
1737	L/DOOR MIRROR ASSY	87940 37E92	Original	dis	350.00
0887	L/END MOULDING	53814 37100A0	Original	bt	90.00
1711	L/F DOOR TRIM	67620 37130B6	Original	x	400.00
1495	L/F LOWER DOOR HINGE	68710 37020	Original	?	50.00
1453	L/FR WIPER ARM	85221 37240	Original	?	80.00
2205	L/F STEP	51772 37091	Original	x	160.00
1487	L/F UPPER DOOR HINGE	68730 37010	Original	?	50.00

Code	Description	Part Number	Part Source	Price SGD
1445	L/F WASHER JET	85381 37030	Original	m/s 30.00
2417	L/LOWER DRIP RAIL	67864 37011	Original	X 70.00
0911	L/OUTER A-PILLAR	61132 37053	Original	Rx 270.00
1481	LEFT FRONT DOOR	67002 37322	Original	bul 850.00
0571	LEFT HEADLAMP ASSY	81170 37121	Original	Aug 400.00
1002	LOWER PROTECTOR	LH CORNER PANEL	Original	m/s 60.00
0418	OUTER ENG FIREWALL	55078 37120	Original	bt 140.00
1000	PANEL - INNER	FRONT	Original	Rx 520.00
1454	R/FR WIPER ARM	85211 37241	Original	X 80.00
0572	RIGHT HEADLAMP ASSY	81130 37120	Original	Aug 400.00
1004	TOP COVER	LH SIDE MIRROR	Original	m/s 20.00
1401	WINDSCREEN	56111 37120	Original	Aug 600.00
1411	WINDSCREEN BOND KIT	PZ49I 00C1131		ne 0.00
1410	WINDSCREEN SEAL	56121 25040	Original	me 100.00
1461	WIPER LINKAGE	85150 37180	Original	? 160.00
1450	WIPER MOTOR	85070 37393	Original	? 460.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			8,106.00
u: Used parts	Total			8,106.00

Extras

Code	Description	Price SGD
1006	NO. PLATE FRONT	30 40.00*
1007	GUM WINDSCREEN	✓ 80.00*
	Total Extras	120.00

Final Calculation

	SGD	SGD
Parts	8,106.00	
Total Parts		8,106.00
Labour Time Base 10 WU/h		
Total 292.0 WU X 42.00 SGD/h	1,226.40	
Alignment		
Fixed Rate	840.00	
Total of Labour		2,066.40
Total Of Extras		120.00
Paint Work Time Base 10 WU/h		
Labour Cost 147.0 WU X 42.00 SGD/h	617.40	
Material Cost	201.16	
Total Paint Including Material		818.56
Repair Cost Excludes GST		11,110.96
GST (+8.0%)		888.88
Repair Cost Included GST		11,999.84

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	28/03/2023 16:08 (SGT)
Reported by	Actual Driver
Date of Accident	27/03/2023 09:57 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	ALONG PAYA LEBAR ROAD TOWARDS PIE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBD3793E
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	SIONG HONG SEAFOOD ENTERPRISE PTE LTD
Company Reg No	2XXXXX170D
Email Address	XUEPING_SIONGHONG@HOTMAIL.COM
Mobile Phone No	(Phone) +65-96258138
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	TOYOTA DYNA 150 MANUAL
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Goods vehicle
Transmission	Auto
CC	2982

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMCVSNA00109892202

DRIVER

Name of Driver	LI HONGLIN
NRIC No	GXXXX519W
Date Of Birth	20/05/1980
Occupation	Outdoor

Date Of Driving Pass	24/08/2022
Driving experience	7 MONTHS
Gender	Male
Mobile Number	(Phone) +65-91154758
Alt. Phone Number	-
Email Address	SIONGHONG@HOTMAIL.COM
Address	15 WOODLAND LOOP #03-54/55/56
Address complement	-
Postcode	738322
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	1
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO SKETCH PLAN

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	YN5964R
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	-
Contact Number	(Phone) +65-96770025

Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time


[Signature]

Actual Driver's Signature (if driver is not the policyholder) / Date & Time



Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

Sketch Plan

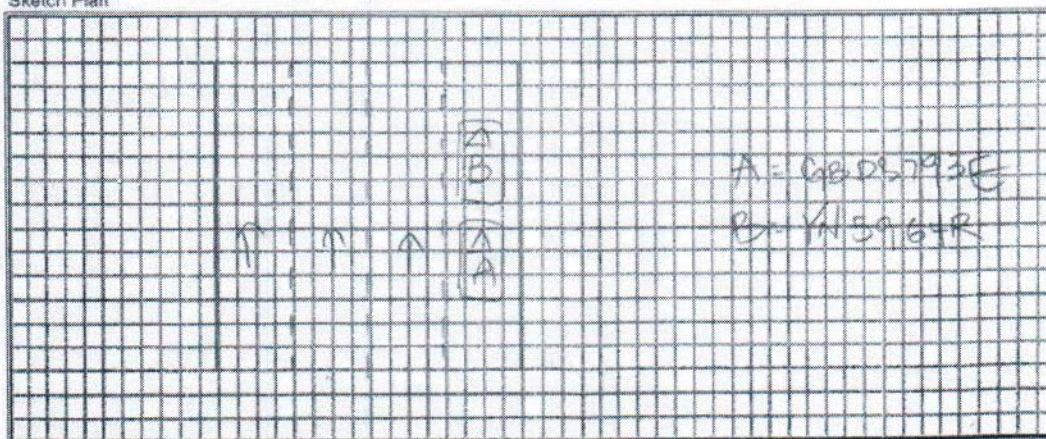

vJun2022

Describe Circumstance of the Accident

On 27 March 2023 at around 0957hrs. I was driving
 at along Raya Lebar road. Suddenly a vehicle B (R/SKTR)
 jammed brake in front, I tried to press brake,
 however the ~~vehicle~~ ^{my vehicle} skid due to the wet weather.
 Resulted ~~in~~ ^{my vehicle} ~~hit~~ ^{hit} onto the rear
 portion of vehicle B.

Declaration

I hereby declare that the above particulars are true in every respect.



Policyholder's Signature / Date & Time

[Signature]

Actual Driver's Signature (if driver is not the policyholder)
 / Date & Time



Witnessed by Reporting Centre Personnel
 (Name as in NRIC/ID card)

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	170D
Vehicle Details	
Vehicle No.:	GBD3793E
Vehicle to be Exported:	No
Intended Deregistration Date:	31 Mar 2023
Vehicle Make:	TOYOTA
Vehicle Model:	TOYOTA DYNA 150 MANUAL
Primary Colour:	Silver
Manufacturing Year:	2014
Engine No.:	1KD2442648
Chassis No.:	JTFAT35Y20K203446
Maximum Power Output:	-
Open Market Value:	\$27,856.00
Original Registration Date:	30 Sep 2014
First Registration Date:	30 Sep 2014
Transfer Count:	0
Actual ARF Paid:	\$1,393.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	29 Sep 2024
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$33,332.00
COE Rebate Amount:	\$4,990.00
Total Rebate Amount:	\$4,990.00

The information contained herein is correct as at 28 Mar 2023

OK