

UNITED Appraisal And Management Pte Ltd

Motor Vehicle Appraiser and Insurance Loss Adjuster
No. 10 Kaki Bukit Ave 4 #06-75 Premier @ Kaki Bukit Singapore 415874
Handphone No. : +65 9146 1186 Email : united.appraisal@live.com.sg
Business Registration Nos. : 200817301N

VEHICLE INSPECTION REPORT

To : Chia Ming Ann

Our ref. : UAM22.04.18-AK-STP-RCG-SMW6686G

Date : 09 Feb 2023

REFERENCE

Assign by	: Chia Ming Ann	Insured	: To be advice
Assign on	: 29 Mar 2022	Policy no.	: To be advice
Inspection on	: 29 Mar 2022	Claim no.	: To be advice
Accident on	: 18 Mar 2022	Sum insured	: To be advice
Workshop name	: Revol Carz Garage Pte Ltd	Excess	: Not applicable
Inspection at	: 10, Ang Mo Kio Ind. Park 2A	3rd party Veh.	: To be advice
	#02-18 AMK Autopoint	3rd party ins.	: To be advice
	Singapore 568047		

PARTICULARS OF DAMAGED VEHICLE

Registration no.	: SMW6686G	Odometer	: 90503 km
Make / Model	: Mercedes Benz C180 Avantgrade R1	Chassis no.	: WDD2050402R252285
Regn. date	: 31 Mar 2017	Engine no.	: 27491030859061
Body colour	: White	Engine cap.	: 1595 cc

PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)

Steering	: In order	Paintwork	: Good
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Good

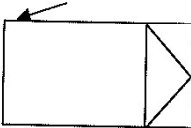
TYRE CONDITION ON VEHICLE

	Make	Size	Tread depth	Type of road wheel
Front N/S	: Bridgestone	225/45R18	70%	Alloy
Front O/S	: Bridgestone	225/45R18	70%	Alloy
Rear N/S	: Continental	225/45R18	70%	Alloy
Rear O/S	: Continental	225/45R18	70%	Alloy

NOTE: The above percentages represent the estimated remaining life of tyre threads.

* Denotes damaged component/s

POINT OF IMPACT

On the near side rear in the direction from left to right.	
--	--

SYNOPSIS OF DAMAGES RESULTANT FROM THE ACCIDENT

The impact of the collision has damaged / affected the n/s rear fender, taillamp, rear bumper, exhaust pipe and etc...

Please refer to Annex A (Appraisal Schedule) for a detailed account of the damages and photographs taken.

Note: Reinspection vehicle on 30 Mar 2022 for repair in progress.

RECOMMENDATION

The estimate cost of repair submitted by Messrs Revol Carz Garage Pte Ltd as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairers have agreed to undertake the repairs to the owner's satisfaction at our revision. We have not authorised the repairs.

Our adjusted cost of repair is SGD 5,500.00 to carry out the repairs. Please refer to Annex A (Appraisal Schedule) for a detailed account of the cost estimates.

REMARKS

We have not authorised the repair. However, for information, under normal circumstances, the repair would takes approximately 4 (Four) working days to complete.

In accordance to your instruction, we have **NOT AUTHORISED** the repair to the damaged vehicle and the survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

Yours faithfully,
United Appraisal & Management Pte Ltd



Ananda K. Biswas Marc
Motor Vehicle Appraiser

APPRAISEMENT SCHEDULE

Annex A

Registration no. : SMW6686G
 Our reference : UAM22.04.18-AK-STP-RCG-SMW6686G

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
-----	-----	-------------	---------------------	-----------------------	------------------

LIST ITEMS

1	1	Rear fender n/s	Refer To Labour	0.00	0.00 X R
2	1	Taillamp n/s	Cracked	955.00	955.00 780 ✓
3	1	Taillamp lower bracket n/s	Cracked	135.00	135.00 ✓
4	1	Taillamp base panel n/s	Refer To Labour	0.00	0.00 X nn
5	1	Rear bumper	Cut	1506.40	1506.40 1350 ✓
6	1	Rear bumper side retainer n/s	Distorted	210.00	210.00 125 ✓
7	1	Rear bumper lower (Black)	Distorted	852.70	852.70 X nn
8	1	Rear bumper support	Re-Used	264.00	264.00 X nn
9	1	Rear bumper lower securing strip	Necessary	189.00	189.00 X nn
10	6	Rear bumper sensor @ SGD 226.00	1pcs Shorted	1356.00	226.00 ✓
11	1set	Rear bumper sensor ring	Necessary	48.00	48.00 ✓
12	1	Rear bumper sensor wire harness	Not Necessary	533.25	0.00 X nn
13	1	Rear bumper chrome side @ SGD 168.00	Necessary	336.00	336.00 X nn
14	1	Rear bumper chrome centre	Necessary	260.20	260.20 X nn
15	1	Exhaust pipe	Refer To Labour	0.00	0.00 X nn
				6645.55	4982.30
Less 0% / 10%				0.00	498.23
				6645.55	4484.07
					2664 -10% 2397.60

SPECIAL NETT ITEMS

1	1	Sundries	Necessary	80.00	60.00 30
2	1set	Rear fender innershield clips n/s	Necessary	35.00	30.00 X nn
3	1set	Taillamp clips n/s	Necessary	70.00	70.00 X nn
4	1	Taillamp inner seal n/s	Necessary	60.00	60.00 X nn
5	1set	Rear bumper clips	Necessary	80.00	80.00 30
6	1set	Rear bumper lower clips	Necessary	40.00	40.00 X nn

				80.00	60.00	60
TOTAL				6725.55	4544.07	

LABOUR & MISC CHARGES

1	To dismantle / renew the accident damaged portion. To panel beating, reshape, straighten, orientate and align repair / replacement parts.	SGD 350.00/day	1400.00	1050.00 300
2	To disconnect wire harness of electrical component to facilitate repairs, reconnect and check functions.		80.00	60.00 ✓

UAM

APPRAISEMENT SCHEDULE

Annex A

Registration no. : SMW6686G
 Our reference : UAM22.04.18-AK-STP-RCG-SMW6686G

S/N	Qty	Description	Condition / Remarks	Estimate by Wshop SGD	Adjusted Amt SGD
3		To remove and refit, straighten and readjust exhaust pipe and exhaust silencer.		280.00	250.00 X
4		To apply undercoating on the accident repair and replaced panel for rust protection.		100.00	80.00 30
5		Supply spray paint material and necessary items to respray n/s rear fender, taillamp base panel, rear bumper and other affected area / panel.	SGD 300.00/pnl	1300.00	900.00 500
TOTAL				3160.00	2340.00 890
Total Parts and Labour Cost of Repair				9885.55	6884.07
Less (Lumpsum repair adjustment)					1384.07
Adjustment Parts and Labour Cost of Repair					5500.00

3347.60

3 days

L/S - 2678.08
 = 2700