

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

INVOICE

To: Rabbit Car Rental Pte Ltd
c/o 459 Macpherson Road
Shariot Building
Singapore 368177

Date : 20/03/2023

Invoice No : IV23-03021/CAS

Particulars	Amount
Fee For Services Rendered In Respect Of: Surveying, Adjusting, and Re-inspection Of Accident Damaged Vehicle SLF 4610P (Inclusive Of Photographs And Transport Charges) Our reference : CAS/23-03/021	\$543.00
Total	\$543.00

E. & O.E

Constant Appraiser Services



Cheque Should Be Crossed And Made Payment To 'Constant Appraiser Services'

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

Automobile Inspection Report

To: Rabbit Car Rental Pte Ltd c/o 459 Macpherson Road Shariot Building Singapore 368177	Date : 20/03/2023 Reference No : CAS/23-03/021		
<u>General Information</u>			
Registration No. : SLF 4610P Accident Date : 04/03/2023			
<u>Particulars of Damaged Vehicle</u>			
Colour : Pearl White Engine Capacity : 1496 cc Mileage (KM) : 348764 Chassis No. : RU31211658 Registration Date : 26/08/2016	Make & Model : Honda Vezel Pre-Accident Condition : Good Engine No. : LEB5911669 Steering : In Order Brake : In Order		
<u>Tyre Condition</u>			
R/H Front Tyre	Size	Make	Balance
L/H Front Tyre	215/60R16	DUNLOP	80%
R/H Rear Tyre	215/60R16	DUNLOP	80%
L/H Rear Tyre	215/60R16	ROADSTONE	80%
	215/60R16	ROADSTONE	80%
<u>Inspection</u>			
Repairer : Autobahn Rent A Car Pte Ltd 459 Macpherson Road, Shariot Building, Singapore 368177			
<u>Adjustment And Recommendation Cost Of Repair</u>			
Repairer's Estimate : \$3,836.54 Revised Amount : \$1,950.00 Less Excess : - Nett Total : \$1,950.00			
<u>Remarks</u>			
(A) Survey was done on 08/03/2023 (B) Re-survey was done on 13/03/2023 (C) Re-survey after repair was done on 17/03/2023 (D) The survey was conducted entirely on WITHOUT PREJUDICE basis. (E) We have NOT given any instruction to authorize the repair of the vehicle.			

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Constant Appraiser Services

Vehicle No : SLF 4610P

Our ref : CAS/23-03/021

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)	
		<u>PARTS REPLACEMENT – LIST ITEMS</u>				
1	1pc	Rear bumper	Grazed/Deformed	891.60	891.60	
2	1pc	Rear bumper reflector LH	Cracked	111.30	111.30	
3	1pc	Rear bumper side LH	Grazed/Deformed	281.72	281.72	
4	1pc	Rear bumper side retainer LH	Necessary	27.28	27.28	
5	1pc	Rear fender LH	Repair	789.60	-	
6	1pc	Rear fender wheel arch trim LH	Grazed/Deformed	257.92	257.92	
				2,359.42	1,569.82	
		Less 20%		(471.88)	(313.96)	
			Sub total	1,887.54	1,255.86	
		<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>				
1	1set	Rear bumper clip	Necessary	55.00	45.00	
2	1set	Rear bumper side clip LH	Necessary	28.00	28.00	
3	1set	Rear fender wheel arch trim clip LH	Necessary	46.00	26.00	
			Part total	2,016.54	1,354.86	
		<u>LABOUR & MISC. CHARGES</u>				
1		Repair & replace damaged parts		800.00	500.00	
2		Spray paint on affected area (Pearl white)		800.00	500.00	
3		Check wiring system		40.00	20.00	
4		Remove & refix rear trim board & garnish	Not Necessary	100.00	-	
5		Spray anti rust on affected area		80.00	30.00	
			Grand total	3,836.54	2,404.86	
Recommended cost of lump sum repair (To its pre-accident condition)					1,950.00	

Constant Appraiser Services

Vehicle No : SLF 4610P

Our ref : CAS/23-03/021

Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$1,950.00** on a contractual basis. Under normal circumstances, the repair period would be about **3 (Three)** working days.





Yours faithfully,

Constant Appraiser Services




Lim Yong Tian (Sebastian)
Licensed Appraiser
Adv. Dip. In Mechanical Engineering (AUS)
MSAAA


Constant Appraiser Services

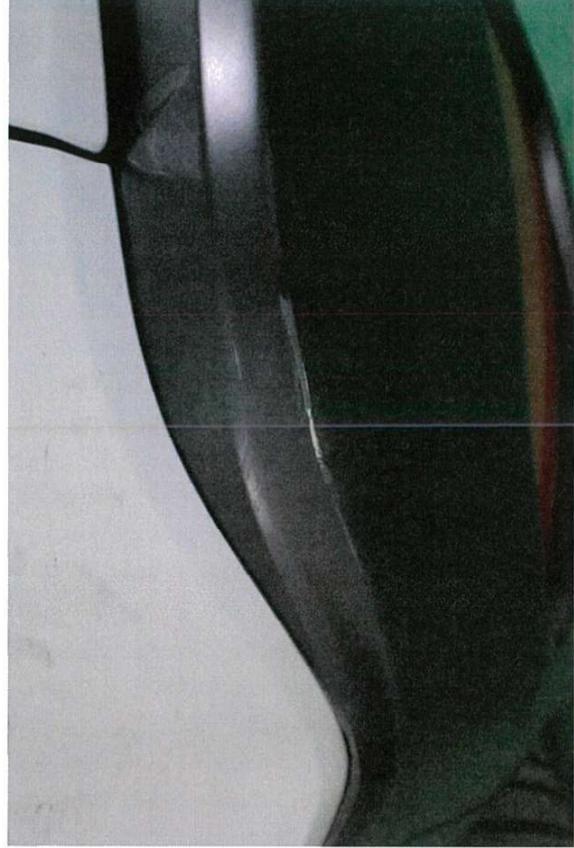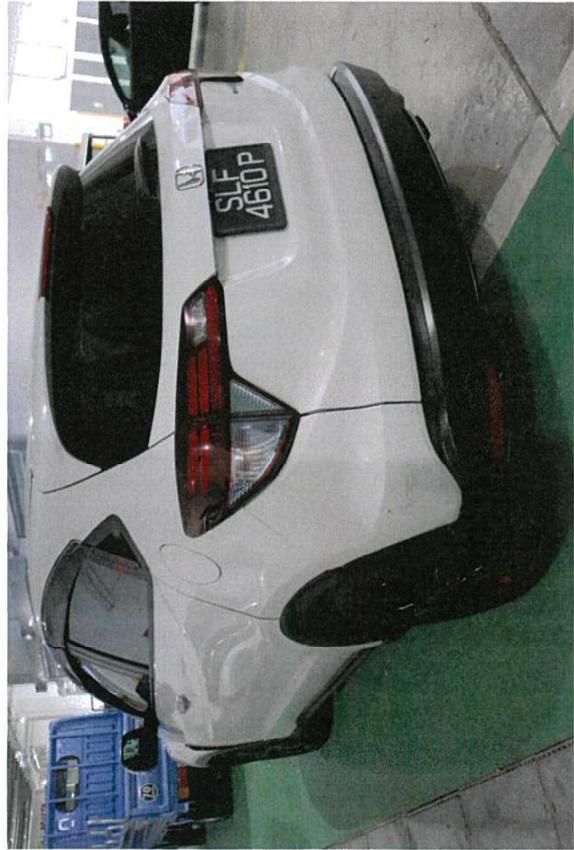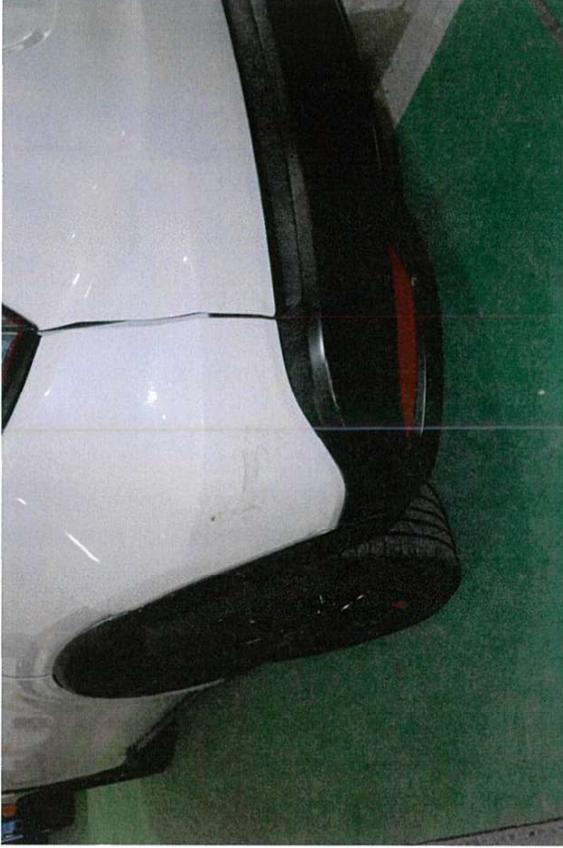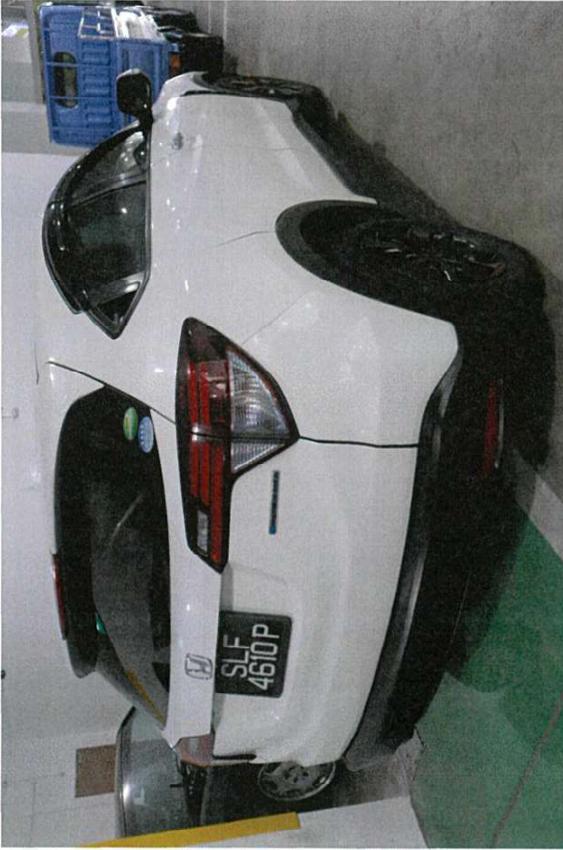



Constant Appraiser Services

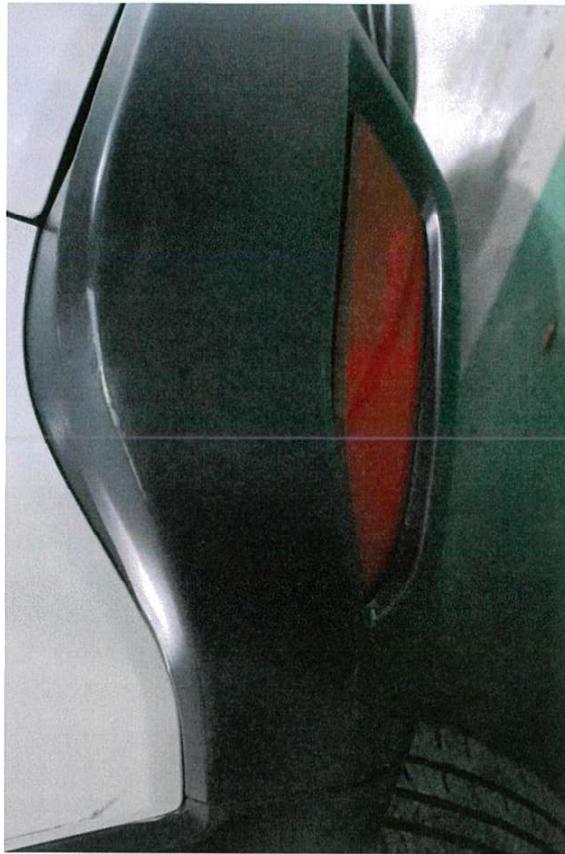


Constant Appraiser Services

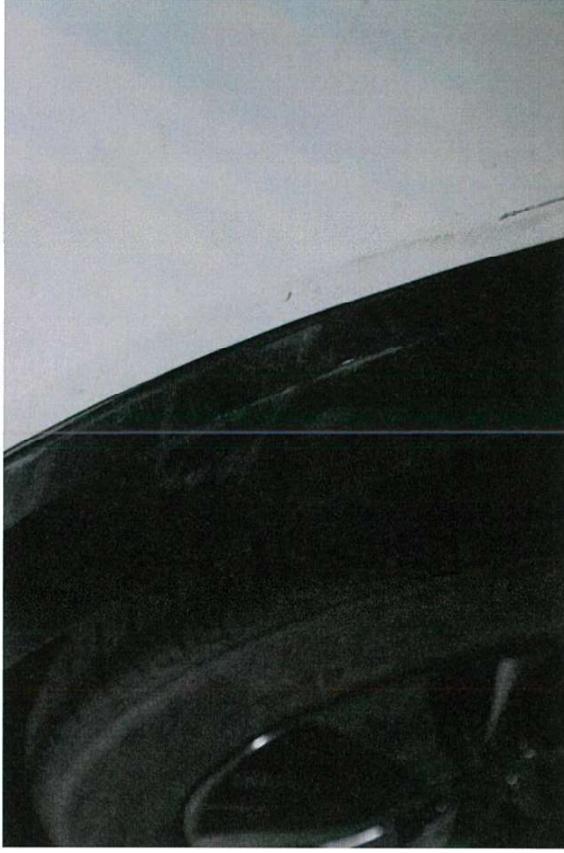


Constant Appraiser Services

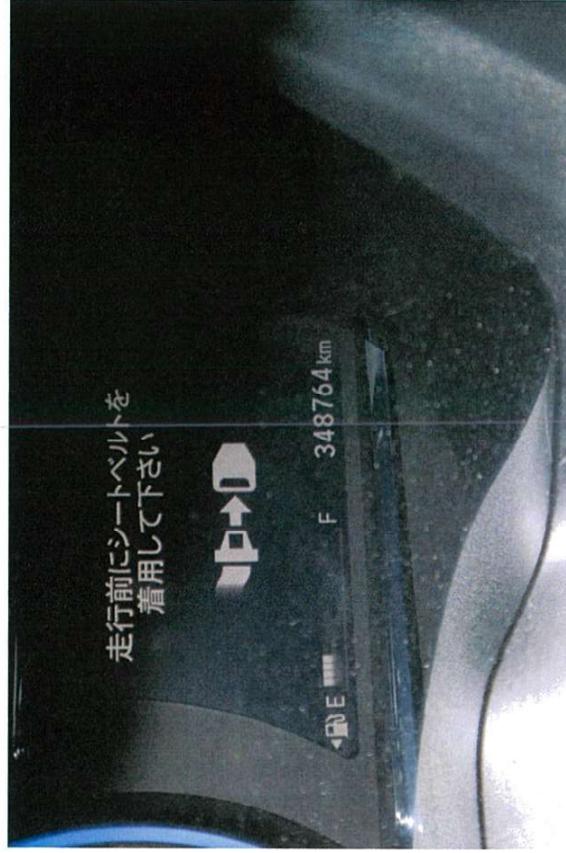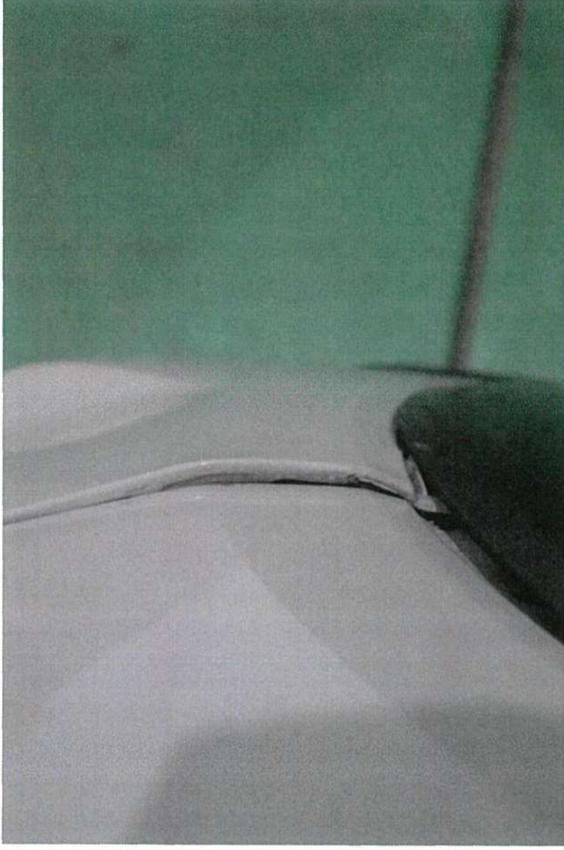


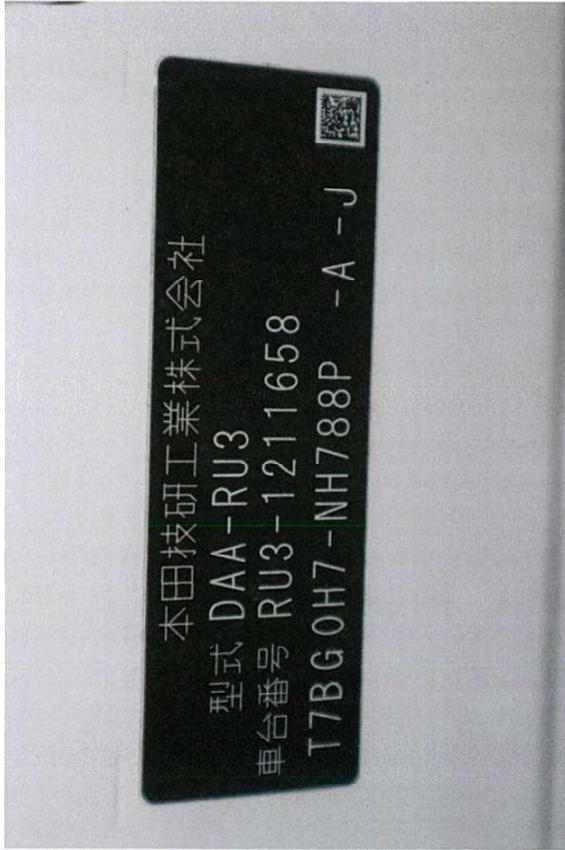

Constant Appraiser Services

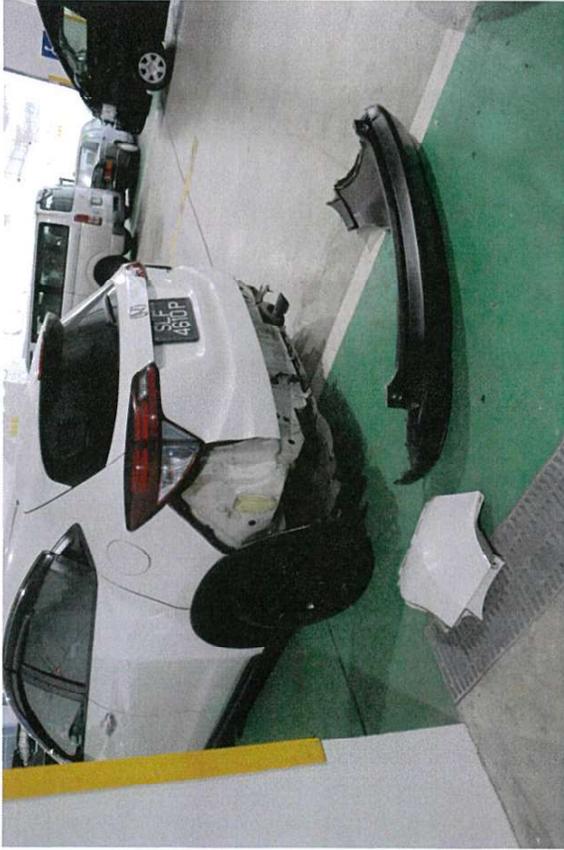


Constant Appraiser Services

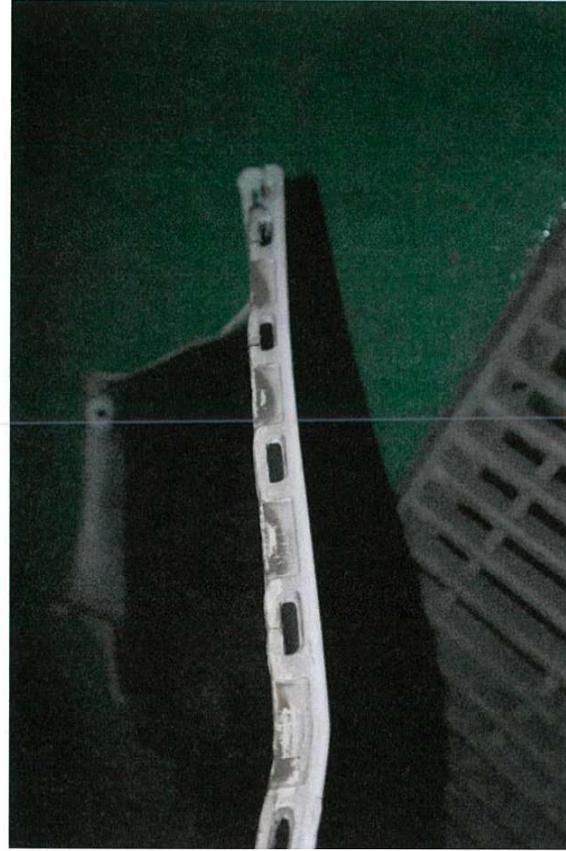


Constant Appraiser Services




Constant Appraiser Services

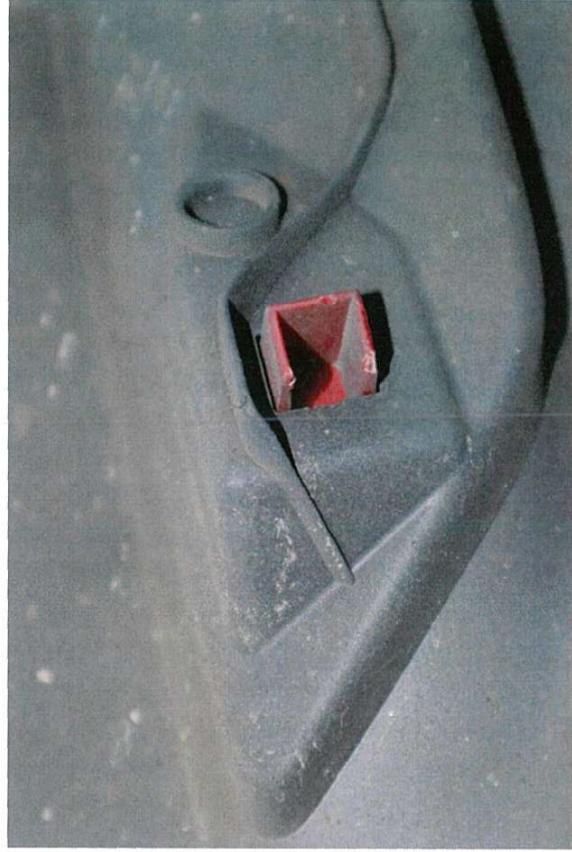





Constant Appraiser Services

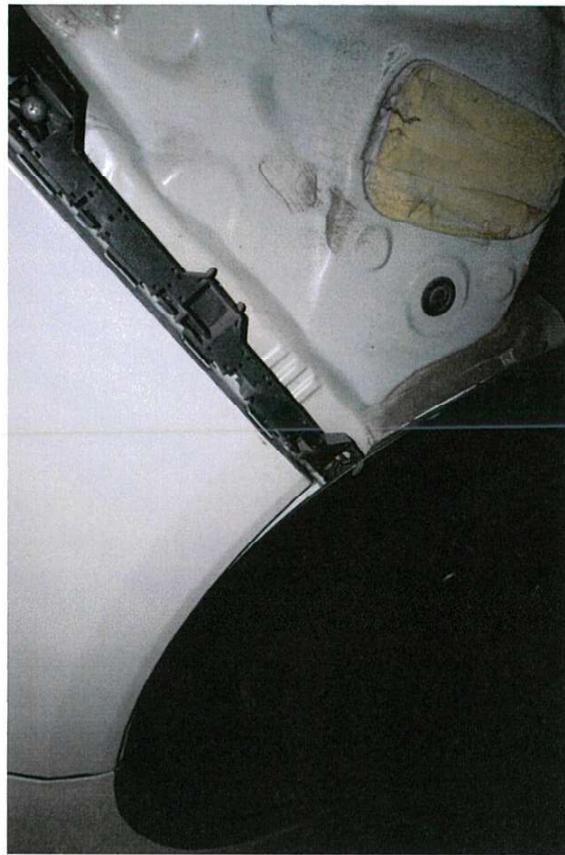

Constant Appraiser Services

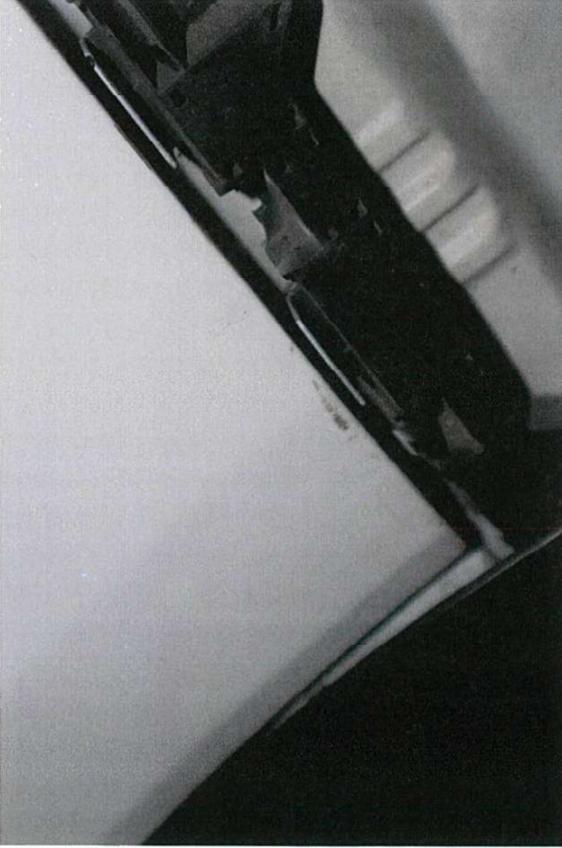

Constant Appraiser Services

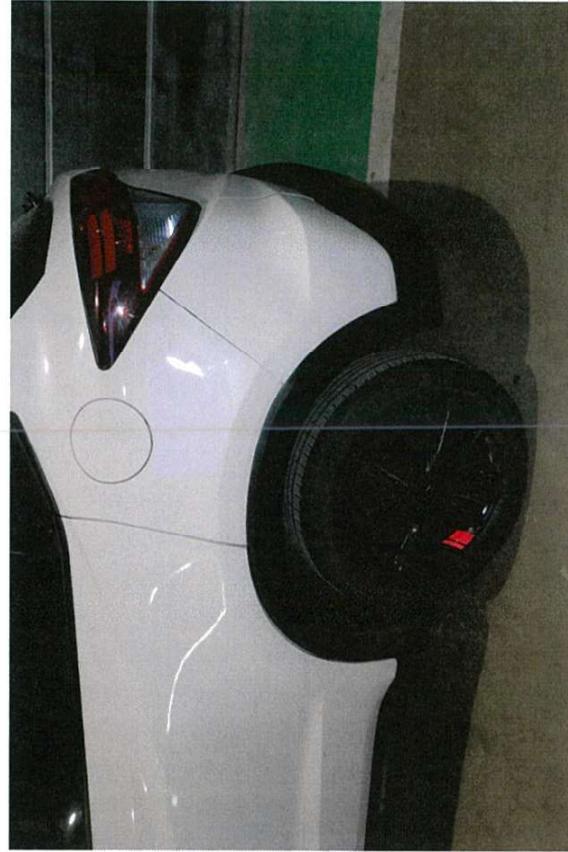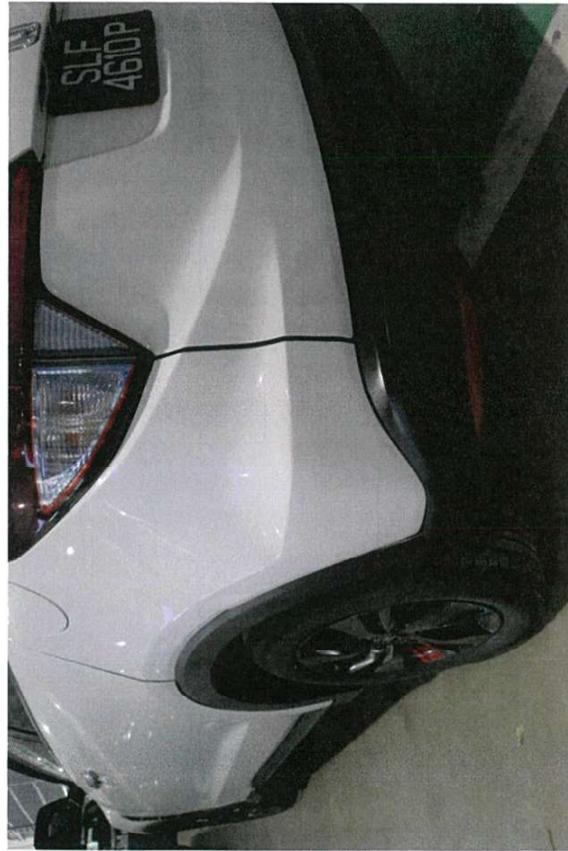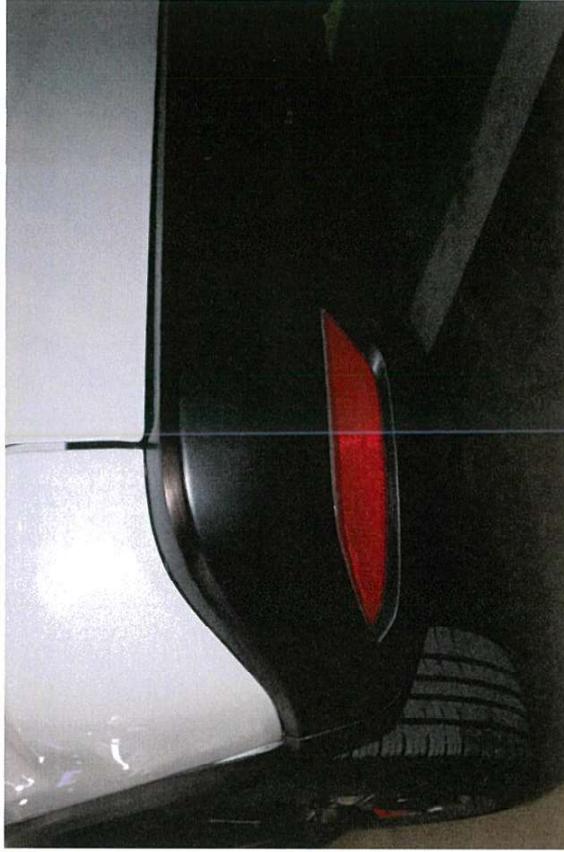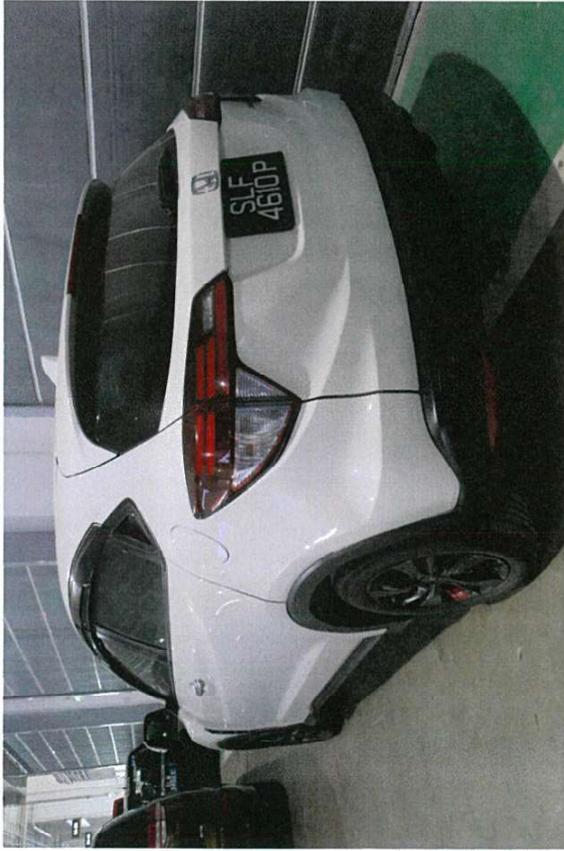

Constant Appraiser Services

