

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com Mobile: 9061 0543

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 1010M22.PHE  
Vehicle no : SLV4501L

### **1 REFERENCE**

Date of inspection : 12 October 2022  
Requested by : Yap Teck Meng  
371 Woodlands Ave 1  
#06-831  
Singapore 730371  
Type of survey : Independent  
Repairer : Paul Hoe Enterprise Pte Ltd  
Blk 1 Kaki Bukit Ave 6, #01-109 AutoBay @ Kaki Bukit, Singapore 417883  
Date of accident : 6 October 2022

### **2 VEHICLE DATA**

Make/model : **MERCEDES BENZ C180 AMG LINE (R18 LED)**  
Chassis no : WDD2050402R008880  
Engine no : 27491030217756  
Date of registration : 23 January 2015 COE Expiry Date: 22 January 2025  
Engine capacity : 1595 cc  
Odometer reading : 60780 km  
Colour : Grey

### **3 STATIC CONDITION CHECK**

Steering : Serviceable  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General Condition : Good

### **4 TIRE CONDITION CHECK**

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 7 mm/Yokohama	7 mm/Yokohama	223/45R18
Rear tread	: 7 mm/Yokohama	7 mm/Yokohama	223/45R18

### **5 BRIEF DESCRIPTION OF DAMAGE**

RH taillamp face scraped, rear fender scraped/dented, rear door scraped/grazed, etc. Please see para. 8 of this report for more details.

### **6 REMARKS**

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

### **7 RECOMMENDATION**

Cost of repairs : **\$3,200.00** (lump sum)  
Estimated no of days : **Six (6)**

## 8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 1010M22.PHE  
Vehicle no: SLV4501L

### A SPARE PARTS

Description	Qty	Assessed Condition	Repairer's Amount	Revised Amount
RH taillamp assy	1	face scraped	780 ✓ 1,080.00	1,080.00
RH rear fender	1	to repair	2,030.00	R 0.00 X
Fuel filler door	1	to repair	125.00	R 0.00 X
RH rear door	1	to repair	2,605.00	R 0.00 X
RH rear door outer handle	1	scraped	256.00	nn 256.00 X
RH rear rim	1	scraped/grazed	1840 -10% 1,060.00	1,060.00 ✓
		Subtotal of the above	1656 7,156.00	2,396.00
		Discount 10% / 10%	715.60	239.60
(Special nett)		Subtotal 1:	6,440.40	2,156.40
RH rear tyre	1	to reuse	455.00	nn 0.00 X
		Subtotal 2:	455.00	0.00
Total cost of parts:			6,895.40	2,156.40

### B LABOUR

To check wiring.	60.00	45.00 ✓
To apply anti-rust undercoat.	120.00	30 ✓ 60.00
Labour charges to remove and replace, to cut and weld, to panel beating affected and damaged parts.	900.00	400 600.00
Spray painting charges to paint the rear fender, fuel filler door, rear door, etc.	1,200.00	600 900.00
To conduct 4-wheel computerised alignment to realign wheels.	90.00	90.00 ✓
To remove and replace damaged front right hand suspension parts (for checking only).	450.00	120.00 X
Total cost of labour:	1165	2,820.00 1,815.00
Total cost of repair:		9,715.40 3,971.40

5 days

2821

L/S - 2256.80  
= 2250

Report no: 1010M22.PHE  
Vehicle no: SLV4501L

**9 CONCLUSION**

The revised or adjusted cost of repairs to restore the vehicle is \$3,971.40

(a) However, the recommended cost of repair based on lump sum basis would be **\$3,200.00**

(b) The estimated number of days taken to complete the repairs would be **Six (6)**

(1<sup>st</sup> re-inspection conducted on 13 October 2022)


(Post Repair Inspection conducted on 17 October 2022)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

**Note: Lump Sum Repair Basis**

*This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.*

Prepared by:

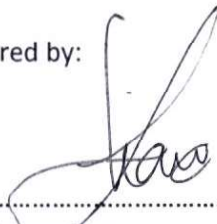

.....  
Liaw Leong San  
Licensed Automotive Appraiser

Dated: 14 November 2022