

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: G3J1345Y
 at Workshop m/s SME 11am
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: 350
 (Client's Record)
 Make of Veh: _____

Veh No: G3J1345Y Yr Regn: 09/01/19
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or LM
 Make: Toyota Dyno c.c. 2982
 Colour: silver A/C: Insured / Std / NI / NA
 Sp. Reading: 235611 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: JTFAT35440K2/2259
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195-215
 R: 155-212 hb, lead
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 87214
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 5 days Res.: Yes or No
 Lum Sum: 1.3.1 % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS C 100C
 Date: _____ Person Contacted: 21AE13323
 Vehicle: IN / OUT

Front 72 mm Rear 4/4 mm
 R/Bal. 72 mm L/Bal. 3/3 mm
 D.O.A. 10/05/23 D.O.I. 17/05/23
 Survey held at _____
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Frt
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction Dep 13/4

partial hold

repairer went P/P repair because no 2nd hand parts only few items
SME photo number 38-40/52 for AH eye

Uth 62-62 RP AH

P/P 3719.23 informed AH very Ured \$2531.75, 41%.

condition of front tyres still within the legal requirement
and did not contribute to the accident.

Date/Time, File Pass to?

☐ : Preli. ReportDays Of Repair: 51) 29/7 typh☐ : Final ReportResurvey No. of Trip: 1

Date/Time, File Return to?

2)

Add Fee:

☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

Photos

Others

Report Format: MER-00Lump Sum T.I.B.I. (\$) 3719.23

TOTAL

SME Motor Pte Ltd
1 Kaki Bukit Ave 6, BLK D, #02-15
417883

Insurer Reference:
Repairer Reference: 23/CN/OD-263 (05)
Date calculated: 11/05/2023 1:17 PM

Full Report
Registration: GBJ1345Y
Printed: 11/05/2023 1:17 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Gary Seah	Currency:	SGD
Claim Reference:		Date of Incident:	10/05/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	DYNA
Sub Model:	BASE MODEL
Model Sheet Number:	70 1C 01
Registration:	GBJ1345Y
VIN number:	
Odometer:	

Model Specs

PAINTED RAD GRILLE	4.0 LTR 73KW	WHEELBASE 2525MM	STANDARD CAB
TWO COAT METALLIC	PREPARE OFF VEHICLE		

Not Authorized
Tel: 62563561
EXCESS \$350
5 days.
~~Eng 2/5~~
Wh photo before & after.
P/P \$3719.23

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

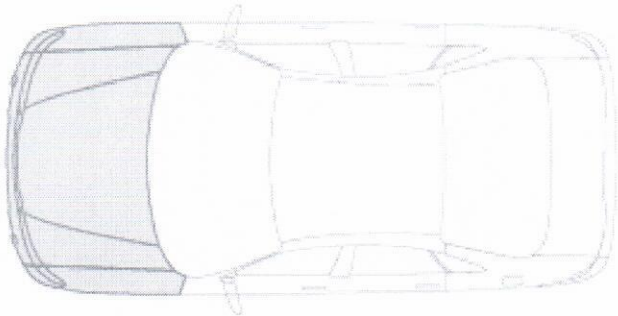

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner),Tread (Right Outer),Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm		
Spare Tyre Brand	Tread (Spare), mm						

Labour

		Time Base 10 WU/h	Price = 42.00 SGD/h	
Code	Description		WU	Price SGD
NO NUMBER	RENEW ENGINE COVER		60.0	252.00
NO NUMBER	R + R BADGE "DYNA"		2.0	8.40
520011	RENEW FRONT BUMPER		10.0	42.00
	INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS			
751011	R + R RADIATOR GRILLE		3.0	12.60
810051)	R + R L/HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
	DOES NOT INCLUDE: ADJUST HEADLAMP			
810051)	R + R R/HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
	DOES NOT INCLUDE: ADJUST HEADLAMP			
810151A	ADJUST HEADLAMPS		3.0	12.60
554011)	R + R WINDSCREEN		30.0	126.00
	INCLUDES: R + R SUN VISORS, UPPER FRONT PANEL AND A-PILLAR TRIMS			
670051)	R + R LEFT FRONT DOOR		3.0	12.60
670051)	R + R RIGHT FRONT DOOR		3.0	12.60

Code	Description	WU	Price SGD
NO NUMBER	R + R FRONT CROSSMEMBER	25.0	105.00
743201)	DETACH + REFIT HEADLINING	4.0	16.80
883621)	R + R HEATING CPL	21.0	88.20
870151)	R + R HEATER BLOWER	4.0	16.80
550451)	R + R INSTRUMENT PANEL	9.0	37.80
NO NUMBER	R + R INSTRUMENT PANEL CARRIER (REMOVED)	2.0	8.40
850161)	R + R WIPER MOTOR (WIPER UNIT REMOVED)	7.0	29.40
NO NUMBER	R + R AIR FILTER HOSE	1.0	4.20
NO NUMBER	DRAIN + REFILL COOLANT	3.0	12.60
461201)	R + R BRAKE FLUID RESERVOIR	2.0	8.40
442151 ZAX	R + R STEERING COLUMN ASSY	4.0	16.80
441101	R + R STEERING WHEEL	4.0	16.80
NO NUMBER	DETACH + REFIT STEERING COLUMN	2.0	8.40
1482	RIGHT FRONT DOOR REPAIR	5.0*	21.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		20.90	209.0
Total of Labour			877.80

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	L/F BUMPER BRACKET NEW PART PAINTING	6.0
	R/F BUMPER BRACKET NEW PART PAINTING	6.0
	ENGINE FIREWALL NEW PART PAINTING	30.0
	OUTER ENG FIREWALL NEW PART PAINTING	8.0
	FRONT CROSSMEMBER SURFACE PAINT	5.0
	FRONT BUMPER NEW PART PAINT K1R	7.0
	GRILLE NEW PART PAINT K1R	5.0
	RIGHT FRONT DOOR REPAIR PAINTING <50%	17.0

Paint Material Per Part

Code	Description	Price SGD
0293	L/F BUMPER BRACKET NEW PART PAINTING	1.55
0294	R/F BUMPER BRACKET NEW PART PAINTING	1.55
0413	ENGINE FIREWALL NEW PART PAINTING	41.25
0418	OUTER ENG FIREWALL NEW PART PAINTING	10.32
3010	FRONT CROSSMEMBER SURFACE PAINT	4.98
0281	FRONT BUMPER NEW PART PAINT K1R	26.57
0410	GRILLE NEW PART PAINT K1R	11.81
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	28.75

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			84.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	11.40	114.0	478.80

Material Cost - Paint

New Part Painting	Price SGD
New Part Painting - Plastic K1R	54.67
Repair Painting	38.38
Surface-/Blend Paint	28.75
Material-constant Metal Preparation	4.98
Material-constant Plastic	28.60
Total	9.00
	164.38

Spare Parts

prices as at 2015-06-01/01				
Code	Description	Part Number	Part Source	Price SGD
0281	FRONT BUMPER	52111 37301	Original	DD/2e 320.00 ✓
0293	L/F BUMPER BRACKET	52012 37033	Original	11 160.00 X
0294	R/F BUMPER BRACKET	52011 37034	Original	Buy 160.00 ✓
0410	GRILLE	53111 37A01A0	Original	cur/cu 235.00 ✓
0413	ENGINE FIREWALL	55700 37440	Original	123 480.00 ✓
0418	OUTER ENG FIREWALL	55078 37120	Original	Buy 225.00 ✓
0428	CLIP FASTENING	90467 W0009	Original	123 30.00 ✓
0431	BADGE	75315 37080	Original	123 55.00 ✓
0433	BADGE MODEL	75311 37160	Original	123 65.00 ✓
0571	LEFT HEADLAMP ASSY	81170 37121	Original	11 420.00 X
0572	RIGHT HEADLAMP ASSY	81130 37120	Original	11 420.00 ✓
1410	WINDSCREEN SEAL	56121 25040	Original	123 125.00 ✓
1411	WINDSCREEN BOND KIT	PZ49I 00C1131	Original	123 0.00 ✓
3010	FRONT CROSSMEMBER	51211 37090	Original	R 225.00 X
4411	HEATER CPL	87010 37090	Original	11 1,250.00 X
4415	HEATER BLOWER CPL	87210 37050	Original	11 450.00 X
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			4,620.00
u: Used parts	Total			4,620.00

Extras

Code	Description	Price SGD
1000	F/R DOOR CO STICKER 1000	25.00* ✓
1001	FRT NUMBER PLATE 1001	35.00* ✓
1002	AIRCON COOLANT 1002	50.00* ✓
	Total Extras	110.00

1-2115

Final Calculation

	SGD	SGD
Parts	4,620.00	
Total Parts		4,620.00
Labour Time Base 10 WU/h		
Total 209.0 WU X 42.00 SGD/h	877.80	
Total of Labour		877.80
Total Of Extras		110.00
Paint Work Time Base 10 WU/h		
Labour Cost 114.0 WU X 42.00 SGD/h	478.80	
Material Cost	164.38	
Total Paint Including Material		643.18
Repair Cost Excludes GST		6,250.98
GST (+8.0%)		500.08
Repair Cost Included GST		6,751.06

Comments
* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SME Motor Pte Ltd
1 Kaki Bukit Ave 6, BLK D, #02-15
417883

Insurer Reference:

Repairer Reference: 23/CN/OD-263 (05)

Date calculated: 25/07/2023 12:14 PM

Full Report

Registration: GBJ1345Y

Printed: 25/07/2023 12:15 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Gary Seah	Currency:	SGD
Claim Reference:		Date of Incident:	10/05/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	DYNA
Sub Model:	BASE MODEL
Model Sheet Number:	70 1C 01
Registration:	GBJ1345Y
VIN number:	
Odometer:	

Model Specs

PAINTED RAD GRILLE	4.0 LTR 73KW	WHEELBASE 2525MM	STANDARD CAB
TWO COAT METALLIC	PREPARE OFF VEHICLE		

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

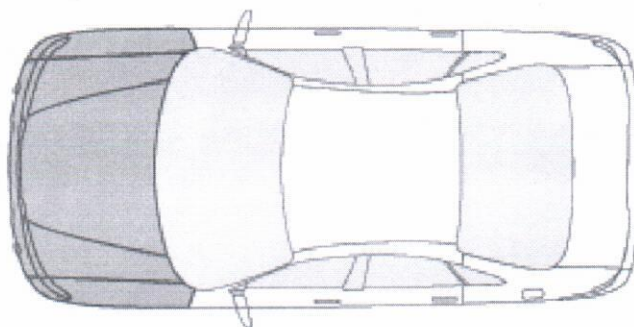

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	RENEW ENGINE COVER		60.0	252.00
NO NUMBER	R + R BADGE "DYNA"		2.0	8.40
520011	RENEW FRONT BUMPER		10.0	42.00
	INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS			
751011	R + R RADIATOR GRILLE		3.0	12.60
810051)	R + R L/HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
	DOES NOT INCLUDE: ADJUST HEADLAMP			
810051)	R + R R/HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
	DOES NOT INCLUDE: ADJUST HEADLAMP			
810151A	ADJUST HEADLAMPS		3.0	12.60
554011)	R + R WINDSCREEN		30.0	126.00
	INCLUDES: R + R SUN VISORS, UPPER FRONT PANEL AND A-PILLAR TRIMS			
670051)	R + R LEFT FRONT DOOR		3.0	12.60
670051)	R + R RIGHT FRONT DOOR		3.0	12.60

Code	Description	WU	Price SGD
743201)	DETACH + REFIT HEADLINING	4.0	16.80
883621)	R + R HEATING CPL	21.0	88.20
870151)	R + R HEATER BLOWER	4.0	16.80
550451)	R + R INSTRUMENT PANEL	9.0	37.80
NO NUMBER	R + R INSTRUMENT PANEL CARRIER (REMOVED)	2.0	8.40
850161)	R + R WIPER MOTOR (WIPER UNIT REMOVED)	7.0	29.40
NO NUMBER	R + R AIR FILTER HOSE	1.0	4.20
NO NUMBER	DRAIN + REFILL COOLANT	3.0	12.60
461201)	R + R BRAKE FLUID RESERVOIR	2.0	8.40
442151 ZAX	R + R STEERING COLUMN ASSY	4.0	16.80
441101	R + R STEERING WHEEL	4.0	16.80
NO NUMBER	DETACH + REFIT STEERING COLUMN	2.0	8.40
1482	RIGHT FRONT DOOR REPAIR	5.0*	21.00
3010	FRONT CROSSMEMBER REPAIR	25.0*	105.00 ✓
Labour Cost		Hrs	WU
Panel / Mechanical Labour		20.90	209.0
Total of Labour			877.80

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	R/F BUMPER BRACKET NEW PART PAINTING	6.0
	ENGINE FIREWALL NEW PART PAINTING	30.0
	OUTER ENG FIREWALL NEW PART PAINTING	8.0
	FRONT BUMPER NEW PART PAINT K1R	7.0
	GRILLE NEW PART PAINT K1R	5.0
	RIGHT FRONT DOOR REPAIR PAINTING <50%	17.0
	FRONT CROSSMEMBER SURFACE PAINT	5.0

Paint Material Per Part

Code	Description	Price SGD
0294	R/F BUMPER BRACKET NEW PART PAINTING	1.55
0413	ENGINE FIREWALL NEW PART PAINTING	41.25
0418	OUTER ENG FIREWALL NEW PART PAINTING	10.32
0281	FRONT BUMPER NEW PART PAINT K1R	26.57
0410	GRILLE NEW PART PAINT K1R	11.81
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	28.75
3010	FRONT CROSSMEMBER SURFACE PAINT	4.98

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		78.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	108.0	453.60

Material Cost - Paint

New Part Painting	Price SGD
New Part Painting - Plastic K1R	53.12
Repair Painting	38.38
Surface-/Blend Paint	28.75
Material-constant Metal Preparation	4.98
Material-constant Plastic	28.60
Total	9.00
	162.83

Spare Parts

prices as at 2015-06-01/01			
Code	Description	Part Number	Part Source
			Price SGD
0431	BADGE	75315 37080	Original
0433	BADGE MODEL	75311 37160	Original
0428	CLIP FASTENING	90467 W0009	Original
0413	ENGINE FIREWALL	55700 37440	Original
0281	FRONT BUMPER	52111 37301	Original
0410	GRILLE	53111 37A01A0	Original
0418	OUTER ENG FIREWALL	55078 37120	Original
0294	R/F BUMPER BRACKET	52011 37034	Original
0572	RIGHT HEADLAMP ASSY	81130 37120	Original
1411	WINDSCREEN BOND KIT	PZ49I 00C1131	
1410	WINDSCREEN SEAL	56121 25040	Original

f: OEM Parts	Savings	0.00
n: Non-OEM Parts	Subtotal	2,115.00
u: Used parts	Total	2,115.00

Extras

Code	Description	Price SGD
1000	F/R DOOR CO STICKER 1000	25.00*
1001	FRT NUMBER PLATE 1001	35.00*
1002	AIRCON COOLANT 1002	50.00*
	Total Extras	110.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	2,115.00	2,115.00
Labour Time Base 10 WU/h		
Total 209.0 WU X 42.00 SGD/h	877.80	
Total of Labour		877.80
Total Of Extras		110.00
Paint Work Time Base 10 WU/h		
Labour Cost 108.0 WU X 42.00 SGD/h	453.60	
Material Cost	162.83	
Total Paint Including Material		616.43
Repair Cost Excludes GST		3,719.23
GST (+8.0%)		297.54
Repair Cost Included GST		4,016.77

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.