

# **ICON MOTOR APPRAISER PTE LTD**

Motor Appraiser and Insurance Loss Adjustor  
Blk 361 Yung An Road #12-105 Singapore 610361  
Mobile: +65 9232 0012 Email: iconappraiser@gmail.com  
UEN : 202006885Z

## **INSPECTION REPORT**

To : LIM YU CHUN

Our ref. : 20230414/00266/CA

Date : 14 Apr 2023

### **REFERENCE**

Assign by : LIM YU CHUN  
3rd party Veh. : SKR779L  
Inspection on : 29 Mar 2023  
Accident on : 20 Mar 2023  
Workshop name : Celebrity Auto  
Inspection at : 176 Sin Ming Drive #03-17  
Sin Ming Autocare  
Singapore 575721

### **PARTICULARS OF DAMAGED VEHICLE**

Registration no.	: SMR957R	Odometer	: 47996 km
Make / Model	: HONDA FIT 1.3GF CVT	Chassis no.	: GK33422559
Regn. date	: 2019	Engine no.	: L13B3937048
Body colour	: Blue	Engine cap.	: 1317 cc

### **PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)**

Steering	: In order	Paintwork	: Fair
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Fair


### **TYRE CONDITION ON VEHICLE**

	Make	Size	Tread depth	Type of road wheel
Front N/S	: Falken	185/60R15	70%	Alloy
Front O/S	: Falken	185/60R15	70%	Alloy
Rear N/S	: Falken	185/60R15	70%	Alloy
Rear O/S	: Falken	185/60R15	70%	Alloy

*NOTE: Tread depth percentages represents the visually estimated remaining life of tyre treads.*

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

### POINT OF IMPACT

The damages was found on the rear portion.	
--	--

### RECOMMENDATION

The estimated cost of repair submitted by the repairer Celebrity Auto as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairer have agreed to undertake the repairs at our recommendation.

Our adjusted cost of repair is SGD 5,500.00 to carry out the repairs.  
Kindly refer to parts and labour portion for a detailed account of the cost estimates.

### REMARKS

However, for your information, under normal circumstances, the repair normally would take approximately 6 (Six) working days to complete.

We have **NOT AUTHORISED** the repair to the damaged vehicle.  
The survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our final report, which includes material damages photographs.

Yours faithfully,  
ICON Motor Appraiser Pte Ltd



Patrick Ng  
Motor Vehicle Appraiser

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

# ICON MOTOR APPRAISER PTE LTD

List items					
S/N	Parts description	QTY	Condition	Repairer's Estimate	Our Recommendation
1	Tailgate	1	Damaged	\$ 1,088.00	\$ 1,088.00
2	Tailgate lock	1	Jammed	\$ 395.00	\$ 395.00
3	Tailgate lock striker	1	Bent	\$ 65.00	\$ 65.00
4	Tailgate hinge	2	Re-use	--	--
5	Tailgate absorber	2	Re-use	--	--
6	Tailgate trim board	1	Damaged	\$ 445.00	\$ 445.00
7	Tailgate weatherstrip	1	Deformed	\$ 185.00	\$ 185.00
8	Tailgate "HONDA" logo	1	Re-use	--	--
9	Tailgate "FIT" emblem	1	Necessary	\$ 49.00	\$ 49.00
10	Tailgate outer garnish	1	Re-use	--	--
11	Tailgate stopper	2	Necessary	\$ 44.00	\$ 44.00
12	Taillamp weatherseal n/s	1	Necessary	\$ 15.00	\$ 15.00
13	Taillamp n/s	1	Damaged	\$ 456.00	\$ 456.00
14	Taillamp panel n/s	1	Not necessary	--	--
15	Rear bumper	1	Damaged	\$ 876.00	\$ 876.00
16	Rear fender inner trim	2	Re-use	--	--
17	Tailgate inner handle	1	Re-use	--	--
18	Tailgate windscreen moulding	1	Necessary	\$ 125.00	\$ 125.00
19	Rear bumper tow cover	1	Not necessary	--	--
20	Rear bumper parking sensor holder	2	Necessary	\$ 34.00	\$ 34.00
21	Rear bumper parking sensor harness	1	Damaged	\$ 198.00	\$ 198.00
22	Rear bumper bracket	2	Bent	\$ 118.00	\$ 118.00
23	Keyless antenna	1	Damaged	\$ 197.00	\$ 197.00
24	Keyless sensor	1	Damaged	\$ 224.00	\$ 224.00
25	Rear bumper side retainer	2	Cracked	\$ 102.00	\$ 102.00
26	End panel	1	Buckled	\$ 553.00	\$ 553.00
27	End panel top garnish	1	Damaged	\$ 195.00	\$ 195.00
Subtotal				\$ 5,364.00	\$ 5,364.00
Discount (less 20.00%)				\$ -	\$ 1,072.80
Total				\$ 5,364.00	\$ 4,291.20

Special nett items					
No.	Parts description	QTY	Condition	Repairer's Estimate	Our Recommendation
1	Tailgate trim board clips	1	Necessary	\$ 60.00	\$ 40.00
2	Tailgate outer garnish clips	1	Necessary	\$ 50.00	\$ 30.00
3	Taillamp panel sealant	1	Not necessary	\$ 80.00	--
4	Rear bumper clips	1	Necessary	\$ 80.00	\$ 60.00
5	Rear fender inner trim clips	1	Not necessary	\$ 100.00	--





6	Tailgate windscreen sealant	1	Necessary	\$ 100.00	\$ 80.00
7	Reverse sensor	1	Damaged	\$ 300.00	\$ 250.00
8	Reverse camera	1	Re-use	\$ 450.00	—
9	End panel sealant	1	Necessary	\$ 100.00	\$ 80.00
10	End panel top garnish clips	1	Necessary	\$ 50.00	\$ 40.00
11	Rear licence plate and frame	1	Re-use	\$ 65.00	—
12	Sundries	1	Necessary	\$ 60.00	\$ 50.00
<b>Total</b>				<b>\$ 1,495.00</b>	<b>\$ 630.00</b>

<b>Labour</b>				
<b>No.</b>	<b>Description</b>	<b>QTY</b>	<b>Repairer's Estimate</b>	<b>Our Recommendation</b>
1	To dismantle / renew rear accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	1	\$ 1,200.00	\$ 1,000.00
2	To remove, refit tailgate components to replace tailgate, check and re-adjust close gap, alignment and water seepage.	1	\$ 80.00	\$ 60.00
3	To remove and refit rear windscreen to facilitate repair work.	1	\$ 150.00	\$ 120.00
4	Supply spray paint material and necessary items to respray rear affected area / panel.	1	\$ 1,000.00	\$ 800.00
5	To rust proof all affected portions after repair.	1	\$ 100.00	\$ 80.00
<b>Total labour</b>			<b>\$ 2,530.00</b>	<b>\$ 2,060.00</b>

<b>Estimate Grand Total</b>	<b>\$ 9,389.00</b>	<b>\$ 6,981.20</b>
-----------------------------	--------------------	--------------------

# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L

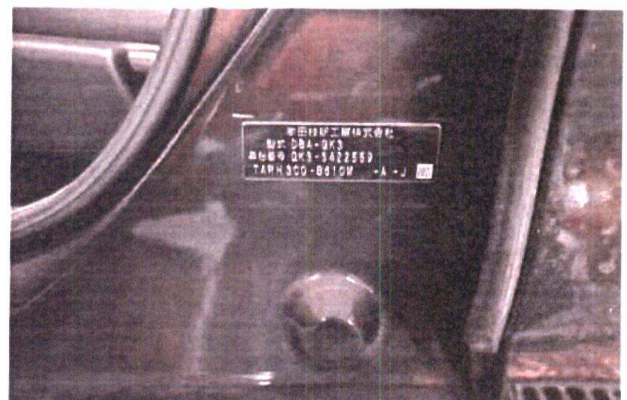
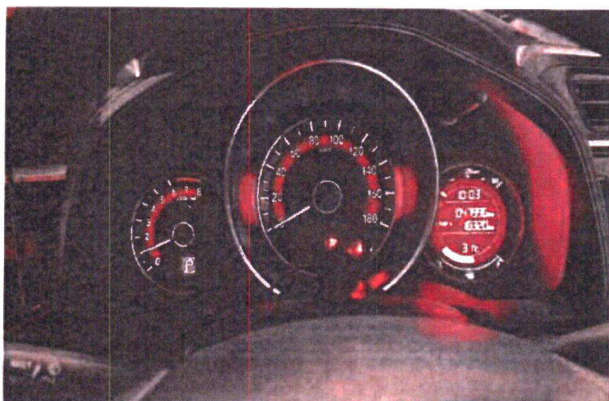


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L

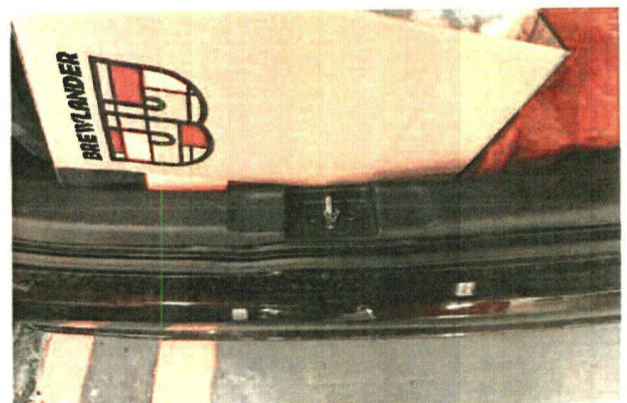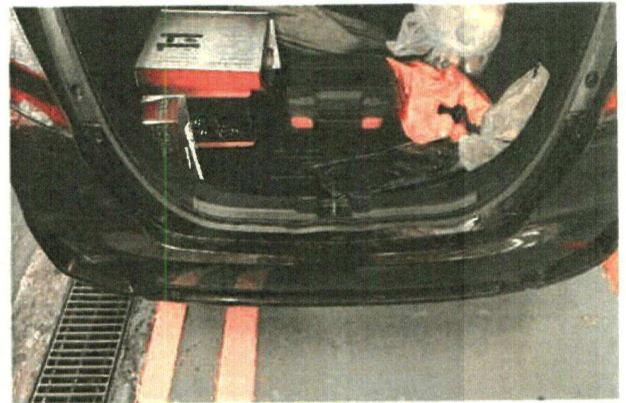


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L



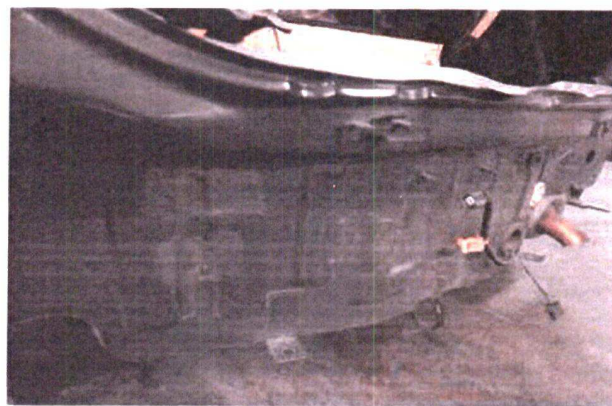


**Note:** This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L

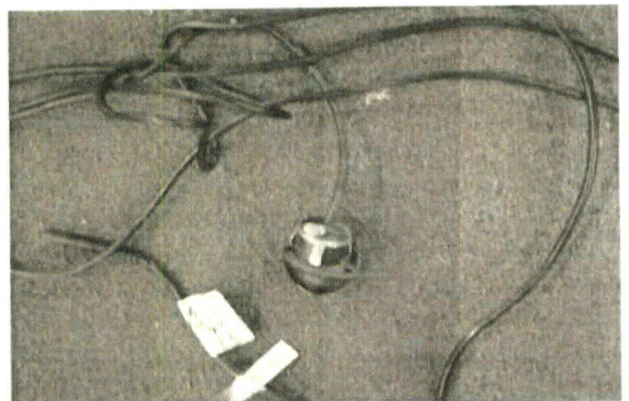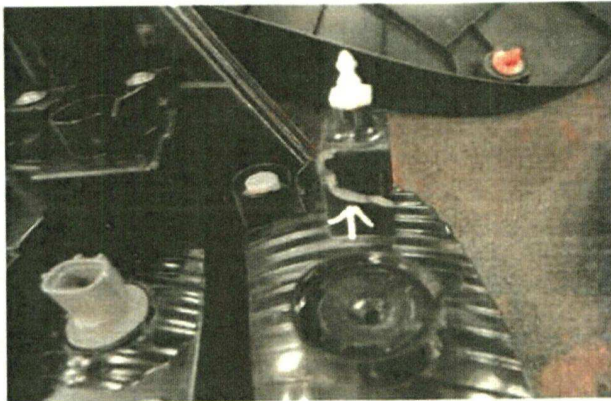
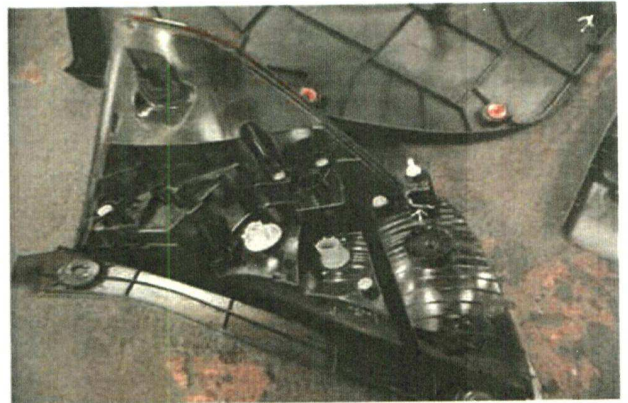


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L



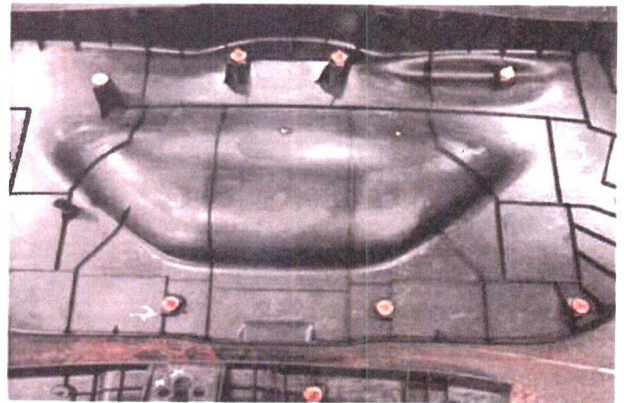
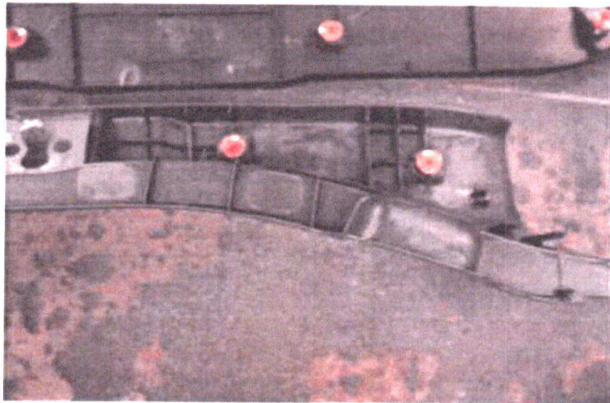


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L

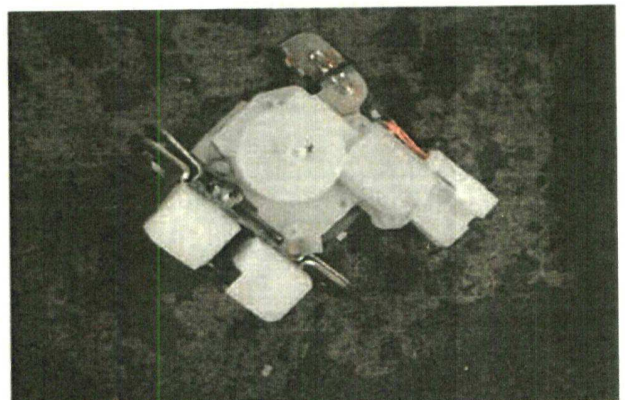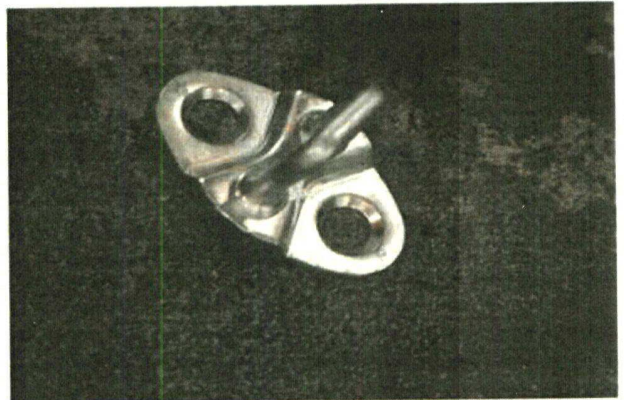
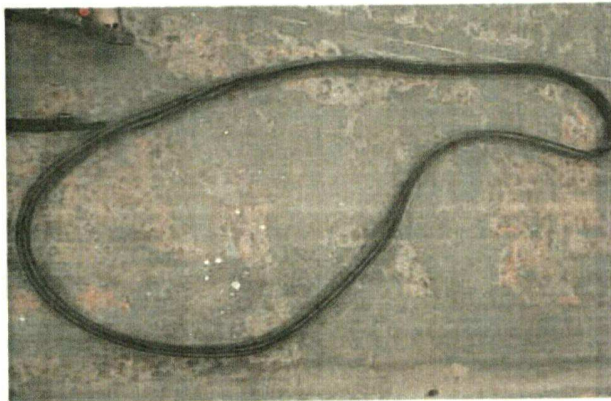
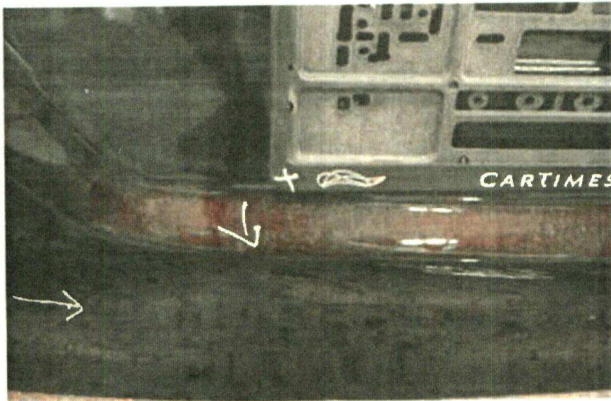


**Note:** This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L

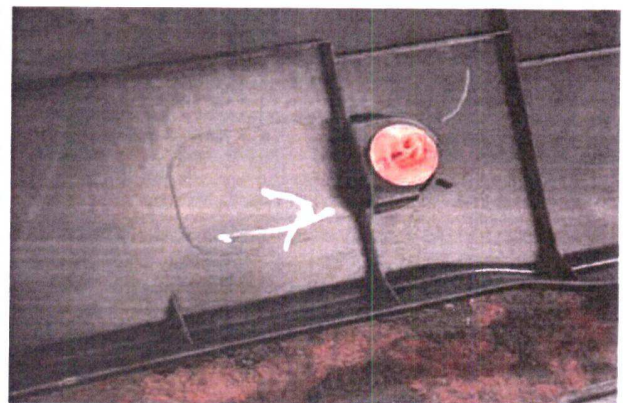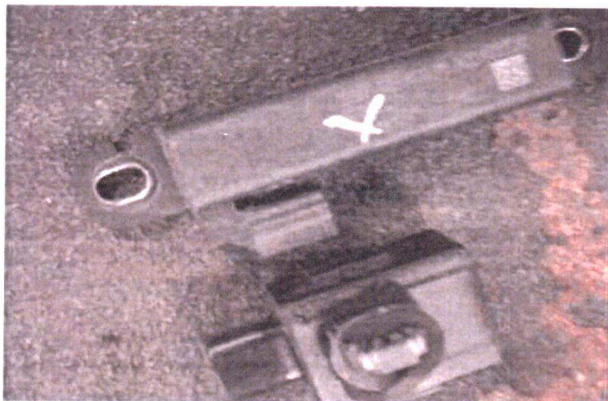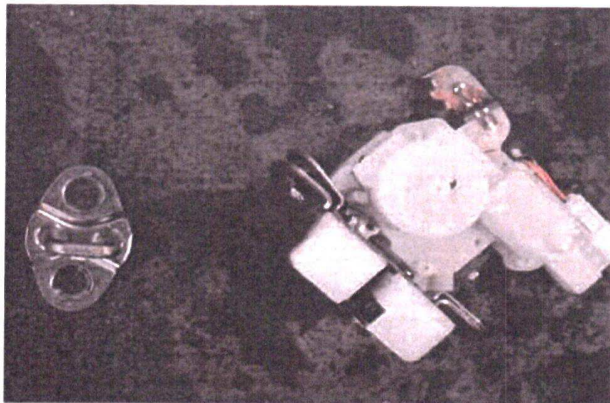


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20230414/00266/CA  
Your Ref: SKR779L

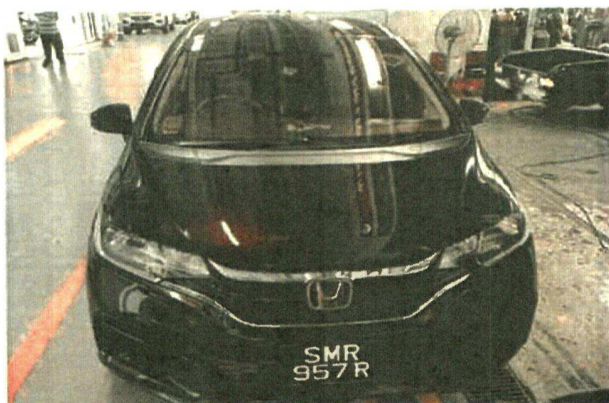

**Note:** This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.