

ASS. REC. BY:

REF:

CSI / LAW 23006067 / Dny3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

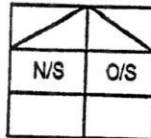Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: FBK 632 u Yr Regn: 13/2/2015Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Piaggio vespa c.c. 150Colour Blue A/C: Insured / Std / NI / NASp. Reading _____ T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ZAPM 812 000000 * 3002Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: NII / S/Rim / STD A/Rim orTyre Size: F: 110/70-11

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /TOYO / YOKO or

Front _____ Rear _____

R/Bal. 3 mm R/Bal. 3 mm

L/Bal. _____ mm L/Bal. _____ mm

D.O.A. _____ D.O.I. _____

Survey held at _____

Des. of Damages: Frnt / Rear / O/S / N/S / U/C / Rooftop orThe U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐ : Preli. Report

1) _____

☐ : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS. \$ _____

Photos _____

Others _____

TOTAL

Report Format : _____

Lump Sum / I.B.I. (\$) _____



Advanced Automotive Consultancy Pte Ltd

Bussiness Regn No: 201416413W

ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT

1 REFERENCE	
Our reference no	: TP/FBK632U/EB/0120/08
Date of request	: 21-Jan-2020
Date of survey	: 21-Jan-2020
Date of accident	: 17-Jan-2020
Requested by	: PEH WEE SIANG C/o , Blk 25 Kaki Bukit Rd 4 Synergy@KB, #03-79.Singapore 417800
Type of claim	: Third party
Workshop	: EQUATOR BROTHERHOOD Blk 25, Kaki Bukit Rd 4 Synergy@KB, #03-79 Singapore 417800
2 DETAILS OF VEHICLE	
Registration No.	: FBK632U
Make & Model	: PIAGGIO VESPA PRIMAVERA 150
Date of registration	: 13-Feb-2015
Engine No.	: M812M1003528
Engine Capacity	: 150CC
Chassis No.	: ZAPM8120000003002
Speedometer reading	: -
Colour	: BLUE
3 STATIC CHECK	
Steering	: Distorted
Footbrake	: In order
Handbrake	: In order
Paintwork	: Good
Modification	: Nil
General condition	: Good
4 TYRE CONDITION	
	<u>Nearside/Make</u>
Front tyre	: 3mm/Michelin
Rear tyre	: 3mm/Michelin
	<u>Size</u>
	110/70-11
	110/70-11
5 POINT OF IMPACT	
The said vehicle has sustained an impact damages on the front, left and right portion. Kindly refer to the attached photographs for more detail of the damages.	
6 REMARK	
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.	

Advanced Automotive Consultancy Pte Ltd

Annex A : Assesement / Adjustment on Spare Parts

TP/FBK632U/EB/0120/08

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)	
List Items							
1	Vespa front signal light	broken/cracked	2	\$130.00	10%	\$117.00	✓
2	Vespa upper handle bar cover fairing	cracked	1	\$160.00	10%	\$144.00	✓
3	Vespa bottom handle bar cover fairing	cut/scratched	1	\$160.00	10%	\$144.00	✓
4	Vespa handle bar	distorted	1	\$140.00	10%	\$126.00	✓
5	Vespa upper body trimming (chrome)	cut/grazed	2	\$170.00	10%	\$153.00	✓
6	Vespa lower body trimming (chrome)	grazed/cut	2	\$200.00	10%	\$180.00	✓
7	Vespa mudguard	broken	1	\$180.00	10%	\$162.00	✓
8	Vespa floorboard	distorted	1	\$200.00	10%	\$180.00	✓
9	Vespa front panel cover fairing (horn cover)	missing	1	\$90.00	10%	\$81.00	✓
10	Vespa compartment cover fairing (center)	grazed/cut/cracked	1	\$300.00	10%	\$270.00	✓
11	Vespa compartment panel (center)	grazed/cut	1	\$100.00	10%	\$90.00	✓
12	Vespa steering cone bearing	necessary	1	\$150.00	10%	\$135.00	HL
13	Vespa front rim	grazed/wobble	1	\$350.00	10%	\$315.00	R
14	Vespa front wheel bearing	rattle/distorted	1	\$50.00	10%	\$45.00	HL
15	Vespa front wheel seal	necessary	1	\$20.00	10%	\$18.00	HL
	Vespa front suspension aluminium bracket (left)	grazed	1	\$85.00	10%	\$76.50	✓
16	Vespa front suspension	distorted/grazed	1	\$480.00	10%	\$432.00	✓
17	Vespa brake master cylinder (right)	malfunction	1	\$200.00	10%	\$180.00	HL
18	Vespa engine mounting (left)	missing/broken	1	\$160.00	10%	\$144.00	HL
19	Vespa engine mounting fairing blue (left)	grazed/cut	1	\$50.00	10%	\$45.00	HL
20	Vespa engine mounting cover matte black (left)	grazed	2	\$50.00	10%	\$45.00	✓
21	Vespa pillion footrest	grazed/cut	2	\$110.00	10%	\$99.00	✓
22	Vespa pillion footrest cover	grazed	2	\$50.00	10%	\$45.00	✓
23	Vespa rear signal light	intact	2	\$130.00	100%	\$0.00	HL
24	Vespa front brake lever (left)	grazed	1	\$55.00	10%	\$49.50	✓
25	Vespa rear brake lever (right)	broken	1	\$55.00	10%	\$49.50	✓
26	Vespa rear brake cable	distorted	1	\$65.00	10%	\$58.50	HL
27	Vespa front panel cover (chrome)	missing	3	\$105.00	10%	\$94.50	✓
28	Vespa headlight	cracked	1	\$280.00	10%	\$252.00	✓
29	Vespa headlight rim	grazed/cut	1	\$75.00	10%	\$67.50	✓
30	Vespa front brake disc	warped	1	\$150.00	10%	\$135.00	HL
31	Vespa front brake pad	intact	1	\$45.00	100%	\$0.00	HL
32	Vespa mirror	bent/grazed	2	\$200.00	10%	\$180.00	✓
33	Vespa Piaggio logo	necessary	1	\$35.00	10%	\$31.50	✓
34	Vespa mudguard trim (chrome)	cracked	1	\$45.00	10%	\$40.50	✓
35	Vespa grip set	cut	1	\$45.00	10%	\$40.50	✓
36	Vespa box	grazed	1	\$350.00	10%	\$315.00	✓

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)	
37	Vespa box rack	distorted	1	\$150.00	10%	\$135.00	✓
38	Vespa floor board cover (matte black)	grazed/cut	1	\$45.00	10%	\$40.50	✓
39	Vespa floor board rubber set	grazed/cut	1	\$40.00	10%	\$36.00	✓
40	Vespa engine cover (silver)-left	grazed/cut	1	\$180.00	10%	\$162.00	HN
41	Vespa engine air duct	deformed	1	\$45.00	10%	\$40.50	HN
42	Vespa seat under compartment tray (black)	deformed/cut	1	\$75.00	10%	\$67.50	✓
43	Vespa main stand	grazed/bent	1	\$120.00	10%	\$108.00	✓
44	Vespa horn	dented	1	\$25.00	10%	\$22.50	HN
				\$5,900.00		\$5,152.50	
S/Nett Items							
1	Tire front	serviceable	1	\$120.00		\$0.00	HN
2	Number plate (front)	necessary	1	\$15.00		\$15.00	✓
				\$135.00		\$15.00	
Total for Spare Parts :				\$6,035.00		\$5,167.50	

Advanced Automotive Consultancy Pte Ltd

Annex B : Adjustment on Labour and Spray Painting

TP/FBK632U/EB/0120/08

Item	Job Description	Workshop Est. (\$)	Adjusted Cost (\$)
1	To remove & replace front rim, front wheel bearing, front suspension, steering cone, front brake disc, etc.	\$300.00	\$200.00 50/-
2	To remove & replace, panel beating on the above body damaged parts, check wiring & lighting system	\$800.00	\$650.00 300/-
3	To putty and complete spray painting	\$1,000.00	\$800.00 200/-
4	To conduct chassis alignment	\$850.00	\$750.00 120/-
5	Towing -from traffic police compound to workshop	\$60.00	\$60.00 30/-
6	Towing -workshop to accident reporting center	\$60.00	\$60.00 30/-
7	Towing -accident reporting center to workshop	\$60.00	\$60.00 30/-
		<u>\$3,130.00</u>	<u>\$2,580.00</u>
TOTAL FOR LABOUR & SPRAY PAINTING :		<u>\$3,130.00</u>	<u>\$2,580.00</u>

760.00

Summary

	Workshop Est. (\$)	Adjusted Cost (\$)
TOTAL FOR SPARE PARTS :	\$6,035.00	\$5,167.50
TOTAL FOR LABOUR & SPRAY PAINTING :	\$3,130.00	\$2,580.00
TOTAL REPAIR COSTS :	<u>\$9,165.00</u>	<u>\$7,747.50</u>

* Parts indicated as NW, mostly not supported by photos.

* Sticker show engine cover used back.

4627.00

4/5 3,700/-

6 days

Advanced Automotive Consultancy Pte Ltd

TP/FBK632U/EB/0120/08

Annex C: Recommendation

We have inspected thoroughly the actual damages found on the vehicle and our assessment is appended in the Annex(es) attached. The condition and age of the vehicle was considered before we reached our recommendation as to whether the parts need replacement or repair.

M/S Equator Brotherhood estimated repair cost is **S\$9,165.00** and we have adjusted it to **S\$7,747.50** on a part by part basis. However, taking into consideration the age of the vehicle and the availability of used/recondition components. We, therefore recommend a contract lump sum repair cost.


The repairer have agreed to undertake the repairs on a contract lump sum of **S\$6,200.00**, according to acceptable quality and standard. (Repairer discretion to repair parts, to replace with old parts, or to replace with OEM or genuine parts).

The entire repair of the damaged vehicle should be completed within a reasonable period of 12 working days.

We have advised the repairer that the inspection was conducted strictly on a WITHOUT PREJUDICE basis and we have not given any instruction and authorisation to proceed with the repair of the vehicle.

We are reverting the matter to you for your discretion and enclosed is our invoice for service rendered.

Yours faithfully,



Henry Low
Automotive License Appraiser
CMTM, DMTM, IPTM (UNF)

