

Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 110A Arab Street Singapore 199806

Tel: +65 92324941 / +65 66523352; Fax: +65 67220690

E mail – mail.stappraisal@gmail.com

Mailing Address: 161 Alexandra Post Office Singapore 911506

Invoice No : **06508**

ORIGINAL

INVOICE

Date: 7th July 2023

Our Ref : TP / YKA SMY735C/ 05.30/23

Your Ref :

CUSTOMER PARTICULARS

Name	: Mr Ee Ching Kiong
Address	: No 33B
	: Meragi Road
	: Singapore 487948

ASSIGNMENT

TP Motor Claims by SMY 735 C

DESCRIPTION

A set of Survey Report, correspondence & consultation. Other disbursements incurred.
Transport charges.

AMOUNT CHARGEABLE

\$500.00

TOTAL

\$500.00

Terms of payment: 7 days from date of invoice
All Payments please make payment to "ST Appraisal Services"



Authorised Signature

Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 110A Arab Street Singapore 199806

Mobile: +65 92324941 / +65 66523352 Fax: +65 67220690

Mailing Address : 161 Alexandra Post Office Singapore 911506

Email: mail.stappraisal@gmail.com

Date : 7th July 2023

Our Ref : TP / YKA SMY735C/ 05.30/23

Your Ref :

Mr Ee Ching Kiong

No 33B

Meragi Road

Singapore 487948

DAMAGED VEHICLE (SMY 735 C) INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows:-

(A) Reference

Name of Claimant	: Mr Ee Ching Kiong	Date of Request	: 12 th June 2023
		Referred By	: Insured
Policy No.	: Please Advice	Date of Inspection	: 12 th June 2023
Claim No.	: Please Advice	Date of Re-inspection	:
Accident Date	: 30 th May 2023	Sum Insured	: NA
Repairer	: M/s Yeow Koon Auto Care Pte Ltd	Excess Amount	: NA
	Blk 3012 Bedok Industrial Park E	3 rd Party Vehicle	: Please Advice
	#01-2016, Singapore 489978	3 rd Party Insurer	: Please Advice

(B) Particulars of Vehicle

Registration No	: SMY 735 C	Mileage	: 21785 km
Make & Model	: HYUNDAI CN7 AVANTE	Engine No	: G4FMLU192811
Year of Registration	: 10 th Feb 2021	Chassis No.	: KMHLN41ETMU094600
Colour	: Blue	Engine Capacity.	: 1,598 cc

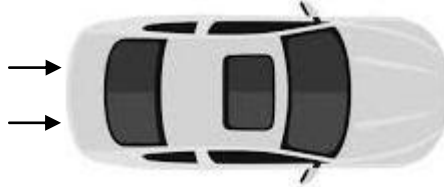
(C) Pre-Accident Condition (Static Test Only)

Steering	: Serviceable	Paint Work	: Good
Foot-brake	: Serviceable	Modification	: NIL
Hand-brake	: Serviceable	General Condition	: Good

(D) Tyre Condition

	Tread Depth	Make	Size
Front Right	70 %	KUMHO	225/45 R17
Front Left	70 %	KUMHO	225/45 R17
Rear Right	70 %	KUMHO	225/45 R17
Rear Left	70 %	KUMHO	225/45 R17

(E) Point of Impact

The damages sighted were consistent with the reported accident.	
---	--

(F) General Description of Damages

The impact of the collision has damaged/affected the rear bumper, rear bumper lower spoiler, bumper sensor and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken.

(G) Recommendation

We have inspected thoroughly the actual damages found on the vehicle, before we arrived at our recommendation as to whether the parts needed replacement or repairs.

Our adjusted cost of lump sum repair is **\$4,000.00** and an estimated **4** days is required to repair the vehicle. Please refer to the Annex for a detailed account of the cost estimates.

(H) Remarks

We have not authorized the repairs. However for information, under normal circumstances, the repairs should not exceed **4** days.

This inspection was conducted on a “**without prejudice**” basis.

We are pleased to advice that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

ST Appraisal Services



Thiruchelvam Dinesh
B.Bus. (International) Business and Marketing
Motor Vehicle Assessor

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS FOR VEHICLE NO: SMY 735 C**Adjustment of Spare Parts Costs for Repairs**

Item	Qty	Vehicle parts description	Condition / Remark	Estimated by workshop	Disc. (%)	Adjusted cost
1	1	Boot lid	dented	1782.40	10	1604.16
2	1	Boot lid lock	malfunction	187.90	10	169.11
3	1	Boot lid badge - AVANTE	necessary	46.25	10	41.63
4	1	Boot lid label - ELITE	necessary	38.73	10	34.86
5	1 set	Boot lid inner board clip	necessary	48.00	10	43.20
6	1	Boot lid centre reflector	serviceable	368.00	100	0.00
7	2	Taillamp	serviceable	774.00	100	0.00
8	1	Rear bumper	damaged	524.70	10	472.23
9	1	Rear bumper bracket	serviceable	68.60	100	0.00
10	1	Rear bumper side retainer	serviceable	46.20	100	0.00
<u>Special Items</u>						
1	1	Rear number plate	damaged	60.00		45.00
2	1	Rear bumper sensor	malfunction	280.00		260.00
3	1	Rear bumper lower spoiler	cut/damaged	700.00		650.00
4	1	Rear bumper lower sticker	necessary	40.00		30.00
				4964.78		3350.18

Adjustment of Labour Costs for Repairs

To remove and replaced damaged parts including straightening and repositioning replacement parts.	900.00	750.00
Supply paint material and to respray replaced and affected panels.	800.00	650.00
To carry out anti rust treatment.	100.00	60.00
To remove and replace rear bumper sensor. To check for proper functions.	100.00	70.00
To remove/refit rear interior fittings and attachments to facilitate repair.	150.00	120.00
Total labour	2050.00	1650.00

Adjustment Parts and Labour Costs of Repairs

	Estimated by workshop	Adjusted cost
TOTAL PARTS COSTS	4964.78	3350.18
TOTAL LABOUR COSTS	2050.00	1650.00
TOTAL REPAIR COSTS	7014.78	5000.18

ADJUSTED REPAIR COST	4000.00
-----------------------------	----------------











