

VEHICLE DAMAGE ASSESSMENT REPORT

To: PEA SIN HUP

CC: RS Garage Services Pte Ltd
2 Balestier Road #04-665
Balestier Hill Shopping Centre
Singapore 320002

REFERENCES

Ref No	: 2023/02033	Date of Report	: 22/2/2023
Claim Type	: Third Party	Date of Request	: 7/2/2023
Third party vehicle	: SNE1888G	Date of Accident	: 14/12/2023
Insured Vehicle	:	Date of Inspection	: 7/2/2023
Your Reference No	: -		

DAMAGED VEHICAL PARTICULARS

Registration Plate No	: SNE1888G	Engine Modification	: NIL
Model / Make	: MERCEDES BENZ GLC250D	Pre-accident damage	: NIL
Colour	: BLACK	General Condition	: Good
Manufacturing Year	: 2017	General Paint Work	: Good
Engine No	: 65192134211335	Steering	: Affected
Engine Capacity	: 2143 CC	Handbrake	: Serviceable
Chassis No	: WDC2533092F299418	Footbrake	: Serviceable
Odometer No	: 92664 KM		
Transmission	: Auto		

TYRES CONDITION

Front Right		Rear Left	
Make	: Michelin	Make	: Michelin
Size	: 275/45ZR20 6	Size	: 275/45ZR20 7
Front Left		Rear Right	
Make	: Michelin	Make	: Michelin
Size	: 275/45ZR20 6	Size	: 275/45ZR20 7

The above millimetres represent the remaining life of tyre treads

VEHICAL REPAIR COST

<u>Descriptions</u>	<u>Repairer (S\$)</u>	<u>Difference (S\$)</u>	<u>Adjuster (S\$)</u>
Parts	20,549.93		14,410.37
Labour	3,800.00		2,610.00
Calculated Cost (S\$) :	24,349.93	7,329.56	17,020.37


Recommended Lump Sum Repair Cost (S\$)	: 13,600.00
Estimate Repair Duration	: 6
Survey Inspection At	: RS Garage Services Pte Ltd
Survey Inspection Address	: 2 Balestier Road #04-665 Balestier Hill Shopping Centre Singapore 320002

DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **Front N/S** Portion.

Front bumper assy, front n/s headlamp, front n/s fender, front n/s rim, front n/s undercarriage etc.

Please see attached scheduled details.

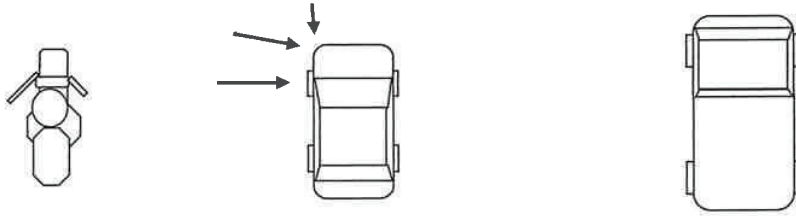

SPECIAL REMARKS

We have not authorised repair. Under normal circumstances, estimated **06** working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

A handwritten signature in black ink, followed by a circular blue stamp. The stamp contains the text 'PRECISE APPRAISER PTE LTD' around the perimeter.

Anthony
Automotive Appraiser
MSAAA

Disclaimer:

This survey was conducted by Precise Appraiser Pte Ltd without prejudice basis and we do not authorized repair. Report by Precise Appraiser Pte Ltd is deemed as confidential and provided for the use of clients and appointed agent. *We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle.* All findings and recommendations are listed accordingly and final decision of settlement to your good selves parts thereof accordingly and final. No liability shall be attached to Precise Appraiser Pte Ltd therefore.

Our Reference : 2023/02033

Your Reference:

Vehicle Number : SNE1888G

S/N	Qty	Description	Condition	Repairer Estimate (S\$)	Our Assessment (S\$)
Parts					
1	1pcs	Front fender LH	Bent	1,200.00	1,026.22
2	1pcs	Front fender arch garnish LH	Cracked	300.00	277.31
3	1pcs	Front fender inner shield front LH	Torn/Deformed	300.00	244.96
4	1pcs	Front fender inner shield rear LH	Serviceable	156.44	Xnn
5	1pcs	Head lamp LH	Cracked	5,000.00	3,528.32
6	1pcs	Head lamp side bracket LH	Bent	85.43	85.43
7	1pcs	Front bumper	Deformed/Cracked	2,500.00	2,196.25
8	2pcs	Front bumper sensor	Malfunction	600.00	440.44
9	4pcs	Front bumper sensor holder	Necessary	72.92	72.92
10	2pcs	Front bumper side retainer	N/S Cracked	300.00	148.36
11	1pcs	Front bumper reinforcement	Bent	600.00	504.88
12	1pcs	Front bumper sponge	Cracked	200.00	198.22
13	1pcs	Front bumper lower	Deformed/Cracked	1,000.00	856.36
14	1pcs	Front bumper fog lamp cover	Deformed/Cracked	200.00	151.34
15	1pcs	Horn	Cracked	200.00	185.66
16	1pcs	Front lower arm LH	Bent	1,000.00	828.63
17	1pcs	Front knuckle arm LH	Bent	2,000.00	1,440.56
18	1pcs	Front knuckle arm bearing LH	Warp	1,000.00	702.55
19	1pcs	Front stabilizer bar	Serviceable	954.55	Xnn
20	1pcs	Front stabilizer bar link	Serviceable	183.22	Xnn
21	1pcs	Front upper arm	Bent	1,000.00	943.56
Total				18,852.56	13,831.97
Less 5%				942.63	691.60
Parts Sub Total				17,909.93	13,140.37

Special Nett

22	1sets	Front fender arch garnish clips	Cracked/Deformed	80.00	50.00
23	1sets	Front fender inner shield clips	Cracked/Deformed	80.00	50.00
24	2 sets	Front fender emblem BITURBO	Necessary	200.00	120.00
25	1sets	Front bumper clips	Cracked/Deformed	80.00	50.00
26	1sets	Front rim	Grazed/Dented	800.00	500.00
27	1sets	Front tyre	Serviceable	400.00	Xnn
28	1sets	Front shock absorber	Bent	1,000.00	500.00
Total				2,640.00	1,270.00

Labour					
1	To check wiring system.			100.00	50.00
2	To reprogramme after the accident repair works .			300.00	200.00
3	To conduct wheel alignment (Before and After)			200.00	140.00
4	To remove, renew and refit the front undercarriage to facilitate the repair			400.00	250.00
5	To carry out body cavity preservation			100.00	30.00

6	To panel beat and straighten on front fender inner panel. To R&R front bumper, front LH fender and others attachments.	1,200.00	900.00
7	To respray on the front bumper, front LH fender, front fender inner panel and accident-affected area.	1,200.00	900.00
8	To conduct wheel balancing to facilitate the repair	50.00	30.00
9	To remove, renew and refit tyre to facilitate the repair	50.00	30.00
10	To remove, renew and refit the reverse sensor to facilitate the repair	200.00	80.00
Labour Total		3,800.00	2,610.00
Sub Total (labour and parts)		24,349.93	17,020.37

600

600

40

1300

11399.74

4/5 9100

06days *

Adjustment / Recommendations

Note: For Lump Sum Repair

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or use of ex-stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements).

The final adjusted Lump Sum contract amount is **S\$13,600.00**

Under normal circumstances, the repair period would be about 6 working days.