

A.S.S. REC. BY: Kam

REF:

NS/INC22002285/Rtc

369K

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHB 54244at Workshop m/s SMRTof 60, HUNMANYS Ind PKEYInsured: INC

Policy No. _____

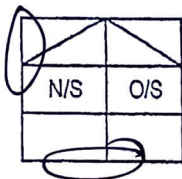
Claims No. MT/1164616-003

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHB 54244 Yr Regn: 2017 / NOVType: M.Car / M.Cycle / Bus / Van / Lorry / Truck / Prime Mover /

Truck / Trailer or _____

Make: TOYOTA PRIUS HYBRID 1.8 c.c. 1798Colour: MARON A/C: Insured / Std / NI / NA

Sp. Reading: _____ T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTDK B3PU 2035 TSS 70Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: NII / STD A/Rlm orTyre Size: F: 195/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

SAILUN

Front

Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 08/03/22 D.O.I. 10/03/22Survey held at SMRT

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S FRT & REAR

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT - 20Kcost of repair of L/S \$15,450.00 /- with 14 days of repairRED: 51462.84;76%

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 14

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Report Format: _____

Lump Sum / L.S. / (

Case Details

Case Reference Number : TAX/03/22/2020
Type of Repair : Accident Repair
Vehicle Registration Number : SHB5424Y

Company Type : Strides Taxi Pte Ltd
Estimation ID : EST-17699-ID
Assigned By : Wei Siong #

Insurance Company Name : NTUC Income Insurance Co-operative Ltd
Accident Date and Time : 08/03/2022 10:30 AM
Vehicle Age(In Months) : -

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			COVER, FR BUMPER	1	495.50	495.50	25.00	371.63	Replace	1	371.63	Replace	for ✓
Standard	Main			SUPPORT, FR BUMPER RH	1	76.90	76.90	25.00	57.68	Replace	0	0	Not Give	X11
Standard	Main			SUPPORT, FR BUMPER LH	1	82.30	82.30	25.00	61.72	Replace	1	61.72	Replace	ca ✓
Standard	Main			REINFORCEMENT FRONT UPPER	1	691.10	691.10	25.00	518.33	Replace	0	0	Not Give	X11
Standard	Main			ABSORBER, FR BUMPER	1	70.30	70.30	25.00	52.72	Replace	0	0	Not Give	X11
Standard	Main			EXTENSION SUB-ASSY, LH	1	116.30	116.30	25.00	87.23	Replace	0	0	Not Give	X11
Standard	Main			REINFORCEMENT FRONT LOWER	1	238.50	238.50	25.00	178.88	Replace	0	0	Not Give	X11
Standard	Main			ABSORBER, FR BUMPER LOWER	1	117.00	117.00	25.00	87.75	Replace	0	0	Not Give	X11
Standard	Main			GRILLE, RADIATOR	1	165.00	165.00	25.00	123.75	Replace	0	0	Not Give	X11
Standard	Main			GRILLE SUB-ASSY	1	335.60	335.60	25.00	251.70	Replace	0	0	Not Give	X11
Standard	Main			CLIPS PIECE, FRT & RR BUMPER	10	1.50	15.00	25.00	11.25	Replace	10	11.25	Replace	re ✓
Standard	Main			RETAINER, FR BUMPER, LH & RH	1	8.50	8.50	25.00	6.38	Replace	0	0	Not Give	X11
Standard	Main			COVER ASSY, ENGINE	1	180.10	180.10	25.00	135.08	Replace	0	0	Not Give	X11
Standard	Main			COVER ASSY, ENGINE UNDER CENTER SET	1	452.80	452.80	25.00	339.60	Replace	0	0	Not Give	X11
Standard	Main			COVER, ENGINE UNDER CENTER	1	94.50	94.50	25.00	70.88	Replace	0	0	Not Give	X11

Total Spare Part Cost 34,736.35

Lump Sum Discount (%) 20.00

Final Spare Part Cost 27,789.08

Surveyor Total 8,367.85

Lump Sum Dis (%) 20

Final Sur Total 6,694.28

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			COVER, ENGINE UNDER SIDE RH	1	76.90	76.90	25.00	57.68	Replace	0	0	Not Give	Xan
Standard	Main			COVER, ENGINE UNDER SIDE LH	1	76.90	76.90	25.00	57.68	Replace	0	0	Not Give	Xan
Standard	Main			COVER, ENGINE UNDER, REAR	1	36.50	36.50	25.00	27.38	Replace	0	0	Not Give	Xan
Standard	Main			LAMP ASSY, FOG, LH	1	910.20	910.20	10.00	819.18	Replace	0	0	Check	?
Standard	Main			UNIT , HEADLAMP , LH	1	2,558.90	2,558.90	10.00	2,303.01	Replace	1	2,303.	Replace	cut/
Standard	Main			COMPUTER SUB-ASSY, HEADLAMP, LH NO.1	1	486.40	486.40	10.00	437.76	Replace	0	0	Not Give	Xan
Standard	Main			SUPPORT S/A UPPER,	1	364.90	364.90	25.00	273.67	Replace	0	0	Not Give	Xan
Standard	Main			SUPPORT S/A LH	1	237.00	237.00	25.00	177.75	Replace	0	0	Not Give	Xan
Standard	Main			FENDER SUB-ASSY, FR , LH	1	933.10	933.10	100.00	0.00	Repair	1	0	Repair	R
Standard	Main			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	52.90	25.00	39.68	Replace	1	39.67	Replace	na/
Standard	Main			LINER, FR FENDER, LH	1	194.30	194.30	25.00	145.73	Replace	1	145.7	Replace	cut/
Standard	Main			PAD, FR WHEEL LH	1	57.70	57.70	25.00	43.28	Replace	0	0	Check	?
Standard	Main			SEAL SUB-ASSY, LH	1	50.20	50.20	25.00	37.65	Replace	0	0	Not Give	Xan
Standard	Main			PROTECTOR, FR FENDER LH	1	90.40	90.40	25.00	67.80	Replace	0	0	Not Give	Xan
Standard	Main			APRON SUB-ASSY, FRONT FENDER , LH	1	944.20	944.20	25.00	708.15	Replace	0	0	Not Give	Xan
Standard	Main			WHEEL, DISC FRONT	1	1,555.10	1,555.10	25.00	1,166.32	Replace	1	0	Repair	R
Standard	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	0	0	Not Give	Xan
Standard	Main			HUB & BEARING ASSY, RH & LH	1	554.20	554.20	25.00	415.65	Replace	0	0	Check	?
Standard	Main			PILLAR, FRONT BODY, LH	1	339.40	339.40	25.00	254.55	Replace	0	0	Not Give	Xan
Standard	Main			COVER SUB-ASSY, FRONT PILLAR , UPR LH	1	96.90	96.90	25.00	72.68	Replace	0	0	Not Give	Xan
Standard	Main			MOULDING ASSY, BODY ROCKER PANEL , LH	1	576.00	576.00	25.00	432.00	Replace	0	0	Not Give	Xan
Standard	Main			COVER, FRONT FLOOR UNDER , LH	1	425.50	425.50	25.00	319.13	Replace	0	0	Not Give	Xan

Total Spare Part Cost 34,736.35

Surveyor Total 8,367.85

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 27,789.08

Final Sur Total 6,694.28

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation						Surveyor Approval				Remarks
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
Standard	Main			SHAFT ASSY, FRONT DRIVE, LH	1	1,175.10	1,175.10	25.00	881.32	Replace	0	0	Not Give	Xm
Standard	Main			KNUCKLE, STEERING, LH	1	555.20	555.20	25.00	416.40	Replace	0	0	Check	?
Standard	Main			DISC, BRAKE FRONT	1	416.30	416.30	25.00	312.23	Replace	0	0	Not Give	Xm
Standard	Main			WHEEL ASSY, STEERING	1	2,880.20	2,880.20	25.00	2,160.15	Replace	0	0	Not Give	Xm
Standard	Main			END SET, TIE ROD, LH	1	155.90	155.90	25.00	116.93	Replace	0	0	Not Give	Xm
Standard	Main			ABSORBER SET, SHOCK, FRONT LH	1	398.10	398.10	25.00	298.58	Replace	0	0	Not Give	Xm
Standard	Main			LOWER ARM SUB-ASSY, FRONT LH	1	631.60	631.60	25.00	473.70	Replace	0	0	Check	?
Standard	Main			BAR, STABILIZER, FR	1	356.00	267.00	25.00	267.00	Replace	0	0	Not Give	Xm
Standard	Main			MIRROR ASSY, OUTER REAR VIEW, LH	1	1,283.90	1,283.90	10.00	1,155.51	Replace	0	0	Not Give	Xm
Standard	Main			COVER, OUTER MIRROR, LH	1	89.50	89.50	25.00	67.13	Replace	0	0	Not Give	Xm
Standard	Main			PANEL SUB-ASSY, FRONT DOOR LH	1	1,249.60	1,249.60	25.00	937.20	Replace	0	0	Not Give	Xm
Standard	Main			STICKER STRIDES TAXI (DOOR)	1	60.00	60.00	0.00	60.00	Replace	0	0	Not Give	Xm
Standard	Main			HINGE ASSY, FRONT DOOR, UPPER LH	1	82.10	82.10	25.00	61.57	Replace	0	0	Not Give	Xm
Standard	Main			HINGE ASSY, FRONT DOOR, LOWER LH	1	92.10	92.10	25.00	69.07	Replace	0	0	Not Give	Xm
Standard	Main			COVER, RR BUMPER ASSY	1	423.90	423.90	25.00	317.92	Replace	1	317.92	Replace	dis ✓
Standard	Main			REAR BUMPER REINFORCEMENT	1	318.80	318.80	25.00	239.10	Replace	1	239.10	Replace	bt ✓
Standard	Main			PAD, RR BUMPER, RH & LH, 1	2	3.80	7.60	25.00	5.70	Replace	2	5.70	Replace	nee ✓
Standard	Main			PAD, RR BUMPER, RH & LH, 2	2	3.80	7.60	25.00	5.70	Replace	2	5.70	Replace	nee ✓
Standard	Main			PAD, RR BUMPER, RH & LH, 3	2	3.80	7.60	25.00	5.70	Replace	2	5.70	Replace	nee ✓
Standard	Main			PAD, RR BUMPER, CTR	3	2.20	6.60	25.00	4.95	Replace	3	4.95	Replace	nee ✓
Standard	Main			SEAL, RR BUMPER ARM, RH & LH	2	11.00	22.00	25.00	16.50	Replace	2	16.50	Replace	nee ✓
Standard	Main			STOPPER, RR BUMPER, RH & LH	2	4.30	8.60	25.00	6.45	Replace	0	0	Not Give	Xm

Total Spare Part Cost 34,736.35

Lump Sum Discount (%) 20.00

Final Spare Part Cost 27,789.08

Surveyor Total 8,367.85

Lump Sum Dis (%) 20

Final Sur Total 6,694.28

BOM Type	Costing Type	Portion	SMRT Recommendation							Surveyor Approval				Remarks
			Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
Standard	Main			RETAINER, RR BUMPER, RH	1	112.70	112.70	25.00	84.53	Replace	0	0	Not Give	Xan
Standard	Main			RETAINER, RR BUMPER, LH	1	111.50	111.50	25.00	83.63	Replace	0	0	Check	?
Standard	Main			SEAL, RR BUMPER, RH	1	85.20	85.20	25.00	63.90	Replace	0	0	Not Give	Xan
Standard	Main			SEAL, RR BUMPER, LH	1	85.20	85.20	25.00	63.90	Replace	0	0	Not Give	Xan
Standard	Main			CLIPS PIECE, FRT & RR BUMPER	10	1.50	15.00	25.00	11.25	Replace	10	11.25	Replace	new
Standard	Main			GUARD, RR BUMPER, LOWER	1	558.30	558.30	25.00	418.72	Replace	1	418.72	Replace	des
Standard	Main			FILLER, RR BUMPER, RH	1	119.90	119.90	25.00	89.93	Replace	1	89.93	Replace	mis
Standard	Main			FILLER, RR BUMPER, LH	1	119.90	119.90	25.00	89.93	Replace	1	89.93	Replace	mis
Standard	Main			COVER, GUARD RR BUMPER LOWER	1	14.80	14.80	25.00	11.10	Replace	1	11.10	Replace	des
Standard	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	1	180.00	Replace	new
Standard	Main			ANTENNA, ELECTRICAL KEY	1	60.30	60.30	10.00	54.27	Replace	0	0	Check	?
Standard	Main			REAR BUMPER GROMMET SCREW	2	2.20	4.40	25.00	3.30	Replace	0	0	Not Give	Xan
Standard	Main			LENS & BODY, REAR COMBINATION LAMP, RH	1	438.10	438.10	10.00	394.29	Replace	0	0	Not Give	Xan
Standard	Main			LENS & BODY, REAR COMBINATION LAMP, LH	1	438.10	438.10	10.00	394.29	Replace	1	394.29	Replace	can
Standard	Main			LENS & BODY ASSY, RR BUMPER, RH	1	486.80	486.80	10.00	438.12	Replace	0	0	Not Give	Xan
Standard	Main			LENS & BODY ASSY, RR BUMPER, LH	1	486.80	486.80	10.00	438.12	Replace	1	438.12	Replace	can
Standard	Main			COVER, REAR COMBINATION LAMP, RH	1	54.00	54.00	25.00	40.50	Replace	0	0	Not Give	Xan
Standard	Main			COVER, REAR COMBINATION LAMP, LH	1	54.00	54.00	25.00	40.50	Replace	0	0	Check	?
Standard	Main			COVER, REAR FLOOR UNDER, RH	1	169.50	169.50	25.00	127.13	Replace	0	0	Not Give	Xan
Standard	Main			COVER, REAR FLOOR UNDER, LH	1	234.30	234.30	25.00	175.73	Replace	1	175.73	Replace	at
Standard	Main			COVER, REAR FLOOR UNDER CENTER	1	222.60	222.60	25.00	166.95	Replace	1	166.95	Replace	des

Total Spare Part Cost 34,736.35

Surveyor Total 8,367.85

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 27,789.08

Final Sur Total 6,694.28

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			PANEL SUB-ASSY, FENDER REAR LH	1	824.80	824.80	25.00	618.60	Replace	1	618.60	Replace	bf✓
Standard	Main			PATCH, SIDE PANEL REAR END, RH & LH	1	33.70	33.70	25.00	25.28	Replace	0	0	Not Give	X17
Standard	Main			LINER, REAR FENDER, LH	1	135.80	135.80	25.00	101.85	Replace	0	0	Not Give	X17
Standard	Main			PANEL, QUARTER WHEEL HOUSE, OUTER LH	1	286.80	286.80	25.00	215.10	Replace	0	0	Not Give	X17
Standard	Main			PANEL QUARTER WHEEL HOUSE, INNER LH	1	527.00	527.00	25.00	395.25	Replace	0	0	Not Give	X17
Standard	Main			REINFORCEMENT, QUARTER WHEEL HOUSE, INNER LH	1	56.70	56.70	25.00	42.53	Replace	0	0	Not Give	X17
Standard	Main			COVER SUB-ASSY, REAR QUARTER PILLAR, LH	1	201.30	201.30	25.00	150.98	Replace	0	0	Not Give	X17
Standard	Main			TAIL GATE PANEL SUB-ASSY, BACK DOOR	1	929.60	929.60	25.00	697.20	Replace	1	697.20	Replace	bf✓
Standard	Main			TAIL GATE WEATHERSTRIP, BACK DOOR	1	360.70	360.70	25.00	270.53	Replace	0	0	Check	?
Standard	Main			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	2	27.90	55.80	25.00	41.85	Replace	2	41.85	Replace	nee✓
Standard	Main			TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1	891.20	891.20	25.00	668.40	Replace	1	668.40	Replace	nee✓
Standard	Main			NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1	52.30	52.30	25.00	39.22	Replace	1	39.22	Replace	nee✓
Standard	Main			NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1	52.30	52.30	25.00	39.22	Replace	1	39.22	Replace	nee✓
Standard	Main			NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1	52.30	52.30	25.00	39.22	Replace	1	39.22	Replace	nee✓
Standard	Main			TAIL GATE GLASS SUB-ASSY, BACK DOOR	1	1,569.70	1,569.70	25.00	1,177.28	Replace	0	0	Not Give	X17
Standard	Main			TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR	1	725.90	725.90	25.00	544.43	Replace	1	544.43	Replace	bro✓
Standard	Main			SEALANT W/SCREEN (3PCS)	3	37.00	111.00	0.00	111.00	Replace	3	111.00	Replace	nee✓

Total Spare Part Cost 34,736.35

Surveyor Total 8,367.85

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 27,789.08

Final Sur Total 6,694.28

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			TAILGATE TRIM , UPPER	1	50.50	50.50	25.00	37.88	Replace	0	0	Not Give	X11
Standard	Main			TAILGATE TRIM , RH	1	92.10	92.10	25.00	69.07	Replace	0	0	Not Give	X11
Standard	Main			TAILGATE TRIM , LH	1	92.10	92.10	25.00	69.07	Replace	0	0	Not Give	X11
Standard	Main			TAILGATE TRIM , LOWER	1	218.50	218.50	25.00	163.88	Replace	0	0	Not Give	X11
Standard	Main			TAILGATE BOARD ASSY	1	251.50	251.50	25.00	188.63	Replace	0	0	Not Give	X11
Standard	Main			TAILGATE BOARD , COVER	1	24.10	24.10	25.00	18.08	Replace	0	0	Not Give	X11
Standard	Main	VM		CLIP(FOR FRONT BODY PILLAR GARNISH)	10	2.20	22.00	25.00	16.50	Replace	0	0	Not Give	X11
Standard	Main			TAILGATE BOARD , HANDLE PULL	1	19.50	19.50	25.00	14.63	Replace	0	0	Not Give	X11
Standard	Main			TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2	59.10	118.20	25.00	88.65	Replace	0	0	Not Give	X11
Standard	Main			TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2	59.10	118.20	25.00	88.65	Replace	0	0	Not Give	X11
Standard	Main			TAIL GATE STAY ASSY , BACK DOOR , RH	1	235.00	235.00	25.00	176.25	Replace	0	0	Not Give	X11
Standard	Main			TAIL GATE BOLT, BACK DOOR STAY , RH & LH	2	11.80	23.60	25.00	17.70	Replace	0	0	Not Give	X11
Standard	Main	BODY LH		TAIL GATE STAY BRACKET, BACK DOOR , RH & LH	1	11.80	11.80	25.00	8.85	Replace	0	0	Not Give	X11
Standard	Main			TAIL GATE STAY ASSY , BACK DOOR , LH	1	235.00	235.00	25.00	176.25	Replace	0	0	Not Give	X11
Standard	Main			TAIL GATE LOCK ASSY, BACK DOOR	1	452.10	452.10	10.00	406.89	Replace	0	0	Not Give	X11
Standard	Main			TAIL GATE LOCK COVER , BACK DOOR	1	25.30	25.30	100.00	0.00	Repair	0	0	Not Give	X11
Standard	Main			TAIL GATE STRIKER ASSY, BACK DOOR	1	24.90	24.90	25.00	18.67	Replace	0	0	Not Give	X11
Standard	Main			CLAMP SUB-ASSY, BATTERY	1	41.40	41.40	25.00	31.05	Replace	0	0	Not Give	X11
Standard	Main			CLAMP, BATTERY, NO.2	1	43.30	43.30	25.00	32.47	Replace	0	0	Not Give	X11
Standard	Main			EMBLEM SUB-ASSY REAR	1	46.30	46.30	25.00	34.72	Replace	1	34.72	Replace	X11
Standard	Main			SPOILER SUB-ASSY, REAR	1	1,322.10	1,322.10	25.00	991.57	Replace	0	0	Not Give	X11
Standard	Main			LAMP SET, STOP CENTER	1	186.50	186.50	10.00	167.85	Replace	0	0	Not Give	X11
Total Spare Part Cost									34,736.35	Surveyor Total 8,367.85				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%) 20				
Final Spare Part Cost									27,789.08	Final Sur Total 6,694.28				

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			PROTECTOR, REAR SPOILER	2	14.00	28.00	25.00	21.00	Replace	0	0	Not Give	X11
Standard	Main			WIRE, TAIL GATE BACK DOOR	1	246.80	246.80	10.00	222.12	Replace	0	0	Not Give	X11
Standard	Main			WIRE, TAIL GATE BACK DOOR, NO.2	1	246.80	246.80	10.00	222.12	Replace	0	0	Not Give	X11
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	1	7.80	Replace	X11
Standard	Main			STICKER DECAL 6555 8888	1	21.60	21.60	0.00	21.60	Replace	1	21.60	Replace	X11
Standard	Main			END PANEL SUB-ASSY, BODY LOWER BACK	1	629.80	629.80	25.00	472.35	Replace	0	0	Check	?
Standard	Main			SPARE TYRE PANEL, PAN, REAR FLOOR	1	564.80	564.80	25.00	423.60	Replace	0	0	Not Give	X11
Standard	Main			SEALANT SIKAFLEX	1	37.00	37.00	0.00	37.00	Replace	0	0	Not Give	X11
Standard	Main			MEMBER SUB-ASSY, CENTER FLOOR CROSS, NO.2	1	500.50	500.50	25.00	375.38	Replace	0	0	Not Give	X11
Standard	Main			BRACKET, SPARE WHEEL CLAMP	1	21.30	21.30	25.00	15.98	Replace	0	0	Not Give	X11
Standard	Main			EXTENSION, REAR FLOOR SIDE PANEL, LH	1	76.20	76.20	25.00	57.15	Replace	0	0	Not Give	X11
Standard	Main	Body		BRACKET, REAR BUMPER COVER	1	17.10	17.10	25.00	12.83	Replace	0	0	Not Give	X11
Standard	Main			COVER ASSY, TONNEAU	1	944.20	944.20	25.00	708.15	Replace	0	0	Not Give	X11
Standard	Main			BOARD, REAR FLOOR, NO.1	1	502.20	502.20	25.00	376.65	Replace	0	0	Not Give	X11
Standard	Main	Body		PROTECTOR, DECK BOARD, NO.1	1	21.30	21.30	25.00	15.98	Replace	0	0	Not Give	X11
Standard	Main	Body		HOOK, DECK BOARD, NO.2	1	8.00	8.00	25.00	6.00	Replace	0	0	Not Give	X11
Standard	Main	Body		HOOK, DECK BOARD, NO.1	1	8.00	8.00	25.00	6.00	Replace	0	0	Not Give	X11
Standard	Main			BOX, DECK FLOOR, LH	1	303.40	303.40	25.00	227.55	Replace	0	0	Not Give	X11
Standard	Main			RETAINER, DECK BOARD	2	28.60	57.20	25.00	42.90	Replace	0	0	Not Give	X11
Standard	Main			BOX, DECK FLOOR, RH	1	304.00	304.00	25.00	228.00	Replace	0	0	Not Give	X11
Standard	Main			PANEL ASSY, DECK TRIM SIDE, RH	1	344.70	344.70	25.00	258.53	Replace	0	0	Not Give	X11
Standard	Main			PANEL ASSY, DECK TRIM SIDE, LH	1	344.70	344.70	25.00	258.53	Replace	0	0	Not Give	X11

Total Spare Part Cost 34,736.35

Surveyor Total 8,367.85

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 27,789.08

Final Sur Total 6,694.28

SMRT Recommendation

Surveyor Approval

BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			BOX, DECK FLOOR, REAR	1	102.20	102.20	25.00	76.65	Replace	0	0	Not Give	Xm
Standard	Main			END PANEL, COVER, DECK TRIM SERVICE HOLE	1	47.00	47.00	25.00	35.25	Replace	0	0	Not Give	Xm
Standard	Main			END PANEL, COVER, DECK TRIM, REAR	1	122.80	122.80	25.00	92.10	Replace	0	0	Not Give	Xm
Standard	Main			PANEL SUB-ASSY, REAR DOOR, LH	1	1,243.90	1,243.90	25.00	932.93	Replace	0	0	Not Give	Xm
Total Spare Part Cost									34,736.35	Surveyor Total		8,367.85		
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)		20		
Final Spare Part Cost									27,789.08	Final Sur Total		6,694.28		

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT LH PORTION	1,014.00	400	
2	Main	TO REPAIR REAR PORTION	1,352.00	700	
Total:			2,366.00	1,100.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESRAY REAR DOOR LH	378.00	0 Xm	
2	Main	TO RESPRAY FRONT BUMPER	378.00	200	
3	Main	TO RESPRAY FRONT BUMPER LOWER GRILLE	180.00	0 Xm	
4	Main	TO RESPRAY FRONT SUPPORT PANEL	180.00	0 Xm	
5	Main	TO RESPRAY FRONT FENDER LH	378.00	200	
6	Main	TO RESPRAY FRT MEMBER, LH	180.00	0 Xm	
7	Main	TO RESPRAY FRONT DOOR LH	378.00	0 Xm	
8	Main	TO RESPRAY APRON PANEL LH	180.00	0 Xm	
9	Main	TO RESPRAY FRONT PILLAR LH	180.00	0 Xm	
Total:			5,886.00	1,150.00	

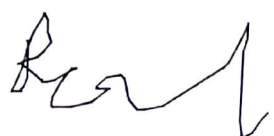
S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
10	Main	TO RESPRAY VIEW MIRROR	180.00	0 Xnn	
11	Main	TO RESPRAY ROCKER PANEL MOULDING	180.00	0 Xnn	
12	Main	TO RESPRAY REAR FENDER LH	378.00	200	
13	Main	TO RESPRAY TAIL LAMP PANEL LH	180.00	0 Xnn	
14	Main	TO RESPRAY REAR CHASSIS LH	180.00	0 Xnn	
15	Main	TO RESPRAY REAR MEMBER, LH	180.00	0 Xnn	
16	Main	TO RESPRAY REAR LH WHEEL HOUSE	180.00	0 Xnn	
17	Main	TO RESPRAY TAIL GATE	378.00	200	
18	Main	TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	100	
19	Main	TO RESPRAY REAR SPOILER	180.00	0 Xnn	
20	Main	TO RESPRAY REAR SPARE TYRE PANEL	180.00	0 Xnn	
21	Main	TO RESPRAY REAR FLOOR SIDE PANEL LH	180.00	0 Xnn	
22	Main	TO RESPRAY FLOOR CORNER PANEL LH	180.00	0 Xnn	
23	Main	TO RESPRAY REAR BUMPER	378.00	200	
24	Main	TO RESPRAY RIM	180.00	50	
25	Main	TO RESPRAY REAR PANEL	180.00	0 Xnn	
Total:			5,886.00	1,150.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TOWING CHARGE	56.00	0 Xnn	
2	Main	TO CHECK WIRING AND SYSTEM FUNCTION	120.00	0 Xnn	
3	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	120.00	60	
4	Main	TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	60	
Total:			1,531.00	465.00	

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
5	Main	TO ALIGN CHASSIS	350.00	0 <i>Xm</i>	
6	Main	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	125.00	
7	Main	TO TRANSFER REAR TAILGATE MECHANISM	120.00	60	
8	Main	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	40	
9	Main	TO REMOVE AND REFIX REAR WINDSCREEN	120.00	120	
10	Main	TO TRANSFER DOOR MECHANISM	120.00	0 <i>Xm</i>	
11	Main	TO WASH AND VACUUM	60.00	0 <i>Xm</i>	
12	Main	TO REPLACE SUNDRY PARTS	100.00	0 <i>Xm</i>	
Total:			1,531.00	465.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	27,789.08	6,694.28
Total Labour Cost	2,366.00	1,100.00
Total Spray Painting	5,886.00	1,150.00
Other	1,531.00	465.00
Overall Total	37,572.08	9,409.28
Lump Sum Repair Option	☐	☒
Lump Sum Total	37,550.00	9,400.00
Surveyor Approved Amount		9,400.00
No of Repair Days*	12	10
Remarks	-	LUMP SUM REPAIR / RESURVEY AFTER PAINT PHOTO / REQUEST NBV .
Surveyor Name		Rasul
Signature		

Estimator Assessment(\$)

Surveyor Assessment(\$)

Survey Date

10/03/2022

(note)

SS2722390005 / Strides Automotive Services Pte Ltd
ENTRY DATE & TIME: 09/03/2022 10:32 (SGT)
SUBMITTED BY: SHANTI B THAIYAL NAYAGI (SMRT05)
VERSION: 1 (09/03/2022 10:32 (SGT))

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	09/03/2022 10:32 (SGT)
Date of Accident	08/03/2022 18:30 (SGT)
Exact Location of Accident	CTE, Singapore
Additional Location Information	CTE TOWARDS CITY
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB5424Y
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	Strides Taxi Pte Ltd
Company Reg No	1XXXXX369K
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Mobile Phone No	(Phone) +65-68662671
Alternative Phone No	(Office) +65-68662672

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1800

INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Type of Coverage	ThirdParty
Fleet Policy	Yes
Policy Number	D-21097466MFSH
Cover Note Number	-

DRIVER

Name of Driver	FARALI KHAN BIN BABU KHAN
NRIC No	SXXXX851G

Date Of Birth	26/07/1953
Occupation	Outdoor
Date Of Driving Pass	08/06/1984
Driving experience	37 YEARS AND 9 MONTHS
Gender	Male
Mobile Number	(Phone) +65-68662672
Alt. Phone Number	-
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Address	11
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	3
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

PASSENGER 1

Name	UNKNOWN
Gender	Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

I WAS TRAVELLING ALONG CTE TOWARDS CITY WITH ONE PASSENGER (MALE INDIAN) ON BOARD. SUDDENLY I FELT AN IMPACT AT THE REAR OF MY TAXI. A VEHICLE GBB8397T HAD COLLIDED ONTO THE REAR OF MY TAXI. THE IMPACT PUSHED MY TAXI TO THE LEFT AND MY TAXI COLLIDED ONTO THE LEFT PORTION OF SHA1818B (COMFORT)

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	FILE TOO BIG
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBB8397T
Vehicle Manufacturer	-
Vehicle Model	-

Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	CHUA BOON CHYE , BENJAMIN
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SHA1818B
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	YEO KOK HONG
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation**.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

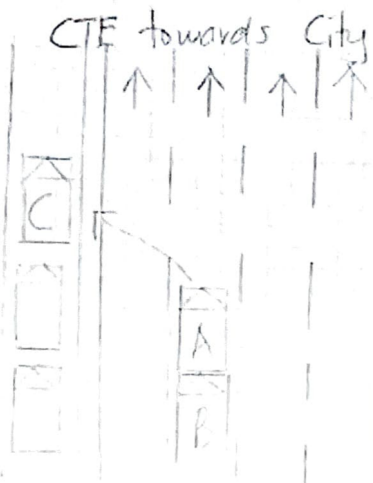


Policyholder's Signature / Date & Time

Sketch Plan

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel



A - SHB5424Y
B - GRB839FT
C - SHH1818B

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	369K
Vehicle No.:	SHB5424Y
Vehicle to be Exported:	No
Intended Deregistration Date:	11 Mar 2022
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS109448
Chassis No.:	JTDKB3FU203575570
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	30 Nov 2017
First Registration Date:	30 Nov 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Nov 2025
PARF Rebate Amount:	\$3,750.00
COE Expiry Date:	29 Nov 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$33,596.00
COE Rebate Amount:	\$15,608.00
Total Rebate Amount:	\$19,358.00

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 11 Mar 2022

OK