



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2500523

16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING
SINGAPORE 048581
ATTN:KAREN TAN

INV Date 20/01/2025
Reference CD/FCI24090010/Rua3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKT 1398K
Insured Veh. SHC 1355J
Claim No. D24007032MFCT/CTPL/TPD-2
Policy No. D-24101861MFCT
Accident Date 10/08/2024
Inspection Date 04/09/2024

Description	Total
Third Party Express Settlement	550.00
Subtotal	550.00
GST (9%)	49.50
Grand Total	599.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS MS FIRST CAPITAL INSURANCE LTD	Ref:	CD/FCI24090010/Rua3q2
16 RAFFLES QUAY	Date:	20/01/2025
#42-01 HONG LEONG BUILDING	Code:	FCI2
SINGAPORE 048581		

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	SHC 1355J	Veh. Inspected	SKT 1398K
Policy No.	D-24101861MFCT	Coverage	0
Claim No.	D24007032MFCT/CTPL/TPD-2	Excess	\$0.00
Assign From	KAREN TAN	Assign Date	02/09/2024

2. Vehicle Details

Make & Model	PORSCHE MACAN S 3.0 A/T ABS D/AIRBAG 4WD	C.C	2997
Engine No.	018511	Year of Reg.	12/02/2015
Chassis No.	WP1ZZZ95ZFLB67248	Colour	GREY
Odometer	62605 KM	Steering	IN ORDER
Brakes	IN ORDER	General	FAIR
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	295/45R20	MICHELIN	6
L/H Front Tyre	295/45R20	MICHELIN	6
R/H Rear Tyre	295/45R20	MICHELIN	6
L/H Rear Tyre	295/45R20	MICHELIN	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	10/08/2024	Inspection Date	04/09/2024
Survey held at	EUROKARS AUTO PTE LTD - 27A TANJONG PENJURU SINGAPORE 609042		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 5 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SKT 1398K

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR DOOR LH (SN)	TO REPAIR SEE LABOUR	\$2,666.90	\$0.00
1	DOOR SEAL OUTER LH (SN)	NOT NECESSARY	\$301.00	\$0.00
1	DOOR SEAL C PILLAR LH(SN)	NOT NECESSARY	\$230.90	\$0.00
8	CLIP (SN)	NOT NECESSARY	\$32.80	\$0.00
1	DOOR SEAL LOWER LH (SN)	NOT NECESSARY	\$175.30	\$0.00
1	REAR DOOR HANDLE LH (SN)	NOT NECESSARY	\$593.10	\$0.00
2	EXPANDER NUT (SN)	NOT NECESSARY	\$5.40	\$0.00
1	REAR DOOR LOWER TRIM LH (SN)	NOT NECESSARY	\$710.20	\$0.00
1	REPAIR KIT (SN)	NOT NECESSARY	\$136.90	\$0.00
1	STONE GUARD LH (SN)	NOT NECESSARY	\$109.00	\$0.00
8	CLIP (SN)	NOT NECESSARY	\$10.40	\$0.00
1	PROTECTIVE FILM REAR FENDER (SN)	NOT NECESSARY	\$87.50	\$0.00
1	SIDE SKIRT LH (SN)	NOT NECESSARY	\$324.80	\$0.00
1	SOUND ABSORBER FOR SIDE SKIRT LH (SN)	NOT NECESSARY	\$48.80	\$0.00
1	ALLOY WHEEL TITANIUM REAR LH (SN)	NOT NECESSARY	\$4,253.50	\$0.00
			\$9,686.50	\$0.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO REMOVE / REPLACE REAR DOOR LH, SIDE SKIRT LH & ALL ACCIDENT DAMAGED BODY PARTS. TO REPAIR REAR FENDER LH & ALL AREAS AFFECTED BY THE ACCIDENT.		\$5,160.00	\$3,440.00
	TO RESPRAY REAR DOOR LH, REAR FENDER LH.		\$3,000.00	\$2,400.00
	TO CARRY OUT BODY CAVITY PRESERVATION.		\$250.00	\$150.00
	TO REPLACE 1 PC TYRE REAR LH.		\$1,200.00	\$0.00
	TO MOUNT 1 PC SPORT RIM AND CONDUCT WHEEL BALANCING.		\$120.00	\$120.00
	TO CHEC STEERING GEOMETRY & CONDUCT FULL WHEEL ALIGNMENT.		\$680.00	\$680.00
	TO TRANSFER THE REAR DOOR LH MECHANISM.		\$860.00	\$860.00
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		\$250.00	\$150.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		\$600.00	\$600.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	SUNDRIES.		\$50.00	\$20.00
			\$12,170.00	\$8,420.00
GRAND TOTAL			\$21,856.50	\$8,420.00
	RECOMMENDED COST OF REPAIRS			\$8,420.00
Report Ref No: CD/FCI24090010/Rua3q2				

MRB

MOHAMMED RASUL BIN MOHD YUNUS

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 8 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K




PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K

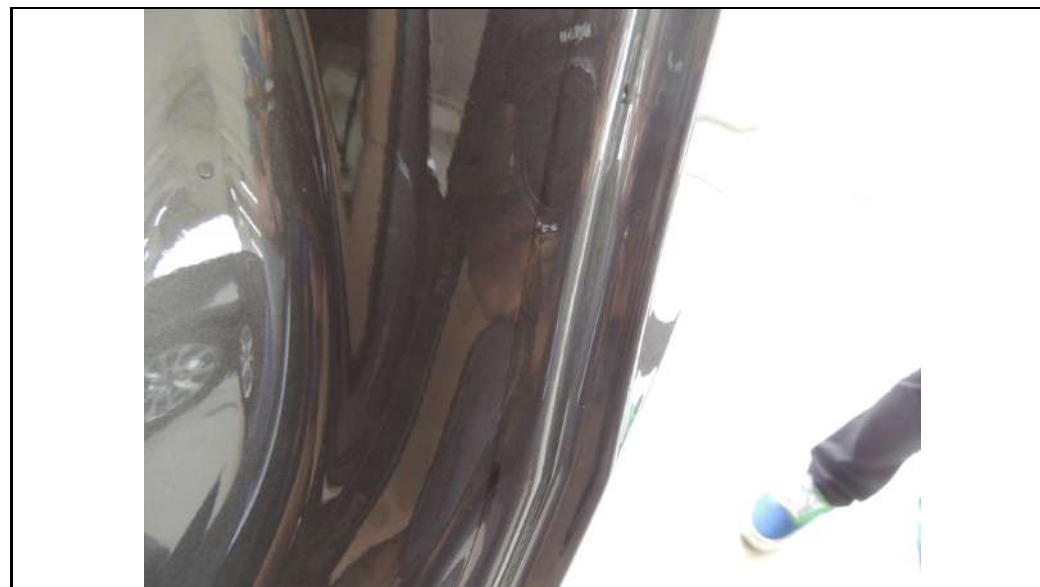



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 12 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K



PHOTOGRAPHS FOR VEHICLE NO. : SKT 1398K

