

ASS. REC. BY:

Tapp

REF:

CS/ALG 24090249/Tapp

## ASSIGNMENT

From:

Date:

Estimated Cost:

☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

HDA 600

(Client's Record)

Make of Veh:

(Policy Condition)

 Remark: The veh had commenced its  
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

9250K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

8

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLZ 727H

Yr Regn:

2024, 08

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Audi Q4 45 E-tron of 82kW

Colour

Blue

A/C: Insured / Std / NI / NA

Sp. Reading

4/4

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WAV ZZZ FZ 9R P074249

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orMod: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

235/55 R19

R:

~ 1

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Hankook

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

D.O.I.

17/9/24

Survey held at

Premium Benoi

Des. of Damages: ☒ Frt / Rear / O/S / N/S / U/G / Rooftop or

The U/G / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

15/01/25@2.11pm confirmed with Nadia final fig \$28100.64, 8 days (Red \$20004.36, 42%)

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

8

Resurvey No. of Trip:

2


Add Fee:



: Site Insp (\$



: Interview (\$

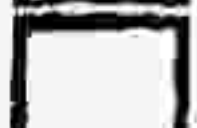

: Tech. Invs (\$



: Weekend (\$

Survey Fee:

Transportation:

\$ + RS. \$

Photos

Others

TOTAL

Rep. Format:

MER-OD

Lump Sum / L.B.E. (\$ 28100.64)





55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS  
WORKSHOP : UBI ROAD 1  
CONTACT NO : 6366 2323  
FAX NO : 6841 1183  
REFERENCE : PA/OD/0685/2024/KS  
DATE : 13-Sep-24  
WIP : 30891

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 17/9/2024

**AIG Asia Pacific Insurance Pte Ltd**

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Motor Claims Dept

OWNER'S NAME : MISS MATHILDA DE BOER-LIM WEN-SZE  
ADDRESS : 521 YIO CHU KANG ROAD  
#02-86  
SINGAPORE 787086  
TELEPHONE : HP +65 81687751  
TYPE OF CLAIM : OWN DAMAGE CLAIM  
POLICY NO : -  
VEHICLE NO : SLZ 727 H  
MODEL CODE : AUDI Q4 SPORTBACK 45 E-TRON  
MODEL YEAR : 29/8/2024  
ENGINE NO : EDFA  
CHASSIS NO : WAUZZZFZ9RP074249  
MILEAGE : -  
DATE IN : -  
ESTIMATED BY : JOHNNY BOO / ALLAN WU  
ACCIDENT DATE : 12-Sep-24  
PLACE OF ACCIDENT : 301 ALEXANDRA ROAD, SINGAPORE 159968



55 UBI ROAD 1, SINGAPORE 408699  
TEL : 6366 2323 FAX : 6841 1183  
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLZ 727 H**

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS AND OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER AND FRONT PARKING AID.	S/N \$ 480.00 ✓	
2	TO REMOVE AND TRANSFER BOTH HEADLIGHTS CONTROL UNIT AND POWER MODULE.	S/N \$ 800.00 ✓	500
3	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET AND BOTH HEADLIGHTS. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 2,400.00	500
4	TO RESPRAY FRONT BUMPER, FRONT BUMPER SPOILER, FRONT BUMPER TRIM, BONNET AND BOTH FRONT WHEEL ARCH TRIMS. X ~400	\$ 4,500.00	1800
5	TO CARRY OUT CALIBRATION FOR FRONT BUMPER RADAR SENSOR AND DISTANCE REGULATION.	S/N \$ 800.00 ?	
6	TO CARRY OUT DE-ENERGEISING HIGH VOLTAGE SYSTEM, DEACTIVATION AND ACTIVATION.	S/N \$ 480.00 ✓	
7	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 292.00 ✓	
<b>TOTAL LABOUR CHARGES</b>		<b>: \$ 9,752.00</b>	

55 UBI ROAD 1, SINGAPORE 408699  
 TEL : 6366 2323 FAX : 6841 1183  
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLZ 727 H**

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER	1	\$ 1,411.00	de✓
2	FRONT BUMPER FIXING PARTS	1	\$ 517.00	X
3	FRONT BUMPER COVER CAP - LH / RH	2	\$ 50.00	?
4	FRONT BUMPER TRIM	1	\$ 496.00	de✓
5	FRONT BUMPER CLOSING ELEMENT	1	\$ 277.00	gra✓
6	FRONT BUMPER AIR GUIDE GRILLE - LH / RH	2	\$ 236.00	?
7	FRONT BUMPER GRILLE - CENTER1	1	\$ 247.00	de✓
8	FRONT BUMPER SPOILER	1	\$ 818.00	?
9	FRONT BUMPER IMPACT PROTECTION - SELENITE SIL	1	\$ 545.00	dis✓
10	FRONT BUMPER AIR DUCT	1	\$ 109.00	?
11	RADIATOR GRILLE	1	\$ 1,712.00	ang✓
12	AUDI EMBLEM	1	\$ 202.00	ant✓
13	VEHICLE ENVIRONMENT CAMERA	1	\$ 1,298.00	?
14	VEHICLE ENVIRONMENT CAMERA BRACKET	1	\$ 53.00	?
15	VEHICLE ENVIRONMENT CAMERA BRACKET SECURING	1	\$ 42.00	?
16	FRONT PARKING AID SENSOR	2	\$ 600.00	?
17	FRONT PARKING AID SENSOR SEAL RING	4	\$ 57.00	?
18	FRONT BUMPER GUIDE SECTION - LH / RH	2	\$ 122.00	?
19	FRONT REINFORCEMENT BEAM	1	\$ 1,307.00	?
20	FRONT BUMPER SUPPORT	1	\$ 57.00	?
<b>SUB TOTAL SPARE PARTS</b>		:	<b>\$ 10,156.00</b>	

ALL CHARGES ARE NOT INCLUSIVE OF GST  
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED  
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699  
 TEL : 6366 2323 FAX : 6841 1183  
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLZ 727 H**

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT FOAM FILLER PIECE	1	\$ 137.00	de ✓
22	LED HEADLIGHT - LH / RH	2	\$ 9,788.00	car ✓
23	LED HEADLIGHT MOUNTING - LH / RH	2	\$ 300.00	?
24	LIFT CYLINDER - LH / RH	2	\$ 504.00	?
25	LIFT CYLINDER HOSE - LH / RH	1	\$ 128.00	?
26	BONNET	1	\$ 3,668.00	X
27	BONNET ATTACHMENT PARTS	1	\$ 133.00	X
28	BONNET HINGE - LH / RH	2	\$ 178.00	X
29	BONNET STRIKER - LH / RH	2	\$ 260.00	X
30	BONNET IMPACT PROTECTION	1	\$ 36.00	X
31	BONNET LOCK - LH / RH	2	\$ 982.00	X
32	BONNET BOWDEN CABLE - CENTER	1	\$ 71.00	X
33	BONNET BOWDEN CABLE COVER	1	\$ 12.00	X
34	BONNET RELEASE ELEMENT	1	\$ 73.00	X
35	FRONT WHEEL ARCH COVER - LH / RH	2	\$ 274.00	new - photo
36	FRONT NO PLATE	S/N	\$ 60.00	bt -
37	SUNDRIES		\$ 600.00	?
<b>TOTAL SPARE PARTS</b>		:	\$ 27,360.00	
<b>TOTAL LABOUR CHARGES</b>		:	\$ 9,752.00	
<b>GRAND TOTAL</b>		:	\$ 37,112.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST  
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED  
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699  
TEL : 6366 2323 FAX : 6841 1183  
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME :  
SURVEYED DATE :  
AUTHORISED DATE :  
EXCESS COST :  
LIABILITY :  
REMARKS :

Taufik 97495749/62563361  
Not Authorised Ex: to be advise  
4 days  
p/p Resurvey before paint.  
taufik@lkhauto.com.

PLEASE NOTE :

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,  
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO  
BODY REPAIR MANAGER

ALLAN WU  
CLAIMS CONSULTANT