

ASS. REC. BY:

REF:

AGZ/

CS

A6124090272/Knp3

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

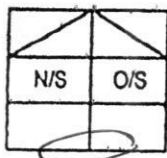

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 04 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: Smp 76016 Yr Regn: 10, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or A) WagonMake: Honda Shuttle C.G. 1496Colour: M-Black A/C: Insured / Std / NI / NASp. Reading: 378135 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: GP7 - 2004141

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 185/60R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or KapsenFront RearR/Bal. 9 mm R/Bal. 9 mmL/Bal. 9 mm L/Bal. 9 mmD.O.A. 13/9/24 D.O.I. 16/9/2024

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1/ GIA & EH not ready18/9/11 Rep @ 3300h. Cash (Red, \$3873.52, 53%)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 4

Resurvey No. of Trlp: _____

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$ _____)

Add Fee:

☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

Tech Invs (\$ _____)

☐

Weekend (\$ _____)

Massive Trading & Auto

Blk 5038 #01-405 Ang Mo Kio Industrial Pk 2 Singapore 569541
H/P 91082728

Focus Toh
Blk 697 Hougang St 61
#11-24
Singapore 530697

Vehicle No : SMP 7601 G
Make/Model : Honda Shuttle
Year : 2019

Not Withair
11 Sep @ 3300h
Resurvey After Paint
4 days

Qty	Description	Unit Price	Amount
-----	-------------	------------	--------

Estimate Cost Of Repair

1 pc	Rear tail-gate assy	1193.70
1 pc	Rear tail-gate glass moulding	
1 pc	Rear tail-gate emblem " Shuttle "	
1 pc	Rear tail-gate emblem " Hybrid "	
1 pc	Rear tail-gate emblem " H "	
1 pc	Rear tail-gate outer chrome garnish	
1 pc	Rear tail-gate inner lock	
1 pc	Rear tail-gate inner trim board	
2 pcs	Rear tail-gate reflector	
1 pc	Rear boot rubber	
1 pc	Rear end panel	
1 pc	Rear end panel inner garnish	
1 pc	Rear bumper	
2 pcs	Rear bumper side retainer	

Bt	\$1,281.10	/
mm	\$105.20	/
mm	\$65.10	/
mm	\$57.20	/
mm	\$40.10	/
mm	\$385.70	X
mm	\$305.10	/
mm	\$287.40	/
\$420.10	\$840.20	X
Dis 100	\$195.70	502m
mm	\$588.60	X
mm	\$185.90	X
mm	\$965.70	/
\$38.20	\$76.40	X
	\$5,379.40	
Less 20 %	\$1,075.88	
	\$4,303.52	

S Nett

1 pc	Rear reverse sensor
1 pc	Rear tail-gate glass sealant
20 pcs	Rear bumper clip
1 pc	Rear no plate

Scr/shot	\$200.00	/
mm	\$55.00	402m
\$2.00	\$40.00	/
mm	\$40.00	X
	\$335.00	

Labour Charges

Remove/renew the above parts including knocking, welding & cutting.

\$1,000.00 500h

To putty and spray paint

\$1,000.00 600h
balance c/f \$6,638.52

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SMP 7601 G

balance b/f \$6,638.52

Labour Charges

Check & reconnect wiring.

\$45.00 201

To respray anti-rust proofing treatment

\$120.00 301

Remove/refit rear windscreen to facilitate repair

\$120.00 ✓

Remove/refit rear tail-gate mechanism to new door.

\$150.00 601

Remove/refit rear boot upholstery to facilitate repair.

\$100.00

Total

\$7,173.52