

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CD/FC/24090297/4ua3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

7

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Day 1st.

Boat Damage Damage wear & Tear

Nth \$12438 Boat \$4001, near by 2945

14/10/24 2/5 \$8100 inboard Randle

Veh No:

SCC 36563

Yr Regn:

31/12/15

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA

Make:

Audi A4

1.8 TFSd.c

1798

Colour:

Grey

A/C: Insured / Std / NI / NA

Sp. Reading

130052

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WAUZZZ8K4FA187069

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

245/40R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

6 mm

Rear

R/Bal.

mm

L/Bal.

6 mm

L/Bal.

6

mm

D.O.A.

13/09/24

D.O.I.

18/09/24

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear & R

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$


) S + RS, SI

) Photos

) Others

Report Format :

Lump Sum / I.R. / \$

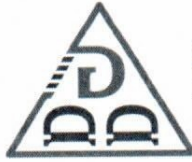

DICKSON GROUP
Your Trusted Automotive Solutionist

DICKSON AUTO CARE CENTRE PTE LTD
29 UBI ROAD 4, DICKSON AUTO CENTRE
SINGAPORE 408619
TEL: 6668 1122 | FAX: 6668 1123

Not Arthur
Mr
Murray
90096608
Monte 1/58 8100
Whipple After 7
mercuschne at klc auto - com
7 days
18/9/24

QUOTATION

QUOTATION FOR

NAME:
COMPANY NAME: MS First Capital Insurance Ltd
STREET ADDRESS: 6 Raffles Quay, #21-00
POSTAL CODE: Singapore 048580
PHONE: 6222 2311

DATE: 14/09/2024
REF: SD0B249D0003
VEHICLE NO: SCE3656B
MAKE: AUDI
MODEL: A4
PREPARED BY: XIANG

S/N	DESCRIPTION	QTY	UOM	UNIT PRICE	AMOUNT BEFORE DISCOUNT	DISC	AMOUNT
LABOUR							
1	TO REMOVE & REPLACE REAR BUMPER, BOOT LID, END PANEL, FRONT BUMPER, BONNET, FRONT PANEL, HEADLAMP FRONT & ALL ACCIDENT DAMAGE BODY PARTS & ALL AREAS AFFECTED BY THE ACCIDENT	1		\$1,800.00	\$ 1,800.00	1000	\$ 1,800.00
2	TO SPRAY BUMPER REAR, BOOT LID, END PANEL, BUMPER REINFORCEMENT REAR, BUMPER FRONT, BONNET, BUMPER REINFORCEMENT FRONT, BOOT FLOOR REAR	1		\$1,800.00	\$ 1,800.00	1000	\$ 1,800.00
3	TO REPAIR BOOT FLOOR REAR	1		\$200.00	\$ 200.00	11X	\$ 200.00
4	TO REPLACE/TRANSFER THE REAR BUMPER SENSORS & OTHER PARTS	1		\$200.00	\$ 200.00	30	\$ 200.00
5	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING	1		\$150.00	\$ 150.00	30	\$ 150.00
6	TO PROGRAMME AFTER THE ACCIDENT REPAIR WORKS	1		\$200.00	\$ 200.00	50	\$ 200.00
7	TO CARRY OUT BODY CAVITY PRESERVATION	1		\$200.00	\$ 200.00	11X	\$ 200.00
8	SUNDRIES	1		\$100.00	\$ 100.00	11X	\$ 100.00
PARTS							
1	BUMPER REAR	1		\$1,865.25	\$ 1,865.25	2.5	\$ 1,865.25
2	BUMPER CLIPS (SET)	1	1set	\$135.55	\$ 135.55	new	\$ 135.55
3	BOOT LID	1		\$2,864.35	\$ 2,864.35	2	\$ 2,864.35
4	EXHAUST SILENCER REAR	1		\$2,252.40	\$ 2,252.40	2	\$ 2,252.40
5	BUMPER REAR LOWER SKIRTING	1		\$209.30	\$ 209.30	2.5	\$ 209.30
6	TOW EYE COVER REAR RH	1		\$37.55	\$ 37.55	11	\$ 37.55
7	SENSOR REAR RH (INNER)	1		\$194.75	\$ 194.75	malhutan	\$ 194.75
8	END PANEL ASSY REAR	1	860	\$1,331.65	\$ 1,331.65	1.5-2.5	\$ 1,331.65
9	END PANEL INNER TRIM	1		\$161.45	\$ 161.45	new	\$ 161.45
10	BUMPER REINFORCEMENT REAR	1		\$458.65	\$ 458.65	new	\$ 458.65
11	BOOT LID LOCK	1		\$159.35	\$ 159.35	new	\$ 159.35
12	BOOT LID BADGE [A4]	1		\$72.30	\$ 72.30	new	\$ 72.30
13	BOOT LID BADGE [TFSI]	1		\$72.30	\$ 72.30	new	\$ 72.30
14	BOOT LID BADGE [LOGO]	1		\$93.65	\$ 93.65	new	\$ 93.65

✓
405/20
X
X
✓
X
✓
X
X
X
X
X
X
X
X

S/N	DESCRIPTION	QTY	UOM	UNIT PRICE	AMOUNT BEFORE DISCOUNT	DISC	AMOUNT
15	BUMPER FRONT	1		\$1,794.25	\$ 1,794.25	20/2	\$ 1,794.25
16	GRILLE FRONT	1		\$829.60	\$ 829.60	320	\$ 829.60
17	NUMBER PLATE FRONT	1		\$30.00	\$ 30.00	Bent	\$ 30.00
18	BUMPER SHOCK ABSORBER FRONT	1		\$89.20	\$ 89.20	7900	\$ 89.20
19	GRILLE BADGE [LOGO]	1		\$93.65	\$ 93.65	c/w strike	\$ 93.65
20	BONNET	1		\$2,025.75	\$ 2,025.75	12	\$ 2,025.75
21	BONNET HINGE LH	1		\$54.70	\$ 54.70	17	\$ 54.70
22	BONNET HINGE RH	1		\$54.70	\$ 54.70	17	\$ 54.70
23	BONNET INSULATION	1		\$246.90	\$ 246.90	17	\$ 246.90
24	BONNET INSULATION CLIPS	10		\$3.50	\$ 35.00	17	\$ 35.00
25	AIRCOND CONDENSER	1		\$813.45	\$ 813.45	su	\$ 813.45
26	RADIATOR	1		\$728.25	\$ 728.25	17	\$ 728.25
27	BUMPER REINFORCEMENT FRONT	1		\$677.70	\$ 677.70	Bent	\$ 677.70
28	FRONT PANEL [SUPPORT PANEL]	1		\$800.75	\$ 800.75	su	\$ 800.75
29	HEADLAMP ASSY FRONT LH	1		\$1,861.05	\$ 1,861.05	su	\$ 1,861.05
30	HEADLAMP ASSY FRONT RH	1		\$1,861.05	\$ 1,861.05	cnc	\$ 1,861.05
31	RADIATOR AIR DEFLECTOR LH	1		\$75.90	\$ 75.90	17	\$ 75.90
32	RADIATOR AIR DEFLECTOR RH	1		\$75.90	\$ 75.90	17	\$ 75.90
33	TOW EYE COVER FRONT RH	1		\$46.70	\$ 46.70	17	\$ 46.70
34	GRILLE FRONT UPPER COVER	1		\$91.35	\$ 91.35	17	\$ 91.35
35	BUMPER FRONT SIDE RETAINER LH	1		\$35.55	\$ 35.55	17	\$ 35.55
36	BUMPER FRONT SIDE RETAINER RH	1		\$35.55	\$ 35.55	17	\$ 35.55
37	BUMPER REAR SIDE RETAINER LH	1		\$38.85	\$ 38.85	17	\$ 38.85
38	BUMPER REAR SIDE RETAINER RH	1		\$38.85	\$ 38.85	17	\$ 38.85
39	AIRCOND GAS	1		\$60.00	\$ 60.00	17	\$ 60.00
40	RADIATOR COOLANT	1		\$40.00	\$ 40.00	17	\$ 40.00
41	WINDSCREEN SEALANT	1		\$80.00	\$ 80.00	17	\$ 80.00
42	FLOOR BOARD SEALANT	1		\$80.00	\$ 80.00	17	\$ 80.00
				SUBTOTAL	\$ 27,253.15	SUBTOTAL	\$ 27,253.15
				GST 9%	\$ 2,452.78	GST 9%	\$ 2,452.78
				TOTAL	\$ 29,705.93	TOTAL	\$ 29,705.93

REMARKS:

102
 fit support panel top garnish 7m 211. ✓

I AGREE TO THE REMARKS AND PRICE AS LISTED ABOVE.

FOR DICKSON AUTO CARE CENTRE PTE LTD

headbury lower bracket RH cnc 147 ✓



(CUSTOMER'S SIGNATURE AND COMPANY STAMP)

Consultants hence notify
 the Repairer of the following:
 • To resurvey before/after spray painting
 • To display damaged parts before resurvey
 • Parts prices are subject to confirmation
 • Third party survey is on a "Without Prejudice" basis
 • No illegal modification(s) is allowed
 • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

(AUTHORISED SIGNATURE)

P-8913-7
 102
 802233
 40
 2110
 1017233
 203
 A37