

(08/11/13) waf
ASS. REC. BY:

REF: CS/A1424060178/Rnp3

331C

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____

OP/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: SMX 3836E

at Workshop m/s PREMIUM

of BENOL SECUR

Insured: ALH

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: TBA

(Client's Record)

Make of Veh: _____

(Policy Condition)

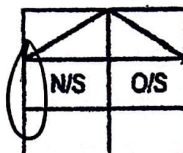

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 229K

IDAC Accident Report: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SMX 3836E Yr Regn: 2019 / NOV
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or

Make: AWD1A75.B.2.0TFS1 Q4 c.c. 1984

Colour: GREEN AC: Insured / Std / NI / NA

Sp. Reading: 137914 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAUZZZF21LNO13368

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 255/40R20

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 20/06/24

Survey held at

Rear

R/Bal. 6 mm

L/Bal. 6 mm

D.O.I. 24/06/24

BENOL SECUR

Des. of Damages: Frt / Rear / O/S N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT - 150K

Date/Time, File Pass to?

☐ : Prel. Report

☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Invs (\$

☐ : Weekend (\$

) \$ + RS. \$

) Photos

) Others

Report Format :

Lump Sum / I.B.I: (\$

TOTAL



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0486/2024/EQ
DATE : 21-Jun-24
WIP : 20149

VEHICLE NOT IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 24/6/2024

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Motor Claims Dept

OWNER'S NAME : MR. LEE JUN WEI, ERIC
ADDRESS : BLK 346 CHOA CHU KANG LOOP
#08-77
SINGAPORE 680346
TELEPHONE : HP +65 94594292
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 2070161277-03
VEHICLE NO : **SMX 3836 E**
MODEL CODE : AUDI A7 SPORTBACK 2.0 TFSI
MODEL YEAR : 29/11/2019
ENGINE NO : DLH 067039
CHASSIS NO : WAUZZZF21LN013368
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 20-Jun-24
PLACE OF ACCIDENT : 167, JALAN EMAS 7 , TAMAN IMPIAN EMAS
81300 JOHOR BAHRU, JOHOR, MALAYSIA

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMX 3836 E.

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT FENDER - LH <i>h/</i>	1	\$ 2,163.00	
2	FRONT FENDER BRACE - LH <i>X</i>	1	\$ 193.00	
3	FRONT FENDER BRACKET - LH UPPER <i>X</i>	1	\$ 55.00	
4	FRONT FENDER CLOSING ELEMENT - LH <i>?</i>	1	\$ 72.00	
5	FRONT FENDER ATTACHMENT PARTS - LH <i>X</i>	1	\$ 94.00	
6	FRONT WHEEL HOUSING LINER - LH <i>?</i>	1	\$ 332.00	
7	FRONT WHEEL SPOILER - LH <i>X</i>	1	\$ 207.00	
8	WHEEL HOUSING LINER ATTACHMENT PARTS - LH <i>X</i>	1	\$ 82.00	
9	FRONT FENDER LOWER BRACKET - LH <i>X</i>	1	\$ 34.00	
10	FRONT FENDER LOWER BRACKET SUPPORT - LH <i>X</i>	1	\$ 8.00	
11	SIDE MEMBER ATTACHMENT PARTS - LH <i>X</i>	1	\$ 153.00	
12	SIDE MEMBER ADHESIVE TAPES - LH <i>X</i>	1	\$ 69.00	
13	FRONT DOOR - LH <i>h/</i>	1	\$ 5,395.00	
14	FRONT DOOR CATCH - LH <i>?</i>	1	\$ 160.00	
15	FRONT DOOR SEAL, OUTER - LH <i>see</i>	1	\$ 275.00	
16	FRONT DOOR RETAINING STRIP OUTER SEAL - LH <i>see</i>	1	\$ 9.00	
17	FRONT DOOR HINGE - LH UPPER / LOWER <i>?</i>	2	\$ 264.00	
18	FRONT DOOR ATTACHMENT PARTS - LH <i>X</i>	1	\$ 390.00	
19	FRONT DOOR CORNER TRIM - LH <i>X</i>	1	\$ 97.00	
20	FRONT DOOR SEALING ELEMENT - LH <i>X</i>	1	\$ 22.00	
SUB TOTAL SPARE PARTS		:	\$ 10,074.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMX 3836 E.

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT DOOR SEALING ELEMENT - LH X	1	\$	22.00
22	FRONT DOOR WINDOW APERTURE SEAL - LH INNER X	1	\$	570.00
23	FRONT WINDOW SLOT SEAL - LH OUTER?	1	\$	398.00
24	FRONT DOOR WINDOW - LH <i>sc</i>	1	\$	439.00
25	FRONT WING MIRROR GLASS - LH <i>ms</i>	1	\$	1,437.00
26	FRONT WING MIRROR CAP - LH <i>cm</i>	1	\$	392.00
27	FRONT WING MIRROR MOUNT - LH <i>br</i>	1	\$	3,385.00
28	FRONT DOOR HANDLE - LH <i>sc</i>	1	\$	521.00
29	FRONT DOOR HANDLE CAP - LH <i>sc</i>	1	\$	116.00
30	FRONT DOOR HANDLE UNDERLAY - LH INNER / OUTER X	2	\$	15.00
31	FRONT DOOR MOUNTING BAR ?	1	\$	203.00
32	REAR DOOR - LH <i>st</i>	1	\$	5,395.00
33	REAR DOOR CATCH - LH ?	1	\$	160.00
34	REAR DOOR SEAL, OUTER - LH <i>me</i>	1	\$	275.00
35	REAR DOOR RETAINING STRIP - LH <i>me</i>	1	\$	6.00
36	STONE CHIP FILM FOR SIDE MEMBER X	1	\$	249.00
37	REAR DOOR HINGER - LH UPPER / LOWER ?	1	\$	131.00
38	REAR DOOR HINGER - LH LOWER ?	1	\$	193.00
39	REAR DOOR ATTACHMENT PARTS X	1	\$	390.00
40	CHROME ROOF MOLDING - LH <i>br</i>	1	\$	887.00
41	FRONT TYRE - LH X	1		TBC
42	REAR TYRE - LH X	1		TBC
43	SUNDRIES	1	\$	600.00
TOTAL SPARE PARTS		:	\$	25,858.00
TOTAL LABOUR CHARGES		:	\$	9,932.00
GRAND TOTAL		:	\$	35,790.00

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMX 3836 E.

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHT, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER AND FRONT PARKING AID.	S/N \$ 480.00	X
2	TO REMOVE AND TRANSFER LHS FRONT REAR DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES.	S/N \$ 800.00	/
3	TO REMOVE AND REINSTALL FRONT BUMPER AND LHS SILL PANEL TRIM. TO DISMANTLE AND RENEW LHS FRONT FENDER AND LHS FRONT AND REAR DOOR. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 4,000.00	2000
4	TO RESPRAY LHS FRONT AND REAR DOOR, LHS FRONT FENDER, LHS FRONT AND REAR DOOR HANDLES AND LHS WING MIRROR.	\$ 3,800.00	2350
5	TO RENEW LHS FRONT AND REAR RIM. TO CARRY OUT WHEEL ALIGNMENT.	S/N \$ 560.00	280
6	TO SUPPLY AND REINSTALL PAINT PROTECTION FILM ON FENDER AND WING MIRROR COVER	S/N TBC	
7	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 292.00	/
TOTAL LABOUR CHARGES		: \$ 9,932.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME
SURVEYED DATE
AUTHORISED DATE
EXCESS COST
LIABILITY
REMARKS

: Rasul - Hp 90010068
: 24/06/24
: 6 days
: Excess: TBA
: Repair / Rep 59 part

PLEASE NOTE

: THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF
THE AFFECTED VEHICLE. SHOULD WE REQUIRE
FURTHER LABOUR CHARGES AND SPARE PARTS IN THE
PROGRESS OF REPAIR, WE SHALL INFORM YOU
ACCORDINGLY.
FOR INSPECTION OF VEHICLE, PLEASE REFER TO
MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR
APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	331C
Vehicle Details	
Vehicle No.:	SMX3836E
Vehicle to be Exported:	No
Intended Deregistration Date:	25 Jun 2024
Vehicle Make:	AUDI
Vehicle Model:	A7 SPORTBACK 2.0 TFSI QU (180KW)
Primary Colour:	Blue
Manufacturing Year:	2019
Engine No.:	DLH067039
Chassis No.:	WAUZZZF21LN013368
Maximum Power Output:	180.0 kW (241 bhp)
Open Market Value:	\$58,902.00
Original Registration Date:	29 Nov 2019
First Registration Date:	29 Nov 2019
Transfer Count:	1
Actual ARF Paid:	\$78,024.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	28 Nov 2029
PARF Rebate Amount:	\$58,518.00
Intended COE Rebate Details	
COE Expiry Date:	28 Nov 2029
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$37,000.00
COE Rebate Amount:	\$20,072.00
Total Rebate Amount:	\$78,590.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 25 Jun 2024

OK



Audi A7 Sportback 2.0A TFSI S-tronic


\$185,000 Instalment \$2,542/mth

PREMIUM AD

Apply for 2.48% loan

Shortlist

Get Warranty

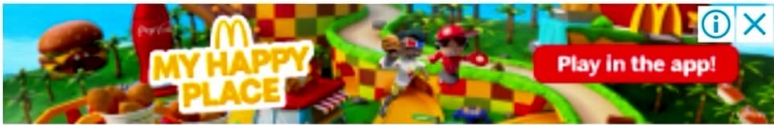

Overview Financial Photo Research

Depreciation	\$35,400 / year
Reg. Date	20-Aug-2018 (4yrs 1mth 25days COE left)
Manufactured	2017
Mileage	54,000 km (9.2k / year)
Transmission	Auto
Engine Cap	1,984 cc
Road Tax	\$1,194 / year
Power	185.0 kW (248 bhp) View specs of the Audi A7 Sportback 2015 (2011-2018)
Curb Weight	1,730 kg
COE	\$34,381
OMV	\$57,740
ARF	\$75,932
Dereg Value	\$67,432 as of today