



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2501574

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555
ATTN:CHARMAINE KONG

INV Date 17/03/2025
Reference CD/LPC24090436/Apa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMN 4284T
Insured Veh. SLC 9721K
Claim No. 23/24/24/VP05/029902
Policy No.
Accident Date 20/09/2024
Inspection Date 27/09/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS LONPAC INSURANCE BHD	Ref:	CD/LPC24090436/Apa3q2
300 BEACH ROAD	Date:	17/03/2025
#17-04/07 THE CONCOURSE SINGAPORE 199555	Code:	LPC2

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	SLC 9721K	Veh. Inspected	SMN 4284T
Policy No.	-	Coverage	0
Claim No.	23/24/24/VP05/029902	Excess	\$0.00
Assign From	CHARMAINE KONG	Assign Date	23/09/2024

2. Vehicle Details

Make & Model	SKODA SUPERB 1.8 TSI (A)	C.C	1798
Engine No.	CJS302419	Year of Reg.	08/08/2019
Chassis No.	TMBBL7NP9K7046550	Colour	BLACK
Odometer	89288 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	225/45 R18	MICHELIN	6
L/H Front Tyre	225/45 R18	MICHELIN	6
R/H Rear Tyre	225/45 R18	MICHELIN	6
L/H Rear Tyre	225/45 R18	MICHELIN	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	20/09/2024	Inspection Date	27/09/2024
Survey held at	KT MOTORWERK 3012 BEDOK INDUSTRIAL PARK E, #01-2020, BEDOK INDUSTRIAL PARK E, SINGAPORE 489978		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 4 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SMN 4284T

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	BOOTLID LOGO	NECESSARY	\$165.90	\$165.90
1	BOOTLID SKODA EMBLEM	NECESSARY	\$145.60	\$145.60
1	BOOTLID SUPERS EMBLEM	NECESSARY	\$132.90	\$132.90
1	BOOTLID WEATHERSTRIP	TORN	\$318.60	\$318.60
1	SMART KEY ANTENNA	CRACKED	\$385.60	\$240.00
1	REAR BUMPER	DEFORMED	\$2,965.76	\$2,456.00
1	REAR LOWER BUMPER	DEFORMED	\$1,468.60	\$470.00
1	REAR BUMPER CENTRE CHROME STRIP	NOT NECESSARY	\$438.50	\$0.00
2	REAR BUMPER LOWER COVER @\$345.90	NOT NECESSARY	\$691.80	\$0.00
2	REAR BUMPER REFLECTOR @\$234.60	N/S CRACKED	\$469.20	\$69.00
1	REAR BUMPER REINFORCEMENT	DENTED	\$1,017.60	\$878.00
1	REAR BUMPER CENTRE RETAINER	CRACKED	\$356.90	\$180.00
2	REAR BUMPER RETAINERS @\$198.60	NOT NECESSARY	\$397.20	\$0.00
4	REAR BUMPER REVERSE SENSOR @\$385.60	DAMAGED	\$1,542.40	\$385.60
4	REAR BUMPER REVERSE SENSOR HOLDERS @\$48.60	NECESSARY	\$194.40	\$48.60
1	REAR BUMPER REVERSE SENSOR WIREHARNES	NOT NECESSARY	\$987.60	\$0.00
2	REAR FENDER INNER COWLING @\$286.90	NOT NECESSARY	\$573.80	\$0.00
2	REAR FENDER INNER TRIMS @\$685.30	NOT NECESSARY	\$1,370.60	\$0.00
2	TAILLAMPS @\$1345.60	N/S CRACKED	\$2,691.20	\$1,104.00
2	TAILLAMPS INNER SEALER @\$40.00	NOT NECESSARY	\$80.00	\$0.00
2	TAILLAMPS BRACKETS @\$205.80	N/S CRACKED	\$411.60	\$110.00
1	END PANEL	TO REPAIR SEE LABOUR	\$1,345.60	\$0.00
1	END PANEL TOP GARNISH	NOT NECESSARY	\$286.90	\$0.00
1	SPARE TYRE FLOOR PANEL	NOT NECESSARY	\$1,145.60	\$0.00
1	SPARE TYRE FLOOR PANEL TOP BOARD	NOT NECESSARY	\$698.70	\$0.00
1	REAR SILENCER BOX	NOT NECESSARY	\$1,345.20	\$0.00
2	REAR SILENCER BOX MOUNTING @\$86.30	NOT NECESSARY	\$172.60	\$0.00
1	REAR SILENCER BOX HEAT SHIELD	NOT NECESSARY	\$398.20	\$0.00
	LESS 0.00 / 10.00% DISCOUNT		\$0.00	(\$670.42)
			\$22,198.56	\$6,033.78



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	\$50.00	\$0.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	\$30.00	\$30.00
2	SET REAR FENDER INNER COWLING CLIPS @\$30.00 (SN)	NOT NECESSARY	\$60.00	\$0.00
2	SET REAR FENDER INNER TRIM CLIPS @\$30.00 (SN)	NOT NECESSARY	\$60.00	\$0.00
2	SET TAILLAMPS CLIPS @\$30.00 (SN)	NOT NECESSARY	\$60.00	\$0.00
1	SET END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	\$30.00	\$0.00
1	SET FLOOR PANEL INSULATOR PADS (SN)	NOT NECESSARY	\$100.00	\$0.00
1	SET END PANEL SEALANT (SN)	NOT NECESSARY	\$60.00	\$0.00
			\$450.00	\$30.00
Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF END PANEL.		\$1,400.00	\$400.00
	SPRAY PAINTING		\$1,400.00	\$600.00
	CHECK WIRING ON TAILAMP		\$120.00	\$30.00
	ANTI RUST	NOT NECESSARY	\$100.00	\$0.00
	REMOVE AND INSTALL REVERSE SENSOR		\$120.00	\$50.00
	REMOVE AND INSTALL REAR BOOTLID AND MECHANISM	NOT NECESSARY	\$150.00	\$0.00
	REMOVE AND INSTALL REAR SILENCER BOX	NOT NECESSARY	\$150.00	\$0.00
	REMOVE AND INSTALL INTERIOR UPHOLSTERY	NOT NECESSARY	\$150.00	\$0.00
			\$3,590.00	\$1,080.00
GRAND TOTAL			\$26,238.56	\$7,143.78
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$5,700.00
Report Ref No: CD/LPC24090436/Apa3q2				

LWP

ADRIAN LING WAI PING

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of repositibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T






PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T

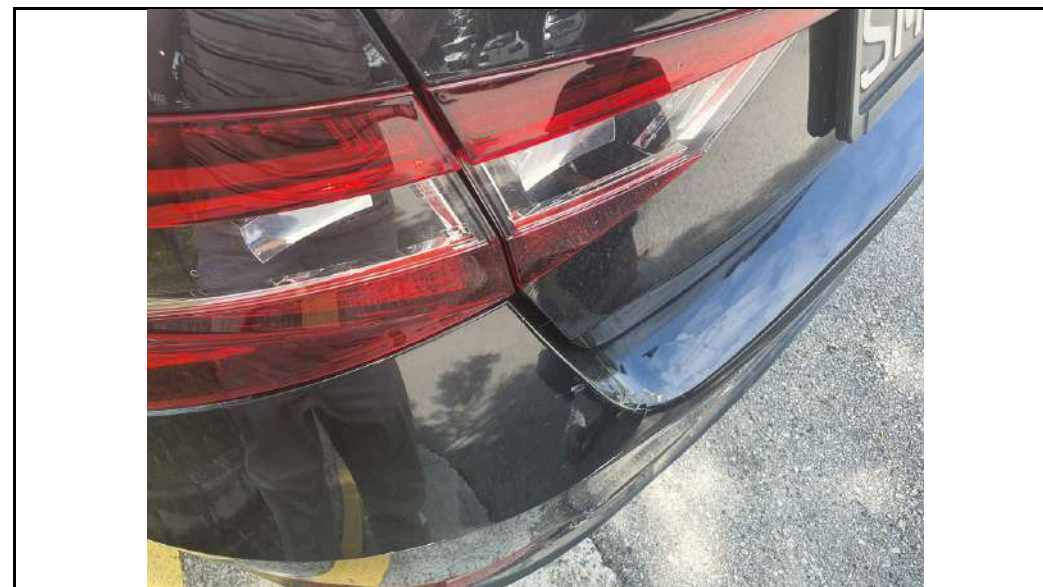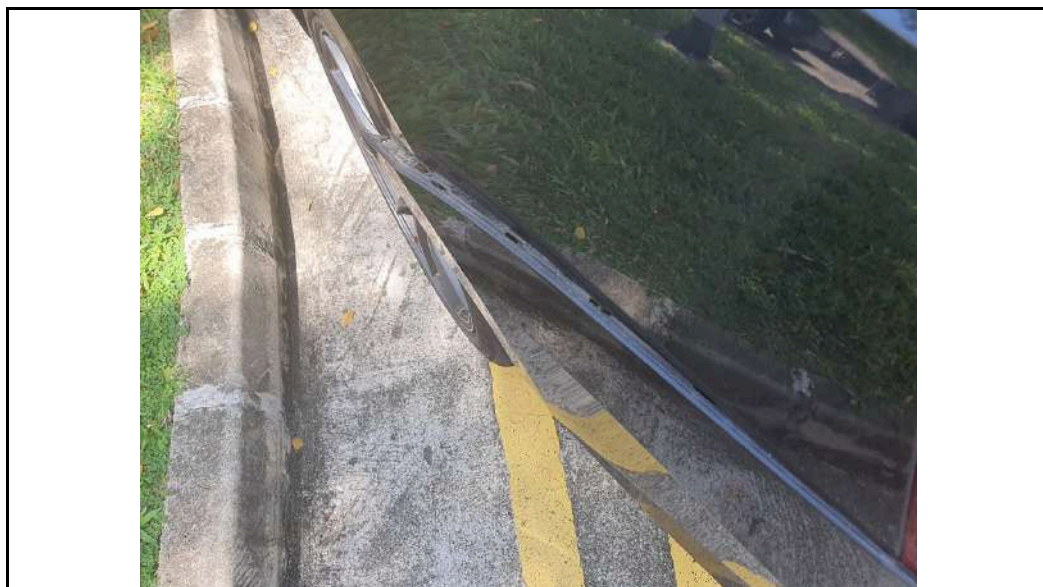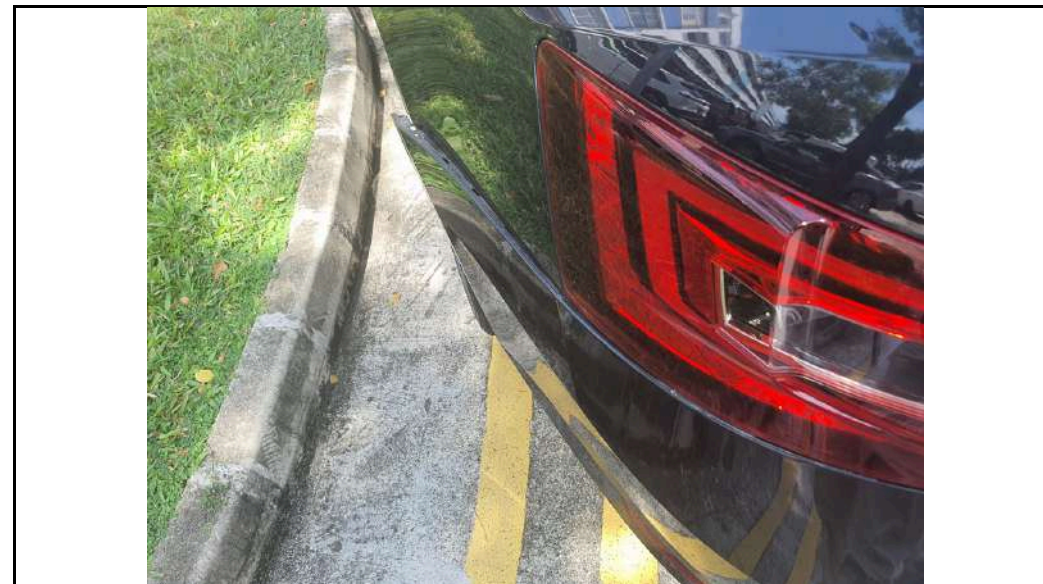

PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 7 of 8)

PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 9 of 9)

PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.

19-9607198-R

REINSPECTION PHOTOS (Page 1 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T



PHOTOGRAPHS FOR VEHICLE NO. : SMN 4284T

