

(08/11/13) wef

ASS. REC. BY:

REF: CS/LPC24090486/Rnh3

6856

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MVTo Inspect Vehicle No: YP 6714Dat Workshop m/s MOVAof 15/FAN YOUNG RDInsured: LPC

Policy No. _____

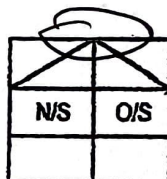
Claims No. _____

Sum Insured: _____ Excess: 700

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 49k

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: YP 6714D Yr Regn: 2017 JulyType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: HINO XZU710R c.c. 4009Colour: WHITE A/C: Insured / Std / NI / NASp. Reading: 493912 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JHHUCS3H30K019584Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 7.00R16R: D/D

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

HAIDA

Front

Rear

R/Bal. 7 mm R/Bal. 7/7 mmL/Bal. 7 mm L/Bal. 7/7 mmD.O.A. 16/09/24 D.O.I. 27/09/24Survey held at FAN YOUNGDes. of Damages: Frnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT 38k

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

1) _____
Date/Time, File Return to?

2) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Weekend (\$

) : S+RS \$

) : Photos

) : Others

Report Format : _____

Lump Sum / I.B.I: (\$ _____)

TOTAL

ESTIMATE

27/9/2024

LONPAC INSURANCE BHD
 300 BEACH ROAD
 #17-04/07 THE CONCOURSE
 SINGAPORE 199555

Vehicle No: YP6714D
 Vehicle Model: CBMQ24090195
 Est No:
 Claims ref:
 Accident Date: 16/09/24
 In Charge: BRIAN
 Remarks:

Main Office:
 Mova Building
 No. 22, Jalan Kilang,
 Singapore 159419
 Tel : (65) 6476 3333
 Fax : (65) 6271 5891
 www.mova.com.sg

Workshop Dept:
 Block 1008,
 Bukit Merah Lane 3,
 #01-04/06/08/94
 Singapore 159722
 Tel : (65) 6272 3892
 Fax : (65) 6270 8314
 Co. Reg. 198904033G
 GST Reg. M2-0088864-2

No	Description	Qty	U. Price	Amounts S\$
LIST ITEMS:				
1	FRONT WINDSCREEN <i>cm</i>	1	PC \$ 780.00	\$ 780.00
2	WIPER ARM LH/RH <i>sc</i>	2	PC \$ 120.00	\$ 240.00
3	WIPER ARM CAP LH/RH <i>sm/mu</i>	2	PC \$ 20.00	\$ 40.00
4	WIPER BLADE <i>st</i>	2	PC \$ 15.00	\$ 30.00
5	FRONT PANEL	1	PC \$ 580.00	\$ 580.00
6	CORNER PANEL LH/RH <i>LH-cm/RH-X</i>	2	PC \$ 280.00	\$ 560.00
7	CORNER PANEL CAP LH/RH <i>mu</i>	1	PC \$ 35.00	\$ 35.00
8	MIRROR STAY LH <i>st</i>	1	PC \$ 250.00	\$ 250.00
9	MIRROR STAY CAP LH/RH <i>cm/mu</i>	2	PC \$ 35.00	\$ 70.00
10	GRILLE <i>cm</i>	1	PC \$ 430.00	\$ 430.00
11	GRILLE CLIPS <i>m</i>	10	PC \$ 2.50	\$ 25.00
12	HINO LOGO <i>m</i>	1	PC \$ 100.00	\$ 100.00
13	HEADLAMP LH/RH <i>cm</i>	2	PC \$ 550.00	\$ 1,100.00
14	FRONT BUMPER <i>st</i>	1	PC \$ 400.00	\$ 400.00
15	FRONT BUMPER BRKT LH/RH <i>4</i>	2	PC \$ 170.00	\$ 340.00
16	FRONT BUMPER STAY UPPER / LOWER <i>X</i>	2	PC \$ 80.00	\$ 160.00
17	FOG LAMP LH/RH <i>X</i>	2	PC \$ 240.00	\$ 480.00
18	DOOR PANEL LH <i>repair</i>	1	PC \$ 920.00	\$ 920.00
19	616 DECAL <i>m</i>	1	PC \$ 65.00	\$ 65.00
20	EURO 5 EMBLEM <i>m</i>	1	PC \$ 75.00	\$ 75.00
21	STEP GARNISH LH/RH <i>LH-cm/RH-X</i>	2	PC \$ 240.00	\$ 480.00
22	A/C BLOWER ?	1	PC \$ 750.00	\$ 750.00
23	A/C HEATER (CHECK) ?	1	PC	\$ -
24	A/C HEATER PIPE <i>st</i>	2	PC \$ 75.00	\$ 150.00
25	A/C PIPE <i>st</i>	2	PC \$ 220.00	\$ 440.00
26	CABIN BRKT RH <i>st</i>	1	PC \$ 360.00	\$ 360.00
27	CABIN SWING ARM <i>st</i>	1	PC \$ 1,000.00	\$ 1,000.00
28	HORN <i>X</i>	1	PC \$ 85.00	\$ 85.00
29	DASH PANEL (REPAIR)	1	PC	\$ -
30	CHASSIS CROSSMEMBER <i>repair</i>	1	PC \$ 600.00	\$ 600.00

COST TOTAL S\$

15% COST PLUS S\$

\$ 10,545.00

\$ 1,581.75

\$ 12,126.75

SPECIAL NET ITEMS:

1	W/SCREEN PRIMER <i>m</i>	1	PC \$ 30.00	\$ 30.00
2	W/SCREEN SEALANT <i>m</i>	1	PC \$ 40.00	\$ 40.00
3	IU BRKT <i>m</i>	1	PC \$ 26.00	\$ 26.00
4	COOLANT <i>m</i>	1	PC \$ 60.00	\$ 60.00
5	A/C GAS <i>m</i>	1	PC \$ 40.00	\$ 40.00
6	NUMBER PLATE <i>st</i>	1	PC \$ 40.00	\$ 40.00

Main Office:
Mova Building
No. 22, Jalan Kilang,
Singapore 159419
Tel : (65) 6476 3333
Fax : (65) 6271 5891
www.mova.com.sg

Workshop Dept:
Block 1008,
Bukit Merah Lane 3,
#01-04/06/08/94
Singapore 159722

Tel : (65) 6272 3892
Fax : (65) 6270 8314
Co. Reg. 198904033G
GST Reg. M2-0088864-2

ESTIMATE

27/9/2024

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

Vehicle No: YP6714D
Vehicle Model: CBMQ24090195
Est No:
Claims ref:
Accident Date: 16/09/24
In Charge: BRIAN
Remarks:

No	Description	Qty	U. Price	Amounts S\$
	SPECIAL NET TOTAL S\$			<u>\$ 236.00</u>
	LABOUR CHARGE:			
1	TO CUT / WELD / PANEL BEAT DASH PANEL , REPLACE CABIN BRKT ,SWING ARM. TO REPLACE DAMAGES ITEMS AND REALIGN ALL THE CONNECTION			\$ 1,400.00 1100
2	TO SPRAY PAINT ON FRONT PANEL , CORNER PANEL LH/RH, LH A-PILLAR GRILLE, FRONT BUMPER,DASH PANEL, CHASSIS CROSSMEMBER AND BOTH FRONT DOOR			\$ 1,680.00 1400
3	TO REPLACE FRONT WINDSCREEN			\$ 150.00 120
4	TO ADJUST FOCUS HEADLAMP			\$ 80.00 40
5	TO REMOVE /REFIT DASHBOARD AND UPHOSTERY TO FACILITATE REPAIR.			\$ 250.00 200?
6	TO REPLACE A/C SYSTEM , DAMAGES PARTS , VACUUM & REPLENISH A/C GAS			\$ 220.00 180
7	TO CHECK FOR / RECTIFY WIRING CONNECTION/DIAGNOSIS, RESET SYSTEM AFTER REPAIR			\$ 220.00 120
	TOTAL LABOUR COST S\$			<u>\$ 4,000.00</u>

AMOUNT S\$ \$ 16,362.75
GST @ 9% \$ 1,472.65
AMOUNT DUE S\$ \$ 17,835.40

Customer's Signature

MOVA AUTOMOTIVE PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Handwritten notes:
Rome
Up 9001068
10 days
45
27/09/24
Reason
EXCESS: 700
Reg after rep

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	695G
Vehicle Details	
Vehicle No.:	YP6714D
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Sep 2024
Vehicle Make:	HINO
Vehicle Model:	HINO XZU710R-HKFMS3
Primary Colour:	White
Manufacturing Year:	2016
Engine No.:	N04CUS30655
Chassis No.:	JHHUCS3H30K019584
Maximum Power Output:	-
Open Market Value:	\$29,203.00
Original Registration Date:	07 Jul 2017
First Registration Date:	07 Jul 2017
Transfer Count:	0
Actual ARF Paid:	\$1,461.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	06 Jul 2027
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
QP Paid:	\$38,501.00
COE Rebate Amount:	\$10,681.00
Total Rebate Amount:	\$10,681.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 27 Sep 2024

OK



Hino XZU710R

\$49,988 Instalment \$1,529/mth

PREMIUM AD

Shortlist

Loan Calculator



Overview Financial Photo Research

Depreciation

i \$17,850 / year

Reg. Date

17-Jul-2017

(2yrs 9mths 19days COE left)

Lifespan

i 16-Jul-2037

Manufactured

i 2016

Mileage

-

Transmission

Manual

Engine Cap

4,009 cc

Curb Weight

i 2,480 kg

Fuel Type

Diesel

COE

i \$36,879

OMV

i \$30,275

ARF

i \$1,514

Dereg Value

i \$10,326 as of today

No. of Owners

i 2