



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2503022

16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING
SINGAPORE 048581

INV Date 16/05/2025
Reference CD/FCI24100008/Tpa3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLN 4224D
Insured Veh. SHA 8733R
Claim No. D24008611MFCT
Policy No. D-24101860MFCT
Accident Date 29/09/2024
Inspection Date 30/10/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDINGSINGAPORE 048581			Ref: CD/FCI24100008/Tpa3q2(N)	Date: 16/05/2025
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 8733R	Veh. Inspected	SLN 4224D	
Policy No.	D-24101860MFCT	Coverage (\$)	0.00	
Claim No.	D24008611MFCT	Excess (\$)	0.00	
Assign From	EMILY TAN	Assign Date	30/10/2024	
2. Vehicle Particulars & Condition				
Make & Model	CITROEN GRAND C4	c.c	1560	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	VF73ABHZTGJ879640	Colour	WHITE	
Odometer	63688 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	MICHELIN	6 mm	
L/H Front Tyre	205/60 R16	MICHELIN	6 mm	
R/H Rear Tyre	205/60 R16	MICHELIN	6 mm	
L/H Rear Tyre	205/60 R16	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	29/09/2024	Inspection Date	30/10/2024	
Survey held at	CYCLE & CARRIAGE FRANCE PTE LTD 209 PANDAN GARDENS SINGAPORE 609339			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLN 4224D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SUNDRIES (SN)	NECESSARY	80.00	50.00
1	FRONT BUMPER (SN)	DEFORMED	1,739.00	1,739.00
1	BUMPER BRACKET (SN)	CRACKED	457.00	457.00
1	BUMPER MOULDING (SN)	CUT	251.00	251.00
1	BUMPER MOULDING (SN)	CRACKED	380.00	380.00
1	BMPR RUBBR BOOT (SN)	CUT	373.00	373.00
1	GUARD GRILLE INFERIEUR (SN)	CUT	519.00	519.00
1	SET BRACKET (SN)	DEFORMED	181.00	181.00
1	BRACKET SET LAT (SN)	CUT	181.00	181.00
1	SET ABSORBER (SN)	CRACKED	137.00	137.00
1	BUMPER BRACKET (SN)	NOT NECESSARY	735.00	-
1	BUMPER BRACKET (SN)	NECESSARY	358.00	358.00
1	PLUG LH (SN)	NOT NECESSARY	160.00	-
10	RIVET (SN)	NOT NECESSARY	10.00	-
1	FRONT WING LH ASS (SN)	BENT	731.00	731.00
1	ACCOUSTIC SEAL (SN)	NOT NECESSARY	76.00	-
1	FRONT LIGHT LH (SN)	NOT NECESSARY	645.00	-
1	FRONT LICENSE PLATE WITH FRAME (SN) (ADDITIONAL)	BENT	85.00	85.00
1	HEADLIGHT ASSY LH (SN) (ADDITIONAL)	CRACKED	1,063.00	1,063.00
1	BUMPR DEFLECTOR (SN) (ADDITIONAL)	DEFORMED	535.00	535.00
10	RIVET 4,8X20 (SN) (ADDITIONAL)	NECESSARY	80.00	80.00
			8,776.00	7,120.00
	<u>LABOUR</u>			
	TO REPLACE FRT BUMPER ,FRT LHS FENDER ,HEADLAMP ,REPAIR ACCIDENT AFFECTED AREA.		2,160.00	1,900.00
	PAINT WORK ON FRT BUMPER ,FRT LHS FENDER .		1,650.00	1,100.00
	ANTI-RUST PROOFING.		160.00	100.00
	APPLY BODY SEALANT ON AFFECTED AREA.		160.00	100.00
	TO CHECK WIRING & CHASSIS ELECTRICAL SYSTEM.		200.00	80.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	TO CARRY OUT DIAGNOSTIC CHECK ON ELECTRONIC CONTROL SYSTEM.		480.00	480.00
			4,810.00	3,760.00
GRAND TOTAL			13,586.00	10,880.00
RECOMMENDED COST OF REPAIRS				10,880.00

Report Ref No. CD/FCI24100008/Tpa3q2(N)

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor


HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D

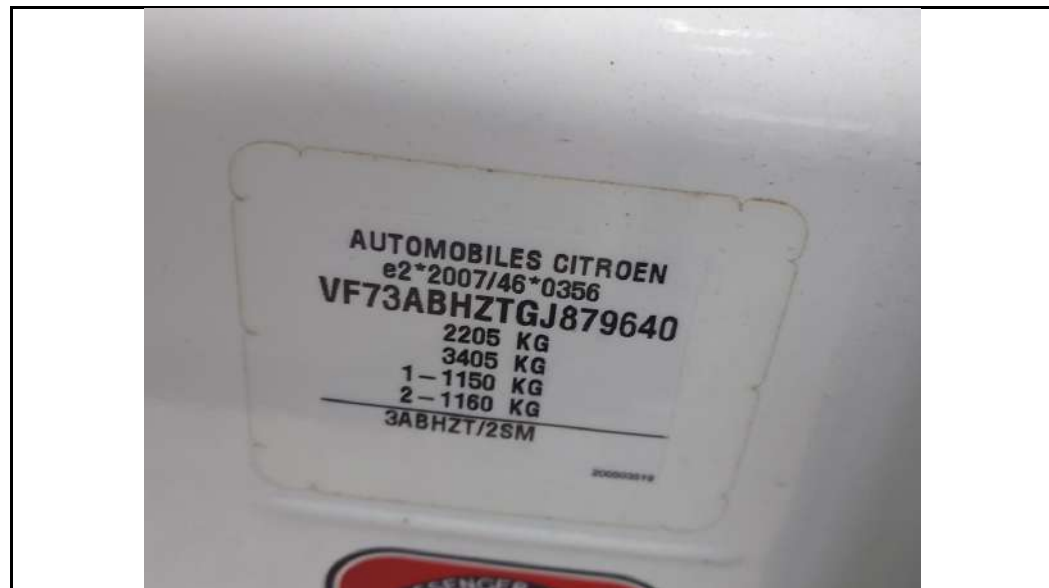

PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D




PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D




PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D

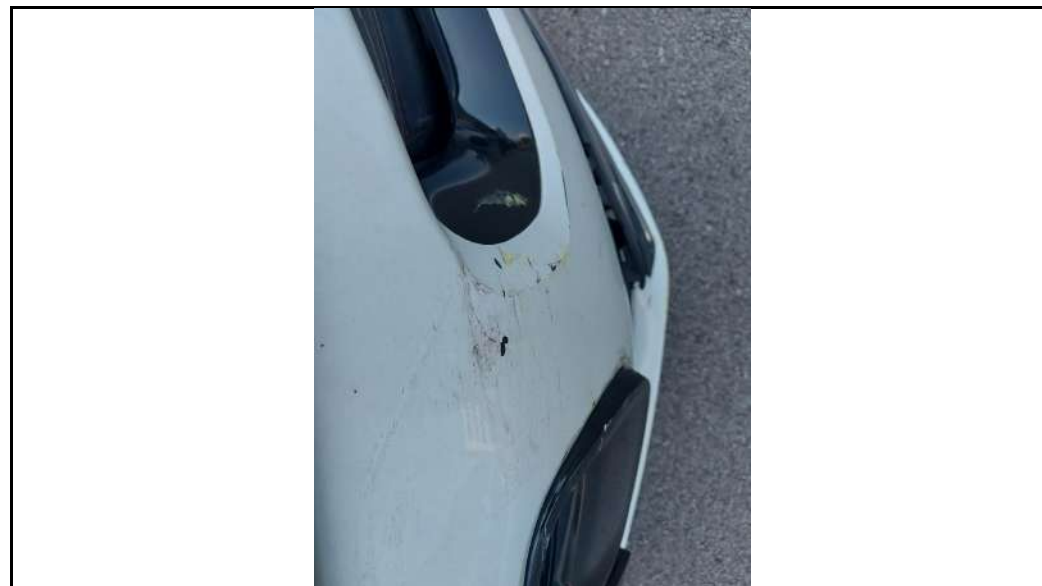

PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D

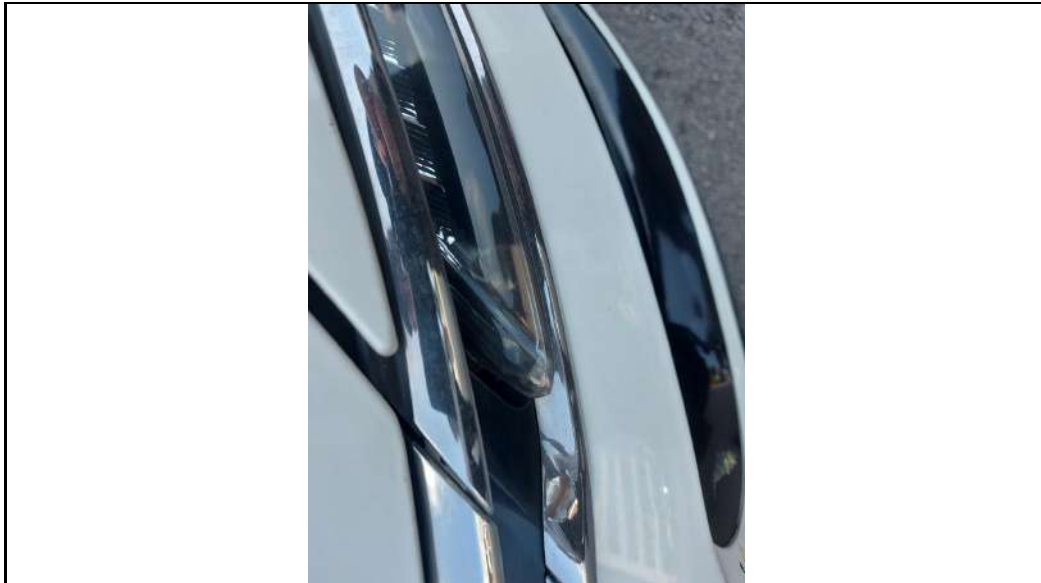

PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 16 of 16)

PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D




PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D

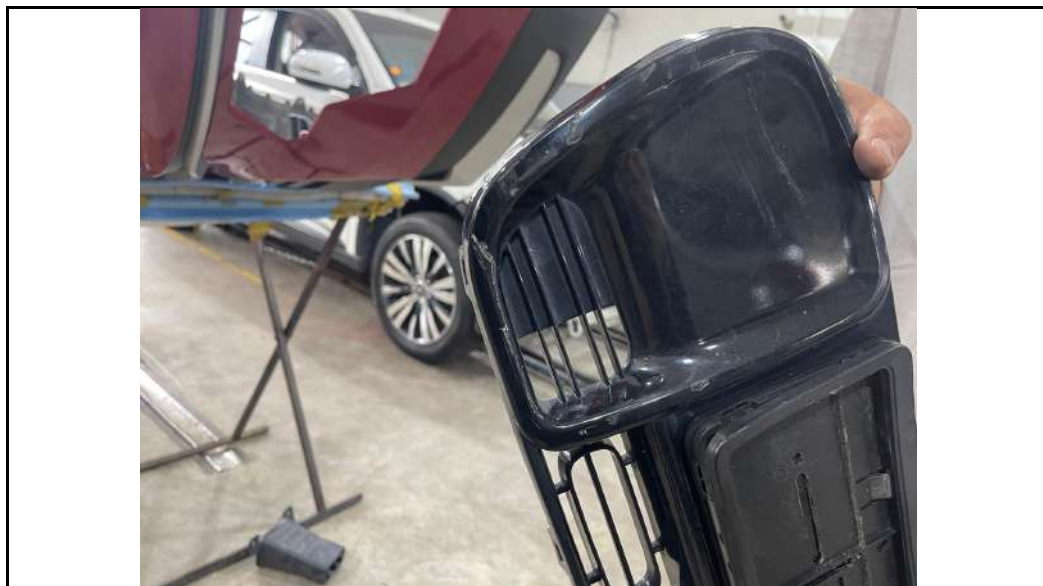

PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D



PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.

19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SLN 4224D

