



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2506193

3 ANSON ROAD #16-00

INV Date 12/09/2025

SPRINGLEAF TOWER

Reference CD/CTI24100030/Kpa3q2

SINGAPORE 079909

Code CTI

ATTN: Lynn Khong

PROFESSIONAL SERVICE FEE

Vehicle No. SNP 1934Z

Insured Veh. GBK 5804H

Claim No. SNM24D205533

Policy No. DMCVSNA00091172300

Accident Date 27/09/2024

Inspection Date 01/10/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909 ATTN: Lynn Khong			Ref: CD/CTI24100030/Kpa3q2(N) Date: 12/09/2025 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBK 5804H	Veh. Inspected	SNP 1934Z
	Policy No.	DMCVSNA00091172300	Coverage (\$)	0.00
	Claim No.	SNM24D205533	Excess (\$)	0.00
	Assign From		Assign Date	01/10/2024
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA ALPHARD (A)	c.c	2487
	Engine No.	HIDDEN	Year of Reg.	2024
	Chassis No.	JTNACAAH108001158	Colour	METALLIC BLACK
	Odometer	37005 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/65R17	TOYO	8 mm
	L/H Front Tyre	225/65R17	TOYO	8 mm
	R/H Rear Tyre	225/65R17	TOYO	8 mm
	L/H Rear Tyre	225/65R17	TOYO	8 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	27/09/2024	Inspection Date	01/10/2024
	Survey held at	OPTIMA WERKZ PTE LTD 10 ANG MO KIO INDUSTRIAL PARK 2A #01-05 AMK AUTOPOINT SINGAPORE 568047		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNP 1934Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT	BENT	3,236.00	2,911.00
1	REAR W/SCREEN MOLDING	NECESSARY	170.00	170.00
1	REAR BOOTLID EMBLEM (HEV)	NECESSARY	101.00	101.00
1	REAR BOOTLID INNER TRIM BOARD	DENTED	1,860.00	1,621.60
1	REAR BOOTLID LOCK ASSY	DENTED	1,108.00	1,108.00
2	REAR BOOTLID ELECTRIC STRUT - LH & RH	JAMMED	3,210.00	3,210.00
2	REAR BOOTLID SENSOR ASSY - RH & LH	O/S DENTED	2,440.00	1,220.00
2	REAR BOOTLID HINGE - LH & RH	TO REPAIR SEE LABOUR	186.00	-
1	REAR WEATHERSTRIP	DISTORTED / DENTED	481.00	481.00
1	REAR BUMPER	BUCKLED	916.00	866.00
2	REAR BUMPER ULTRASONIC SENSOR - CTR LH & RH @ \$432.80	SHORTED	990.00	865.60
1	REAR END PANEL	BENT	2,051.00	1,601.90
1	REAR END FLOOR PANEL	TO REPAIR SEE LABOUR	2,505.00	-
1	REAR END FLOOR TOP COVER - RH	SERVICEABLE	870.00	-
1	REAR END PANEL BTM TRIM PANEL	DENTED	207.00	207.00
1	REAR BOOTLID SUBWOOFER (ADDITIONAL)	MTG CRACKED	2,700.00	2,152.70
	LESS 25% DISCOUNT		-5,757.75	-4,128.95
			17,273.25	12,386.85
<u>SPECIAL NETT ITEMS</u>				
1	REAR END PANEL TOP GARNISH - AFTERMARKET (SN)	SERVICEABLE	110.00	-
1	REAR W/SCREEN SEALANT (SN)	NECESSARY	120.00	40.00
1	SET REAR BUMPER LOWER CHROME STRIPS - (SN)	DENTED	180.00	180.00
			410.00	220.00
<u>LABOUR</u>				
	TO REMOVE, REPLACE, REPAIR, READJUST AND REFIX REAR AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF REAR BOOTLID HINGE - LH & RH AND REAR END FLOOR PANEL.		1,400.00	600.00

Report Ref No. CD/CTI24100030/Kpa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PERFORM WIRING CHECKS ON ELECTRICAL SYSTEMS.		30.00	20.00
	TO REMOVE, PUTTY, REPAIR AND RESPRAY AFFECTED AREAS.		800.00	660.00
	TO REMOVE, REPLACE AND REFIX BUMPER SENSORS.		30.00	30.00
	TO REMOVE, REPLACE AND REINSTALL BOOTLID INNER MECHANISM.		30.00	30.00
	TO PERFORM ADAS CHECKS, CALIBRATION AND PROGRAMMING.		800.00	180.00
	TO REMOVE, REFIX AND REPLACE REAR WINDSCREEN.		100.00	100.00
			3,190.00	1,620.00
GRAND TOTAL			20,873.25	14,226.85
RECOMMENDED COST OF REPAIRS				14,226.85

Report Ref No. CD/CTI24100030/Kpa3q2(N)

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z




PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z



PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z

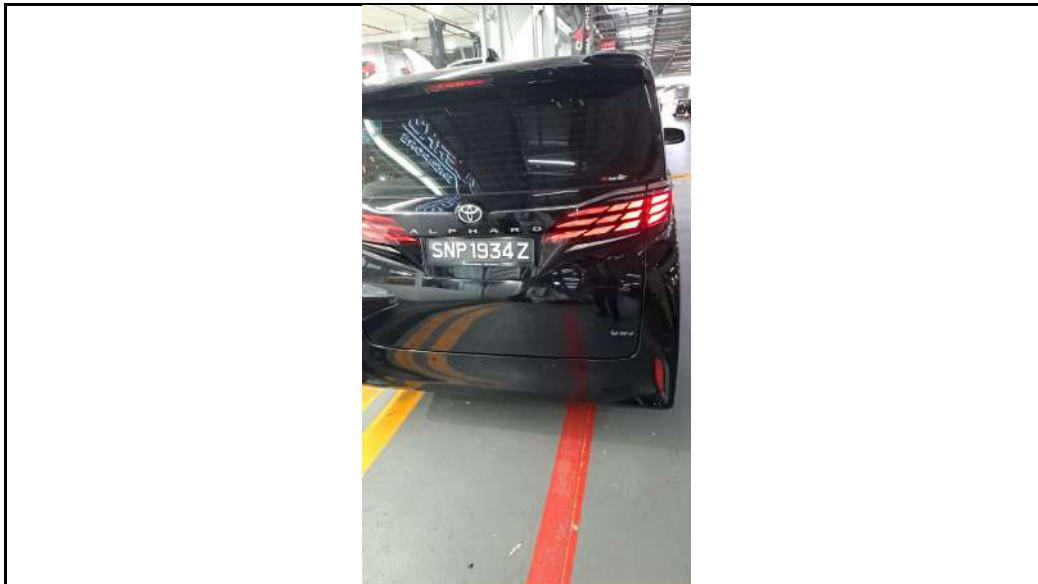



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SNP 1934Z

