

(08/11/13) Waf

ASS. REC. BY:

REF:

CS/FCI24100111/Rnp3


5384

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To inspect Vehicle No: SCN 1132
at Workshop m/s CYCLE & CARRIAGE
of PANDAN LOOP
Insured: PCI
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

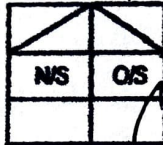

Bal. or Market Value: 125K
IDAC Accident Report: Consistent? : Yes or No
GIA / PR Seer: Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SCN 1132 Yr Regn: 2018 / MY
Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or

Make: MERCEDES BENZ GL200 EXCLUSIVE 1991
Colour: GREY AC: Insured / Std / NI / NA
Sp. Reading: 54376 T/Radio: Insured / Std / NI / NA

EngNo: _____
CNo: W002130422A 475009

Gen. Cont: Good / Fair / Poor / Burnt

Steering: Good / Jammed / Locked / Burnt or

Brake: Good / Jammed / Locked / Burnt or

Modi: NI / STD / STD A/Rim or

Tyre Size: F: 275/40R18
R: _____

BS / DUN / EXNOVA / GY / FS / LZA / MC / ONTSU / PIR / SUNE /
TOYO / YOKO or

Front Rear
R/Bal. 6 mm R/Bal. 6 mm
L/Bal. 6 mm L/Bal. 6 mm
D.O.A. 25/06/24 D.O.I. 07/10/24
Survey held at PANDAN LOOP

Des. of Damages: Frt / Rear / OS / NS / UIC / Roof/Top or

OS REAR

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT - 61K

Date/Time, File Pass to?

☐
☐

Preli. Report

Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐ : Site Insp (\$ _____)

☐ : Interview (\$ _____)

☐ : Tech. Invs (\$ _____)

☐ : Weekend (\$ _____)

) : S+RS \$ _____

) : Photos

) : Others

TOTAL

Report Format : _____

Lump Sum / I.B.I. (\$) _____



Mercedes-Benz

Cycle & Carriage
Industries Pte Limited
Authorised Dealer
Company No. 196400367W
GST Reg No. MR-8500111-X

ESTIMATE FOR SCN113Z

MS FIRST CAPITAL INSURANCE LIMITED

MOTOR CLAIM DEPARTMENT
6 RAFFLES QUAY
#21-00
SINGAPORE 048580
65073848

WIP No

Reg No/Reg Date

Date In/Mileage

Chassis No

Engine No

Make/Model

Colour/Trim

Vehicle & Document Information

18991

SCN113Z / 27/08/2018

SCN113Z

WDD2130422A475009

27492031519037

MB/MB E 200 SEDAN EXCLUSIVE/EXCLUSIVE

029 992 Selenite Gr/ 048 801 Leather Nap

Account No	Terms	Date/Time Printed	CSE	Operator				
WF001862	Credit	07/10/2024/ 11:00	VS	356 / Vincent Seah				
Description of Goods / Services					Qty	Unit Price	Disc%	Amount
Z REQUEST								
Customer Request								
M BPNSUN								
POLICY NO/ACC DATE : V5017264 // 25.06.2024								
DRIVE IN/EXCESS : 25.06.2024 // TP SH7993X- FIRST CAPITAL								
DATE IN/DATE SURVEY:								
BY/AUTHORIZED ON :								
M BPNSUN								15.00
SUNDRIES								
A BPILAB							0.10	380.00
USING XENTRY DIAGNOSTIC TO CHECK ON CONTROL UNIT RESET MEMORY TO IDENTIFICATION STANDARD. NETT								
A BPILAB								120.00
CHECK REAR LIGHTING SYSTEM AND WATER TEST FOR ANY LEAKAGE. NETT								
A BPILAB								4320.00
DISASSEMBLE AND REPLACE ATTACHED DAMAGED PARTS & REFINISH.								
A BPIRES							0.01	3200.00
RESPRAY ON RHR FENDER , REAR BUMPER AND ACCIDENT AFFECTED AREA								
M RIGHT REAR LAMP COMBINATION					1.00	840.76	00.00	840.76
M REAR BUMPER					1.00	1705.44	00.00	1705.44
M LHR CHROME MOULDING					1.00	207.42	00.00	207.42
M RHR CHROME MOULDING					1.00	207.42	00.00	207.42
M BRACKET					1.00	57.90	00.00	57.90
M CUPPED BLIND RIVET					12.00	5.50	00.00	66.00
M LOWER RHR BRACKET					1.00	70.12	00.00	70.12
M RHR EXHUATS TIP CHROME TRIM STRIP					1.00	225.86	00.00	225.86
M RHR SIDE STABILITY					1.00	118.84	00.00	118.84
M RHR BASIC MOUNTING FOR BUMPER					1.00	92.10	00.00	92.10
M TOP RHR BASIC MOUNTING FOR BUMPER					1.00	50.51	00.00	50.51
M DISTANCE SENSOR					2.00	201.17	00.00	402.34
M SPACER RING					6.00	8.89	00.00	53.34
M CUPPED BLIND RIVET					2.00	5.50	00.00	11.00
M REAR LOWER BUMPER					1.00	441.74	00.00	441.74

Confirmed & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required.
Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

Pandan Loop Service Center
188 Pandan Loop
Singapore 128378
Tel: 6777 8388
Fax: 6779 5383

ESTIMATE FOR SCN113Z

Cycle & Carriage
Industries Pte Limited
Authorised Dealer
Company No. 196400367W
GST Reg No. MR-8500111-X

MS FIRST CAPITAL INSURANCE LIMITED

MOTOR CLAIM DEPARTMENT
6 RAFFLES QUAY
#21-00
SINGAPORE 048580
65073848

WIP No

Reg No/Reg Date

Date In/Mileage

Chassis No

Engine No

Make/Model

Colour/Trim

Vehicle & Document Information

18991

SCN113Z / 27/08/2018

WDD2130422A475009

27492031519037

MB/MB E 200 SEDAN EXCLUSIVE/EXCLUSIVE

029 992 Selenite Gr/ 048 801 Leather Nap

Account No	Terms	Date/Time Printed	CSE	Operator		
WF001862	Credit	07/10/2024/ 11:00	VS	356 / Vincent Seah		
Description of Goods / Services						
			Qty	Unit Price	Disc%	Amount
M	REAR BUMPER CHROME MOULDING		1.00	414.53	00.00	414.53
M	COVER, TOWING EYE		1.00	161.87	00.00	161.87
M	RIGHT REFLECTING Emitter		1.00	49.88	00.00	49.88

THIS IS NOT AN OFFICIAL TAX INVOICE

Rasul
Hp 90011168
4 days
07/10/24
Res b4 paint

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Confirmed & accepted by

Nett 13,212.07
9% GST on 13212.07 1189.09

Total Payable 14,401.16

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring removal of the windscreen.

Pandan Loop Service Center
188 Pandan Loop
Singapore 128378
Tel: 6777 8388
Fax: 6779 5383
www.mercedes-benz.com.sg

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	538H
Vehicle Details	
Vehicle No.:	SCN113Z
Vehicle to be Exported:	No
Intended Deregistration Date:	08 Oct 2024
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	E200 EXCLUSIVE (R18 LED)
Primary Colour:	Grey
Manufacturing Year:	2018
Engine No.:	27492031519037
Chassis No.:	WDD2130422A475009
Maximum Power Output:	135.0 kW (181 bhp)
Open Market Value:	\$57,519.00
Original Registration Date:	27 Aug 2018
First Registration Date:	27 Aug 2018
Transfer Count:	0
Actual ARF Paid:	\$75,535.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Aug 2028
PARF Rebate Amount:	\$49,097.00
Intended COE Rebate Details	
COE Expiry Date:	26 Aug 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$36,000.00
COE Rebate Amount:	\$13,974.00
Total Rebate Amount:	\$63,071.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 08 Oct 2024

OK



Mercedes-Benz E-Class E200 Exclusive

\$133,800 Instalment \$1,804/mth

PREMIUM AD

💰 Apply for 2.48% loan

♡ Shortlist

✔ Get Warranty



Overview

Financial

Photo

Research

Depreciation

📘 \$22,910 / year

Reg. Date

17-Dec-2018

(4yrs 2mths 8days COE left)

Manufactured

📘 2018

Mileage

58,000 km (10k / year)

Transmission

Auto

Engine Cap

1,991 cc

Road Tax

📘 \$1,202 / year

Power

135.0 kW (181 bhp)

View specs of the [Mercedes-Benz E-Class Saloon 2016 \(2016-2021\)](#)

Curb Weight

📘 1,605 kg

COE

📘 \$31,101

OMV

📘 \$57,519

ARF

📘 \$75,535

D... V...

📘 \$25,000