LKK

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

Tax Invoice

STRIDES PREMIER AUTOMOTIVE SERVICES PL.

60 WOODLANDS INDUSTRIAL PARK E4

SINGAPORE 757705

INV No.: SAC2401152

INV Date: 25-10-2024

Reference CS/SMR24100145/Eqp3e2

Code SMR

PROFESSIONAL SERVICE FEE

Vehicle No. SLV 7506D Insured Veh. SHB 203B

Claim No. TAX/09/24/2108

Policy No.

Accident Date 30/09/2024 Inspection Date 15/10/2024

Description	Amount
Survey Inspection	128.00
Resurvey Inspection	0.00
Digital Photographs	0.00
Transportation	0.00
Sub-Total	128.00
GST (9%)	11.52
Grand Total	139.52

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

KHM



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

	Affiliated to Federation Internation	ale Des Experts En	Automobile				
STRIDES PREMIE	R AUTOMOTIVE SERVICES PL.	Ref:	CS/SMR24100145/Eqp3e2				
	NDUSTRIAL PARK E4 SINGAPORE	Date:	08/10/2024				
737703		Code:	SMR				
1. Policy Particulars :- THIRD PARTY CLAIM							
Insured Veh.	SHB 203B	Veh. Inspected	SLV 7506D				
Policy No.	-	Coverage	0				
Claim No.	TAX/09/24/2108	Excess	\$0.00				
Assign From	HUA YEN	Assign Date	07/10/2024				
	Vehicle	Details					
Make & Model	TOYOTA WISH	C.C	1798				
Engine No.	2ZR0A34842	Year of Reg.	15/01/2018				
Chassis No.	JTDGG20W60J008527	Colour	BROWN				
Odometer	201462 KM	Steering	IN ORDER				
Brakes	IN ORDER	General	GOOD				
Modification(s)	RIMS: SPORTS RIM						
	Condition	s of Tyres					
	Size	Make	Balance (mm)				
R/H Front Tyre	195/65 R15	CONTINENTAL	6				
L/H Front Tyre	195/65 R15	CONTINENTAL	6				
R/H Rear Tyre	195/65 R15	CONTINENTAL	6				
L/H Rear Tyre	195/65 R15	CONTINENTAL	6				
	Description	of Damages					
VEHICLE SUSTAII	NED DAMAGES AT THE REAR PORTIC	ON.					
IAGES SEE DETAII	_S.						
	General Ir	nformation					
Accident Date	30/09/2024	Inspection Date	15/10/2024				
Survey held at	BORNEO MOTORS (S) PTE LTD 2 PANDAN CRESCENT SINGAPORE 128462						
	Rem	narks					
			REPAIRS.				
		rys of Repair					
	Insured Veh. Policy No. Claim No. Assign From Make & Model Engine No. Chassis No. Odometer Brakes Modification(s) R/H Front Tyre L/H Front Tyre L/H Rear Tyre VEHICLE SUSTAIN AGES SEE DETAIN Accident Date Survey held at	STRIDES PREMIER AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705 Policy Particulars:- Insured Veh. SHB 203B Policy No Claim No. TAX/09/24/2108 Assign From HUA YEN Vehicle Make & Model TOYOTA WISH Engine No. 2ZR0A34842 Chassis No. JTDGG20W60J008527 Odometer 201462 KM Brakes IN ORDER Modification(s) RIMS: SPORTS RIM Condition Size R/H Front Tyre 195/65 R15 L/H Rear Tyre 195/65 R15 L/H Rear Tyre 195/65 R15 L/H Rear Tyre 195/65 R15 WEHICLE SUSTAINED DAMAGES AT THE REAR PORTICAL AGES SEE DETAILS. General In Accident Date 30/09/2024 Survey held at BORNEO MOTORS (S) PTE LTD 2 PANDAN CRESCENT SINGAPORE 128462 Rem HE INSPECTION WAS CONDUCTED ON A"WITHOUT PR IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE N	FOR INCOMPLIANDS INDUSTRIAL PARK E4 SINGAPORE 757705 Policy Particulars: - THIRD PARTY CLAI Insured Veh. SHB 203B Veh. Inspected Policy No Coverage Claim No. TAX/09/24/2108 Excess Assign From HUA YEN Assign Date Vehicle Details Make & Model TOYOTA WISH C.C Engine No. 2ZR0A34842 Year of Reg. Chassis No. JTDGG20W60J008527 Colour Odometer 201462 KM Steering General Modification(s) RIMS: SPORTS RIM Parkes IN ORDER General Make R/H Front Tyre 195/65 R15 CONTINENTAL L/H Front Tyre 195/65 R15 CONTINENTAL L/H Rear PORTION L/H REAR				



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SLV 7506D

	Special Nett							
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)				
1	SUNDRY (SN)	NECESSARY	\$100.00	\$50.00				
1	SEALANT (SN)	NOT NECESSARY	\$200.00	\$0.00				
1	3R0 SENSOR (SN)	NOT NECESSARY	\$151.60	\$0.00				
1	PLATE, RR BUMPER (SN)	DENTED	\$911.60	\$911.60				
1	SUPPORT, RR BUMPER (SN)	NOT NECESSARY	\$149.10	\$0.00				
1	RETAINER, RR BUMPER (SN)	NOT NECESSARY	\$70.20	\$0.00				
1	SUPPORT, RR BUMPER (SN)	BROKEN	\$149.10	\$149.10				
1	RETAINER, RR BUMPER (SN)	BROKEN	\$70.20	\$70.20				
1	REFLECTOR ASSY (SN)	NOT NECESSARY	\$83.40	\$0.00				
1	REFLECTOR ASSY (SN)	NOT NECESSARY	\$83.40	\$0.00				
1	PANEL SUB-ASSY, BODY (SN)	TO REPAIR SEE LABOUR	\$817.70	\$0.00				
1	ARM, RR BUMPER (SN)	NOT NECESSARY	\$74.70	\$0.00				
1	EMBLEM, SYMBOL (SN)	NECESSARY	\$73.50	\$73.50				
1	PLATE, LUGGAGE COMPT (SN)	NECESSARY	\$56.90	\$56.90				
1	ELEGANCE EMBLEM (SN)	NECESSARY	\$40.00	\$40.00				
1	ANTENNA, ELECTRICAL (SN)	NOT NECESSARY	\$266.20	\$0.00				
10	PIECE, RR BUMPER (SN)	NECESSARY	\$58.00	\$58.00				
		\$3,355.60	\$1,409.30					

Labour								
Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)					
DRILL HOLE AND INSTALL REVERSE SENSOR		\$198.00	\$198.00					
CHECK WIRING SYSTEM		\$134.64	\$134.64					
REMOVE INTERIOR UPHOLSTERY TO FAC REPAIR		\$792.00	\$396.00					
TO RESET ECU AND REPROGRAMME		\$198.00	\$198.00					
REPLACE ACC DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY, BODY		\$3,960.00	\$1,584.00					
RESPRAY ACC AFFECTED AREAS		\$3,936.00	\$1,968.00					
		\$9,218.64	\$4,478.64					

GRAND TOTAL	\$12,574.24	\$5,887.94
-------------	-------------	------------



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

RECOMMENDED COST OF REPAIRS \$5,887.94

Report Ref No: CS/SMR24100145/Eqp3e2

CTY

STEVE CHEN TSUE YEE

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

SA0124A10001-01 / AIG Asia Pacific Insurance Pte. Ltd. ENTRY DATE & TIME: 01/10/2024 08:54 (SGT) SUBMITTED BY: Abd-Latiff, Roszanah VERSION: 2 (07/10/2024 11:43 (SGT))



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- Please report <u>correctly</u> the details of the accident to speed up the claims process.
 This Form must be <u>completed by the Policyholder and/or the Actual Driver</u>
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy liability.

 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.

5. Any false reporting may be referred to the Police for investigation.

- 6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.

 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission Reported by Date of Accident Exact Location of Accident Additional Location Information Country/State of Loss

01/10/2024 08:54 (SGT) Both Policyholder and Actual Driver 30/09/2024 19:27 (SGT) Singapore Jurong East Road Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number

SLV7506D

INSURED/POLICYHOLDER

Is company?

Name Of Registered Owner

NRIC No

Email Address Mobile Phone No

Alternative Phone No

Nο

Toyota

WISH 1.8

Private car

Auto

1798

Wish

Kanaiyahnaidu S/O Narasunaidu

109.1

NOEMAIL@AIG.COM

VEHICLE PARTICULARS

Manufacturer

Model Variant

Exact purpose for which vehicle was being used at time of

accident

Are you claiming under your own insurance policy for repair to

your vehicle? Vehicle Category Transmission

CC

Vehicle Fuel

First Regisration Date

Chassis no

Effective Date/Time of Ownership

INSURANCE COMPANY

Name of Insurance Company Policy Number / Cover Note Number

No - Claiming third party

AIG Asia Pacific Insurance Pte. Ltd. 7220146719-01

DRIVER

Name of Driver Kanaiyahnaidu S/O Narasunaidu NRIC No. Date Of Birth Occupation Indoor **Driving Pass Date** 28/02/2003 Driving License Pass Class 3 **Driving License Validity** Valid Driving experience 21 YEARS AND 7 MONTHS Gender Male Mobile Number Alt. Phone Number Email Address NOEMAIL@AIG.COM Address Address complement Postcode Is the driver the policyholder? Yes If No, Relationship of the Driver with the Insured Does Driver Own Other Vehicles? No Vehicle Registration Number of Other Vehicle Owned by Driver Insurance Company of Other Vehicle Owned by Driver GENERAL INFORMATION OF THE ACCIDENT Type of Accident Collision - Head to Rear Weather Conditions Raining Road Surface Wet OTHER INFORMATION Was any foreign vehicle involved in the accident? No Number of vehicles involved in the accident 2 Was anybody injured in the Accident? Nο Was any injured conveyed to hospital by ambulance? Was any other vehicle or property damaged? Yes Number of Passengers (Including Driver) 1 Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? Νo Translator's name Translator's ID Translator's phone number Translator's email Original language used in the statement DETAILS OF POLICE ACTION Was the accident reported to the police? Nο Was notice of intended Prosecution given? No If yes, against whom? CIRCUMSTANCES OF ACCIDENT Moving Straight & Collided ATTACHMENT(S)

DETAILS OF OTHER VEHICLE PROPERTY 1

Yes

Yes

Vehicle Registration Number Vehicle Manufacturer

SHB203B

-



Are accident photos available for attachment?

Was there any video captured by Car Camera?

Vehicle Model	_
Vehicle Variant	-
Vehicle Colour	-
Vehícle Category	Taxi
Name of Driver	-
Contact Number	-
Address	_
Address complement	_
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

85876838585

MPGRIANT NOTICE

- MANAGAR LIMANANA A PARTITUM A SANTAN BERMATAN MANAKAN M A PARTITUM A PARTITUM MANAKAN M A PARTITUM MANAKAN MANAKA
- with with the with a minimum of the control of the
- * Annielse 1660 1860 1820 in colorest in incident Solige Constant of its conserva-tion with the last second of the colorest in the second of the color with the colorest of the color of t The state of commencers and the com-
- A REPORT OF THE PARTY CONTROL TO A ROLL OF
- Controllar of the Application of the property of
- A MARKET BERKER OF A CONTROL OF A final particles of the control of
- , we have a space of some solutions of the solution of the solution $\hat{\theta}_{ij}$
- ersolvending i kindig skalle erste glikering i koloni edelar besester bili stok uderak och och sektive og besek beses pr na levis
- A CONSTRUCTOR AND A CONTRACTOR OF THE STATE
- Ken lakk get landte dat graan toer deer deer deer gegenge ees 2 me. Betatminde mysteersteine van 3 factot op 1 km deem van de verk geen de deem toerbek in het deel deel de verd de Betatminde mysteersteine van 3 factot op 1 km deel van de verk geen de deel de verd de verd de verd de verd de 5 (58) 4 (C. B. C. C.
- HOUSE REPORTED
- of where the second reserves and the second of the property of the property of the second of the sec d. Senting and the sent surface of the sent of the particle of the sent of the sent sent of the sent
- to complete among the material and the contract of the parameter of the contract and the region of the con-

, . · · · - . .

The second secon

			···								
physics.	No law y	Salah ya Sala	Same applica-								
:											
: ,		4				9		25	. ,		
4 0		W	(150 p.)-	and the second	1 A#5 1	11 V - 1 - 1	5 to 5 to 5	1100	r den George	franktigt.	
1.32	P. Barrel	1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	S	awy si	15 July 2019	9 <u>82</u> (2007)	Caryo	: 1.4	6.000	الشجائج	
11 1	ad R						4.7		•		
:											
1											
											:
:											
:											
}											
1											:
:											
1											:
ì											:
:											
,											1
-											
į											:
											- :
:								•			
1											:
(
ì											:
,											
ì											
-											
}											
>											
4											
}											
:											
	and the second				1.0						
	1,45	1									
			•						i s		



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 1 of 10)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 2 of 10)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 3 of 10)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 4 of 10)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. : SLV 7506D









INSPECTION PHOTOS (Page 5 of 10)




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 6 of 10)





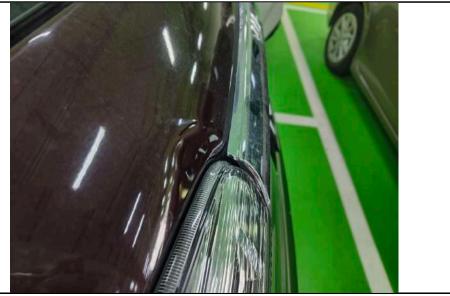






51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 7 of 10)





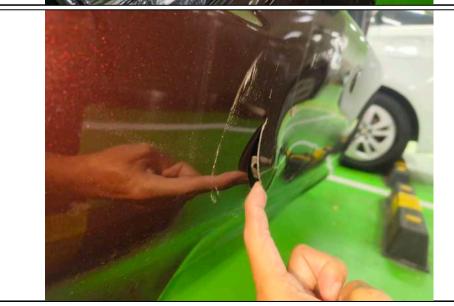








51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 8 of 10)

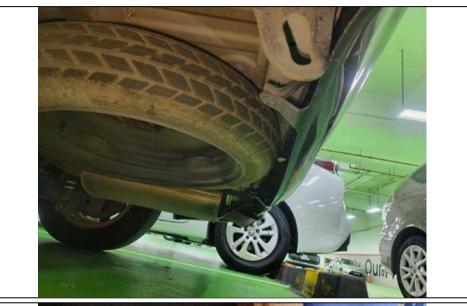








51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

INSPECTION PHOTOS (Page 9 of 10)

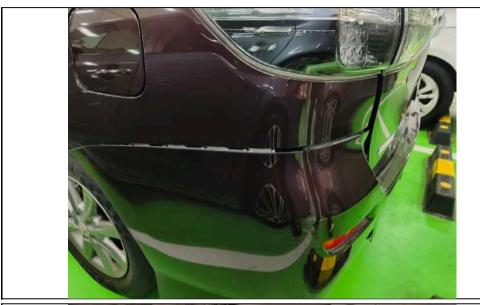











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R


INSPECTION PHOTOS (Page 10 of 10)





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

REINSPECTION PHOTOS (Page 1 of 4)

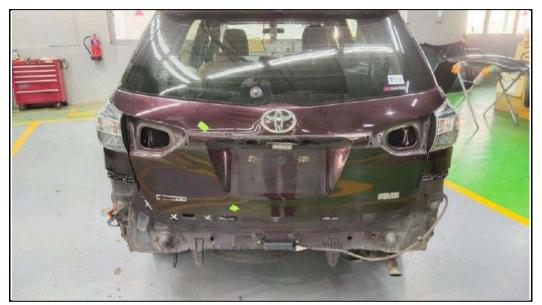









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

REINSPECTION PHOTOS (Page 2 of 4)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

REINSPECTION PHOTOS (Page 3 of 4)











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO.: SLV 7506D







REINSPECTION PHOTOS (Page 4 of 4)