



Century Motors

Century Motors (Singapore) Pte Ltd  
6 Marsiling Lane  
Singapore 739145



E: claims@autoinsure.com.sg

T: (65) 3157 2626

GST No.: 192800002R

Page No.1

AUTOMOBILE ASSESSMENT REPORT

Our Ref: **SNL5025S**

Your ref: **SMB1476P**

Date: **16-Oct-24**

BY EMAIL ONLY  
(claims@autoinsure.com.sg)

ATTENTION: MOTOR CLAIMS DEPT

EMAIL: motor\_claims@first-insurance.com.sg

First Capital Insurance Limited

6 Raffles Quay #21-00  
Singapore 048580

Assessed Vehicle No : **SNL5025S**  
Car Make and Model : **HYUNDAI OS KONA EV**  
Date of Accident : **12-Oct-24**  
Date of Assessment : **15-Oct-24**

We have carried out a physical assessment of SMQ5362D at our workshop **Century Motors (Singapore) Pte Ltd** sustained damages to the **FRONT** portion of the vehicle.


4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had sustained damages to the **FRONT** portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

Estimated Amount : **P/P**  
Adjusted Amount : **\$ 11,768.59**  
Est. Repair Days : **10**

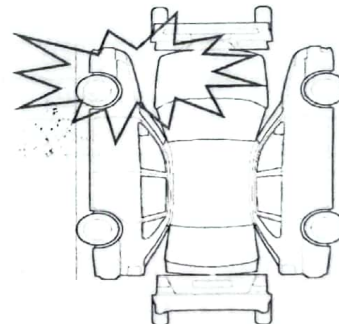

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.  
The assessment was conducted on a **"WITHOUT PREJUDICE"** basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

**Century Motors (Singapore) Pte Ltd** For any reliance on this report by any third party.

Our Ref: **SNL5025S**

Your Ref: **SMB1476P**

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
<b>PARTS REPLACEMENT - LIST ITEMS</b>				
1	1	FRT BUMPER / <i>BR</i>		\$ 590.30 /
2	1	FRT BUMPOER LOWER GRILLE / <i>CH</i>		\$ 486.50 /
3	1	FRT BUMPER SIDE RETAINER LH / <i>BR</i>		\$ 45.80 /
4	1	FRT BUMPER SPONGE <del>BR</del> / <i>BR</i>		\$ 85.60 /
5	1	HEAD LAMP LH / <i>P CH</i>		\$ 1,385.80 /
6	1	HEAD LAMP LOWER BRACKET LH / <i>BR</i>		\$ 35.80 /
7	1	HEAD LAMP MOULDING LH / <i>BR</i>		\$ 87.50 /
8	1	FRT BUMPER AIR DUCT LH / <i>CH</i>		\$ 55.40 /
9	1	FRT BUMPER AIR DUCT BRACKET LH / <i>CH</i>		\$ 38.80 /
10	1	FRT DAYLIGHT LH <del>X</del> <i>nn</i>		\$ 978.50
11	1	FRT FENDER LH <del>X</del> <i>R</i>		\$ 735.60
12	1	FRT WHEEL ARCH LH / <i>CH</i>		\$ 95.50 /
13	1	FRT FENDER INNER SHIELD LH / <i>TH</i>		\$ 85.60 /
14	1	FRT CHARING PORT COVER <del>X</del> <i>nn</i>		\$ 120.50
15	1	FRT CHARING PORT BRACKET <del>X</del> <i>nn</i>		\$ 1,595.65
16	1	HORN LH <del>X</del> <i>nn</i>		\$ 73.50
17	1	FRT WHEEL RIM LH / <i>CH</i>		\$ 1,251.90 /
18	1	FRT RADIATOR UPPER COVER <del>X</del> <i>nn</i>		\$ 120.50
			SUB TOTAL	\$ 7,868.75
			LESS 10%	\$ 786.88
			TOTAL AMOUNT	\$ 7,081.88

4244.50  
-10%  
3820.05

Our Ref: **SNL5025S**

Your Ref: **SMB1476P**

S/NO	QTY	SPECIAL NETT ITEMS	ASSESSED CONDITION	EST. BY WORKSHOP
1	1	FRT BUMPER CLIPS / <i>MC</i>		\$ 30.00
2	1	AIRCOND GAS <del>X</del> <i>nn</i>		\$ 100.00
3	1	RADIATOR COOLANT <del>X</del> <i>nn</i>		\$ 50.00
4	1	FRT NUMBER PLATE & HOLDER <del>X</del> <i>nn</i>		\$ 35.00
5	1	FRT WHEEL TYRE LH <del>X</del> <i>nn</i>		\$ 300.00
			SUB TOTAL	\$ 515.00
			TOTAL PARTS COST	\$ 7,596.88

30

Our Ref: **SNL5025S**

Your Ref: **SMB1476P**

S/NO	DESCRIPTION	EST. BY WORKSHOP	
<b>LABOUR &amp; PAINTWORK</b>			
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ 450	1,800.00
2	WHEEL ALIGNMENT & BALANCING	\$ 80	100.00
3	TO RESET FRT RADAR SENSOR	\$ 100	200.00
4	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$ 500	1,000.00
5	TO VACUUM, WAXING & CLEAN	\$ X	50.00
6	SUNDRIES (SAND PAPER, WELDING WIRE ETC.)	\$ 20	50.00
		TOTAL BEFORE GST	\$ 10,796.88
		GST 9%	\$ 971.72
		TOTAL (PARTS & LABOUR):	\$ 11,768.59

1150

#### Adjustments / Recommendations

5,000.05

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a sum of \$11,768.59 for lump sum with the third party insurance.

Yours Faithfully,

**Ck Loh**  
Claims Estimator

Steve (LKK)  
16/10/24, 2.30pm  
w R  
PIP  
by RL by  
4 days

<p><b>LKK Auto Consultants</b> hence notify the Repairer of the following:</p> <ul style="list-style-type: none"><li>• To resurvey before/after spray painting</li><li>• To display damaged part(s) during resurvey</li><li>• Parts prices are subject to confirmation</li><li>• Third party survey is on a "Without Prejudice" basis</li><li>• No illegal modification(s) is allowed</li><li>• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company</li></ul> <p>Acknowledged by Repairer Signature: _____ Date: _____</p>
---