

ASS. REC. BY:

REF:

CD/C72/24100435/Kma3

C

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

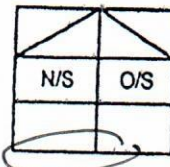

Bal. or Market Value: _____

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

03

days

Res.: Yes or No

Lum Sum: _____

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

SHF 553U

Yr Regn: _____

02, 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: _____

Toy Prius

c.c

1798

Colour _____

M.P White / Red

A/C: _____

Insured / Std / NI / NA

Sp. Reading _____

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: _____

JTDKB3FU03093820

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size: _____

F: _____

195/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Wanli

Front

Rear

R/Bal. _____

9

mm

R/Bal. _____

7

mm

L/Bal. _____

9

mm

L/Bal. _____

7

mm

D.O.A. _____

19/10/24

D.O.I. _____

21/10/2024

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1

Battery Plot

22/10

11 Sup @ 5050h Cahr

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation

S + RS. SI

Fees

Others

Add Fee: _____

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

Not Authorised
11 Pmp @ 5050/h

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF553U

AAD2410-071

Vehicle No.:

Chassis No.:

Co UEN:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

SHF553U

JTDKB3FUX03093820

200303878K

TOYOTA

PRIUS GEN 4

19/10/24

GBB9682M/China.

25/2/2021

PART

LIST

1	COVER, REAR BUMPER	\$	R ₂	612.68	✓
1	REINFORCEMENT SUB-ASSY, REAR BUMPER	\$	R ₂	419.90	✓
1	COVER, REAR BUMPER, LOWER	\$	S ₂	27.93	X
1	GUARD, REAR BUMPER, CENTER	\$	CM	472.19	✓
1	RETAINER, REAR BUMPER SIDE, LH	\$	DR1	167.48	✓
1	RETAINER, REAR BUMPER SIDE, RH	\$	S ₂	167.48	X
1	REFLECTOR ASSY, REFLEX, LH	\$	CM	49.25	✓
1	REFLECTOR ASSY, REFLEX, RH	\$	S ₂	49.25	X
1	COVER, FLOOR UNDER, NO.1 LH	\$	S ₂	220.50	X
1	COVER, FLOOR UNDER, NO.2 RH	\$	S ₂	304.92	X
1	COVER, REAR FLOOR CTR	\$	S ₂	290.43	X
1	COVER, DECK TRIM, REAR	\$	S ₂	159.39	X
1	PANEL SUB-ASSY, BODY LOWER BACK	\$	R	824.46	X
1	PANEL SUB-ASSY, QUARTER, LH	\$	R	1,099.46	X
1	LINER, REAR WHEEL HOUSE, LH	\$	S ₂	176.09	X
1	PANEL SUB-ASSY, BACK DOOR	\$	R	1,443.86	X
1	SPOILER SUB-ASSY, REAR	\$	S ₂ R	1,986.92	X
1	SEAL, REAR SPOILER	\$	R	21.32	X
1	GLASS, BACK WINDOW FIX	\$	Shadow	957.39	✓
1	DAM, WINDOW GLASS ADHESIVE	\$	R	65.21	✓
1	LENS & BODY, REAR COMBINATION LAMP, LH	\$	Br	428.19	✓
1	LENS & BODY, REAR COMBINATION LAMP, NO.2 LH	\$	Br	329.49	✓
1	COVER, REAR COMBINATION LAMP, LH	\$	nd	88.41	✓
1	LAMP ASSY, REAR, LH	\$	Br	370.44	✓
1	LAMP ASSY, REAR, RH	\$	S ₂	370.44	X
1	WEATHERSTRIP, BACK DOOR	\$	S ₂	469.25	X
1	GARNISH SUB-ASSY, BACK DOOR, OUTSIDE	\$	CM	1,156.89	✓
1	STAY ASSY, BACK DOOR, LH	\$	S ₂	305.66	X

Trans-cab Auto Services Pte Ltd**AAD2410-**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF553U

- 1 STAY ASSY, BACK DOOR, RH
- 1 HINGE ASSY, BACK DOOR, LH
- 1 HINGE ASSY, BACK DOOR, RH
- 1 PLATE, LUGGAGE COMPARTMENT DOOR NAME, NO.2
- 1 PLATE, BACK DOOR NAME, NO.1
- 1 ORNAMENT SUB-ASSY, BACK DOOR

\$	na	305.66	X
\$	na	77.18	X
\$	na	77.18	X
\$	na	68.88	—
\$	na	68.88	—
\$	na	90.30	—
TOTAL	\$	13,722.96	
25%	\$	3,430.74	
	\$	10,292.22	

Special Nett

- 1SET PARKING AID
- 1SET REAR BUMPER CLIP
- 2 WINDSCREEN SEALANT
- 1 WINDSCREEN MOULDING
- 1 WINDSCREEN INNER SPONGE SEAL
- 1 REAR TAILGATE STICKER "Trans-Cab"
- 1 REAR TAILGATE STICKER "6555-3333"
- 1 REAR BUMPER PROTECTOR
- 2 SEAM SEALANT
- 1SET REAR BUMPER RETAINER CLIP
- 1 END PANEL TRIM CLIP

\$	na	700.00	X
\$	na	95.00	601n
\$	na	150.00	401n
\$	na	200.00	X
\$	na	130.00	301n
\$	na	80.00	301n
\$	na	80.00	301n
\$	na	180.00	301n
\$	na	250.00	X
\$	na	85.00	X
\$	na	65.00	X
TOTAL	\$	2,015.00	
TOTAL PARTS	\$	12,307.22	

LABOUR

To Remove And Refit Rear Big and Small W/Screen Glass To Facilitate Bodywork Repair.

\$ 300.00 801

To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.

\$ na 380.00 X

Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same

\$ 1,600.00 4001

Trans-cab Auto Services Pte Ltd**AAD2410-**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF553U

To transfer of rear end panel fittings, attachment and perform water seepage test.

\$ 380.00 X

To transfer of Tailgate fittings, attachments and perform water seepage test.

\$ 180.00 X

To Rust-Proofing and apply undercoat Of The Affected Areas.

\$ 250.00 X

Putty And Spray Painting Of The Affected Portion.

\$ 1,600.00 8801

To reinstall rear bumper parking sensor.

\$ 170.00 501

To Check Electrical Lighting Concerned.

\$ 170.00 201

TOTAL \$ 5,030.00**Over All Total \$ 17,337.22****(PART-BY-PART) Repair Days****12 DAYS****3 days****LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF553U**AAD2410-071**

Vehicle No.:

Chassis No.:

Co UEN:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

SUPPLEMENTARY**SHF553U**

JTDKB3FUX03093820

200303878K

TOYOTA

PRIUS GEN 4

19/10/2024

GBB9682M/CHINA

24/5/2019

PART

- 1 MOULDING SUB-ASSY, ROOF TOP
1 MOULDING, ROOF DRIP SIDE FINISH, CENTER LH

LIST

	\$	<i>mycom</i> 829.50	—
	\$	<i>mr's</i> 80.12	—
TOTAL	\$	909.62	
25%	\$	227.40	
	\$	682.21	

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	878K

Vehicle Details

Vehicle No.:	SHF553U
Vehicle to be Exported:	Yes
Intended Deregistration Date:	21 Oct 2024
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS 5DR HATCHBACK (AUTO)
Primary Colour:	Red
Manufacturing Year:	2020
Engine No.:	2ZR2J04084
Chassis No.:	JTDKB3FUX03093820
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,879.00
Original Registration Date:	25 Feb 2021
First Registration Date:	25 Feb 2021
Transfer Count:	0
Actual ARF Paid:	\$7,131.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	24 Feb 2029
PARF Rebate Amount:	\$5,348.00

Intended COE Rebate Details

COE Expiry Date:	24 Feb 2029
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$31,876.00
COE Rebate Amount:	\$17,301.00
Total Rebate Amount:	\$22,649.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be deregistered once the COE expires, or when it reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 21 Oct 2024

OK