

(08/11/13) Wei
ASS. REC. BY:

REF:

CS/GA124100463/Rgp3

2006

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SNH 70455

at Workshop m/s BORNEO MOTOR

of PANDAN CRESCENT

Insured: GAI

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

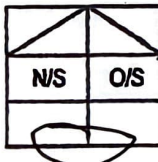

Bal. or Market Value: 131K

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Date / Time Action / Instruction

REPAIR LING - 54K

Veh No: SNH 70455 Yr Regn: 2022 / NOV

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA SIENNA HYBRID ST c.c 1497

Colour: BLACK A/C: Insured / Std / Nil / NA

Sp. Reading: 143367 T/Radio: Insured / Std / Nil / NA

Eng/No: _____

C/No: JD229H390L00131

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 185/60R15

R: _____

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /

TOYOT YOKO or

Front

Rear

R/Bal. 6 mm

R/Bal. 6 mm

L/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 22/10/24

D.O.I. 28/10/24

Survey held at

PANDAN C

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Invs (\$

☐ : Weekend (\$

) S + RS \$

) Photos

) Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

ESTIMATE

Account Details	Account No.	Customer Details
Great American Insurance Company 3 Temasek Avenue #16-01 Centennial Tower Singapore 039190	S1000027 / ICGAIC	M/S Grab Rentals Pte. Ltd
	Document No. 0	3 Media Close #01-03/06 Singapore 138498
	Document Date 23/10/2024	Work: 65703925

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2022	NHP170R	MWXNB H2	21/11/2022	SNH7045S	0	34095	67/TP/SNH7045S
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDZZ9H390L001131	1NZ9410610	60	Sam San Joi	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
1	Z	BP-GRAB-DS SUNDRIES - FLASH ARRIVE: DD/MM/YY 0000HR TP-SLZ6062C ACC DATE:22/10/2024 DRIVE IN:23/10/2024 DATE-IN: DATE SURVEY: NO OF REPAIR DAYS: BY: AUTHORISED ON:				50 100.00
2	B	BP-LAB2 CHECK LIGHTING & WIRING SYSTEM				198.00
3	B	BP-LAB2 REPLACE & INSTALL REAR WINDSCREEN GLASS				594.00
4	S	BP-SUBLET PHV STICKER				20.80
5	B	BP-LAB2 TRANSFER & INTALL COMPONENTS TO NEW TAIL GATE				594.00
6	Z	BP-SLANT SUPPLY SEALANT (NETT)				100.00
7	B	BP-ECU2 TO RESET ECU AND REPROGRAMME				198.00
8	B	BP-LAB2 REPLACE REAR ACCIDENT DAMAGED PARTS STRAIGHTREN & ALIGN REAR ACCIDENT AFFECTED AREAS				1980 3980.00
9	B	BP-RES2 RESPRAY JOB ON REAR ACCIDENT AFFECTED AR EAS				1640 3280.00
10	1	U52159-52978 COVER, RR BUMPER	1.00	489.60		489.60
11	2	U52156-52130 SUPPORT, RR BUMPER	1.00	139.10		139.10
12	3	U52155-52131 SUPPORT, RR BUMPER	1.00	139.10		139.10

For & on behalf of	Customer's Signature	Charge Summary	Total
Borneo Motors (Singapore) Pte Ltd			
	Please acknowledge receipt of vehicle	Parts Labour Sublet Lubrication/Fluid Others	Less Amount Due

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:

Company Copy



Borneo Motors



TOYOTA

Inchcape

Co. Reg No. : 196700086Z

GST Reg No. : MR-8500000-9

No. 2 PANDAN CRESCENT

SINGAPORE 128462, Tel no. 6631 1188

ESTIMATE

Account Details	Account No.	Customer Details
Great American Insurance Company Temasek Avenue #16-01 Centennial Tower Singapore 039190	S1000027 / ICGAIC	M/S Grab Rentals Pte. Ltd
	Document No. 0	3 Media Close #01-03/06 Singapore 138498
	Document Date 23/10/2024	Work: 65703925

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2022	NHP170R	MWXNB H2	21/11/2022	SNH7045S	0	34095	67/TP/SNH7045S
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDZZ9H390L001131	1NZ9410610	60	Sam San Joi	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
13	4	U52151-52010 EXTENSION, RR BUMPER	1.00	262.80		262.80
14	5	K52161-0K040 PIECE, RR BUMPER	10.00	5.80		58.00
15	6	U58307-52670 PANEL SUB-ASSY, BODY	1.00	661.40		661.40
16	7	U67005-52E50 PANEL SUB-ASSY, BACK	1.00	1726.80		1726.80
17	8	U67881-52220 WEATHERSTRIP, BACK	1.00	515.40		515.40
18	9	U68105-52660 GLASS SUB-ASSY, BACK	1.00	1519.50		1519.50
19	0	U56117-64010 DAM, WINDOW GLASS	2.00	71.60		143.20
20	1	U69350-52401 LOCK ASSY, BACK DOOR	1.00	647.90		647.90
21	2	U75403-52010 EMBLEM SUB-ASSY,	1.00	93.30		93.30
22	3	U75441-52170 PLATE, BACK DOOR	1.00	72.10		72.10
23	4	T21000-20 SIKI 182010 SIKI TACK GO! (BLA	2.00	108.00		216.00
24	5	T21000-22 SIKI 207. G+P ADHESIVE PRIMER	1.00	200.00		200.00
25	6	SPC507-0D014 209 BACK SENSOR 209, BLACK MICA	1.00	172.40		172.40

For & on behalf of Borneo Motors (Singapore) Pte Ltd	Customer's Signature	Charge Summary	Total	16,101.40
	Please acknowledge receipt of vehicle	Parts 7,056.60 Labour 9,024.00 Sublet 20.80 Lubrication/Fluid 0.00 Others 0.00	GST 9.00%	1,449.13
			Less	0.00
			Amount Due	17,550.53

Company Copy

Toyota Sienta 1.5A Standard

\$128,800 Instalment \$1,260/mth

PREMIUM AD



 Shortlist

 Loan Calculator



Overview Financial Leasing Photo Research

Depreciation	 \$15,330 / year
Reg. Date	25-Aug-2022 (7yrs 9mths 25days COE left)
Manufactured	 2021
Mileage	39,000 km (17.9k / year)
Transmission	Auto
Engine Cap	1,496 cc
Road Tax	 \$682 / year
Power	79.0 kW (105 bhp) View specs of the Toyota Sienta (2015-2024)
Curb Weight	 1,325 kg
COE	 \$87,889
OMV	 \$17,748
ARF	 \$17,748
Dereg Value	 \$82,057 as of today
No. of Owners	 1

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	200G
Vehicle Details	
Vehicle No.:	SNH7045S
Vehicle to be Exported:	No
Intended Deregistration Date:	30 Oct 2024
Vehicle Make:	TOYOTA
Vehicle Model:	SIENTA HYBRID STANDARD (AUTO)
Primary Colour:	Black
Manufacturing Year:	2022
Engine No.:	1NZ9410610
Chassis No.:	JTDZZ9H390L001131
Maximum Power Output:	73.0 kW (97 bhp)
Open Market Value:	\$24,908.00
Original Registration Date:	21 Nov 2022
First Registration Date:	21 Nov 2022
Transfer Count:	0
Actual ARF Paid:	\$11,872.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	20 Nov 2032
PARF Rebate Amount:	\$8,904.00
Intended COE Rebate Details	
COE Expiry Date:	20 Nov 2032
COE Category:	A - Car-Details at OneMotoring
COE Period(Years):	10
QP Paid:	\$84,000.00
COE Rebate Amount:	\$67,689.00
Total Rebate Amount:	\$76,593.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 30 Oct 2024

OK