



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2501983

3 ANSON ROAD #16-00  
SPRINGLEAF TOWER  
SINGAPORE 079909

INV Date 02/04/2025  
Reference CD/CTI24110093/Apa3q2  
Code CTI

### PROFESSIONAL SERVICE FEE

Vehicle No. SLK 7602S  
Insured Veh. GBK 7843G  
Claim No. SNM24D206103  
Policy No. DMCVSNW00097622302  
Accident Date 29/10/2024  
Inspection Date 30/10/2024

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (9%)</b>                | <b>36.00</b>  |
| <b>Grand Total</b>             | <b>436.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

**LKM**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                              |                                                                                                                                        |                                                                                 |                               |            |
|------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|-------------------------------|------------|
| CHINA TAIPING INSURANCE (S) PTE LTD<br>3 ANSON ROAD #16-00<br>SPRINGLEAF TOWERSINGAPORE 079909 |                                                                                                                                        |                                                                                 | Ref: CD/CTI24110093/Apa3q2(N) |            |
|                                                                                                |                                                                                                                                        |                                                                                 | Date: 02/04/2025              |            |
|                                                                                                |                                                                                                                                        |                                                                                 | Code: CTI                     |            |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                              |                                                                                                                                        |                                                                                 |                               |            |
|                                                                                                | Insured Veh.                                                                                                                           | GBK 7843G                                                                       | Veh. Inspected                | SLK 7602S  |
|                                                                                                | Policy No.                                                                                                                             | DMCVSNW00097622302                                                              | Coverage (\$)                 | 0.00       |
|                                                                                                | Claim No.                                                                                                                              | SNM24D206103                                                                    | Excess (\$)                   | 0.00       |
|                                                                                                | Assign From                                                                                                                            |                                                                                 | Assign Date                   | 30/10/2024 |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                  |                                                                                                                                        |                                                                                 |                               |            |
|                                                                                                | Make & Model                                                                                                                           | TOYOTA AXIO                                                                     | c.c                           | 1496       |
|                                                                                                | Engine No.                                                                                                                             | HIDDEN                                                                          | Year of Reg.                  | 2017       |
|                                                                                                | Chassis No.                                                                                                                            | NZE1617122578                                                                   | Colour                        | RED        |
|                                                                                                | Odometer                                                                                                                               | 116004 KM                                                                       | Steering                      | IN ORDER   |
|                                                                                                | Brakes                                                                                                                                 | IN ORDER                                                                        | Modification                  | SPORTS RIM |
|                                                                                                | General                                                                                                                                | GOOD                                                                            |                               |            |
| <b>3. Conditions of Tyres</b>                                                                  |                                                                                                                                        |                                                                                 |                               |            |
|                                                                                                |                                                                                                                                        | Size                                                                            | Make                          | Balance    |
|                                                                                                | R/H Front Tyre                                                                                                                         | 185/65 R15                                                                      | WEST LAKE                     | 6 mm       |
|                                                                                                | L/H Front Tyre                                                                                                                         | 185/65 R15                                                                      | WEST LAKE                     | 6 mm       |
|                                                                                                | R/H Rear Tyre                                                                                                                          | 185/65 R15                                                                      | WEST LAKE                     | 6 mm       |
|                                                                                                | L/H Rear Tyre                                                                                                                          | 185/65 R15                                                                      | WEST LAKE                     | 6 mm       |
| <b>4. Description of Damages</b>                                                               |                                                                                                                                        |                                                                                 |                               |            |
|                                                                                                | THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION.<br><br>DAMAGES SEE DETAILS.                                                     |                                                                                 |                               |            |
| <b>5. General Information</b>                                                                  |                                                                                                                                        |                                                                                 |                               |            |
|                                                                                                | Accident Date                                                                                                                          | 29/10/2024                                                                      | Inspection Date               | 30/10/2024 |
|                                                                                                | Survey held at                                                                                                                         | YSK AUTO WORKSHOP<br>1 KAKI BUKIT AVE 6<br>@ AUTOBAY #01-71<br>SINGAPORE 417883 |                               |            |
| <b>5a. Remarks</b>                                                                             |                                                                                                                                        |                                                                                 |                               |            |
|                                                                                                | A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                 |                               |            |
| <b>5b. Estimate Days of Repair</b>                                                             |                                                                                                                                        |                                                                                 |                               |            |
|                                                                                                | ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                 | 9 Working Days                |            |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLK 7602S

| Qty | Description of Parts               | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------|----------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b> |                      |                           |                   |
| 1   | REAR BUMPER                        | DISTORTED            | 598.50                    | 598.50            |
| 1   | REAR BUMPER SIDE HOLDER            | CRACKED              | 96.30                     | 96.30             |
| 1   | REAR BUMPER REFLECTOR              | CRACKED              | 59.50                     | 59.50             |
| 1   | REAR END PANEL                     | DENTED               | 662.30                    | 662.30            |
| 1   | REAR EN PANEL TOP GARNISH          | DEFORMED             | 240.80                    | 240.80            |
| 1   | REAR END PANEL TRIANGULAR BRACKET  | NOT NECESSARY        | 82.40                     | -                 |
| 2   | TAILLAMP @\$548.10                 | CRACKED              | 1,096.20                  | 1,096.20          |
| 1   | TAILLAMP PANEL                     | DENTED               | 184.50                    | 184.50            |
| 2   | TAILLAMP LOWER BRACKET @\$45.20    | O/S CRACKED          | 90.40                     | 45.20             |
| 1   | BOOTLID                            | DENTED               | 845.50                    | 845.50            |
| 1   | BOOTLID LOCK                       | DAMAGED              | 180.90                    | 180.90            |
| 1   | BOOTLID LOCK STRIKER               | NOT NECESSARY        | 45.20                     | -                 |
| 1   | BOOTLID WEATHERSTRIP               | CUT                  | 263.70                    | 263.70            |
| 2   | BOOTLID HINGE @\$112.50            | BENT                 | 225.00                    | 225.00            |
| 1   | BOOTLID OUTER CHROME MOULDING      | CRACKED              | 301.40                    | 301.40            |
| 1   | TOYOTA LOGO                        | NECESSARY            | 60.80                     | 60.80             |
| 1   | COROLLA WORDING                    | NECESSARY            | 59.40                     | 59.40             |
| 1   | AXIO WORDING                       | NECESSARY            | 58.10                     | 58.10             |
| 1   | REAR FENDER                        | BUCKLED              | 989.20                    | 989.20            |
| 1   | REAR FENDER INNER TRIM BOARD       | CRUMPLED             | 346.60                    | 346.60            |
| 1   | REAR FENDER INNER SHIELD           | NOT NECESSARY        | 125.40                    | -                 |
| 1   | REAR FENDER AIR VENT               | NOT NECESSARY        | 49.40                     | -                 |
| 1   | REAR WINDSCREEN GLASS              | SHATTERED            | 1,310.40                  | 1,310.40          |
| 1   | REAR WINDSCREEN GLASS MOULDING     | NECESSARY            | 145.50                    | 145.50            |
| 1   | REAR DOOR                          | TO REPAIR SEE LABOUR | 993.90                    | -                 |
| 1   | REAR DOOR LOCK                     | NOT NECESSARY        | 478.70                    | -                 |
| 1   | REAR DOOR WEATHERSTRIPE            | NOT NECESSARY        | 289.60                    | -                 |
| 1   | SPARE TYRE TOP COVER               | NOT NECESSARY        | 436.90                    | -                 |
| 1   | REAR EXHAUST PIPE                  | NOT NECESSARY        | 715.90                    | -                 |
| 1   | REAR EXHAUST PIPE MOUNTING         | NOT NECESSARY        | 38.60                     | -                 |

Report Ref No. CD/CTI24110093/Apa3q2(N)



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

| Qty                | Description of Parts                                                         | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|--------------------|------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
| 1                  | REAR EXHAUST PIPE GASKET                                                     | NOT NECESSARY | 32.30                     | -                 |
|                    | LESS 20% DISCOUNT                                                            |               | -2,775.83                 | -1,942.45         |
|                    |                                                                              |               | 8,327.47                  | 5,827.35          |
|                    | <b><u>SPECIAL NETT ITEMS</u></b>                                             |               |                           |                   |
| 1                  | SET REAR BUMPER CLIPS (SN)                                                   | NECESSARY     | 30.00                     | 30.00             |
| 1                  | SET REAR END PANEL TOP GARNISH CLIPS (SN)                                    | NECESSARY     | 20.00                     | 20.00             |
| 1                  | SET REAR END PANEL SEALANT (SN)                                              | NECESSARY     | 60.00                     | 60.00             |
| 1                  | SET REVERSE SENSOR (SN)                                                      | DAMAGED       | 280.00                    | 200.00            |
| 1                  | REAR CAMERA (SN)                                                             | NOT NECESSARY | 480.00                    | -                 |
| 1                  | BOOTLID TOP SPOILER (SN)                                                     | CRACKED       | 1,200.00                  | 900.00            |
| 1                  | SET BOOTLID OUTER CHROME MOULDING CLIPS (SN)                                 | NECESSARY     | 20.00                     | 20.00             |
| 1                  | SET REAR FENDER INNER TRIM COVER CLIPS (SN)                                  | NECESSARY     | 30.00                     | 30.00             |
| 1                  | SET REAR FENDER INNER SHIELD CLIPS (SN)                                      | NOT NECESSARY | 20.00                     | -                 |
| 1                  | REAR FENDER SEALANT (SN)                                                     | NECESSARY     | 60.00                     | 60.00             |
| 1                  | REAR WINDSCREEN SEALANT (SN)                                                 | NECESSARY     | 60.00                     | 60.00             |
| 1                  | REAR WINDSCREEN SOLAR FILM (SN)                                              | NECESSARY     | 280.00                    | 200.00            |
| 1                  | REAR DOOR BLACK TAPE (SN)                                                    | NOT NECESSARY | 60.00                     | -                 |
|                    |                                                                              |               | 2,600.00                  | 1,580.00          |
|                    | <b><u>LABOUR</u></b>                                                         |               |                           |                   |
|                    | PANEL BEATING ,REMOVE AND REFIT PARTS.INCLUSIVE OF THE REPAIR OF REAR DOOR . |               | 1,800.00                  | 1,200.00          |
|                    | SPRAY PAINTING TO AFFECTED AREA.                                             |               | 1,800.00                  | 1,100.00          |
|                    | WIRING CHECK.                                                                |               | 50.00                     | 30.00             |
|                    | TI APPLY TUFF COAT.                                                          |               | 150.00                    | 80.00             |
|                    | TO REMOVE REVERSE SENSOR .                                                   |               | 100.00                    | 50.00             |
|                    | TO REMOVE REAR CAMERA.                                                       |               | 100.00                    | 50.00             |
|                    | TO REMOVE UPHOLSTERY .                                                       |               | 150.00                    | 60.00             |
|                    | TO TRANSFER BOOTLID FITTINGS.                                                |               | 150.00                    | 60.00             |
|                    | TO TRANSFER REAR DOOR FITTINGS.                                              | NOT NECESSARY | 150.00                    | -                 |
|                    | TO REMOVE EXHAUST PIPE .                                                     | NOT NECESSARY | 150.00                    | -                 |
|                    |                                                                              |               | 4,600.00                  | 2,630.00          |
| <b>GRAND TOTAL</b> |                                                                              |               | <b>15,527.47</b>          | <b>10,037.35</b>  |

Report Ref No. CD/CTI24110093/Apa3q2(N)



|                                                                         |  |  |          |
|-------------------------------------------------------------------------|--|--|----------|
| RECOMMENDED COST OF LUMP SUM REPAIRS<br>(TO ITS PRE-ACCIDENT CONDITION) |  |  | 8,000.00 |
|-------------------------------------------------------------------------|--|--|----------|

Report Ref No. CD/CTI24110093/Apa3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser


DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

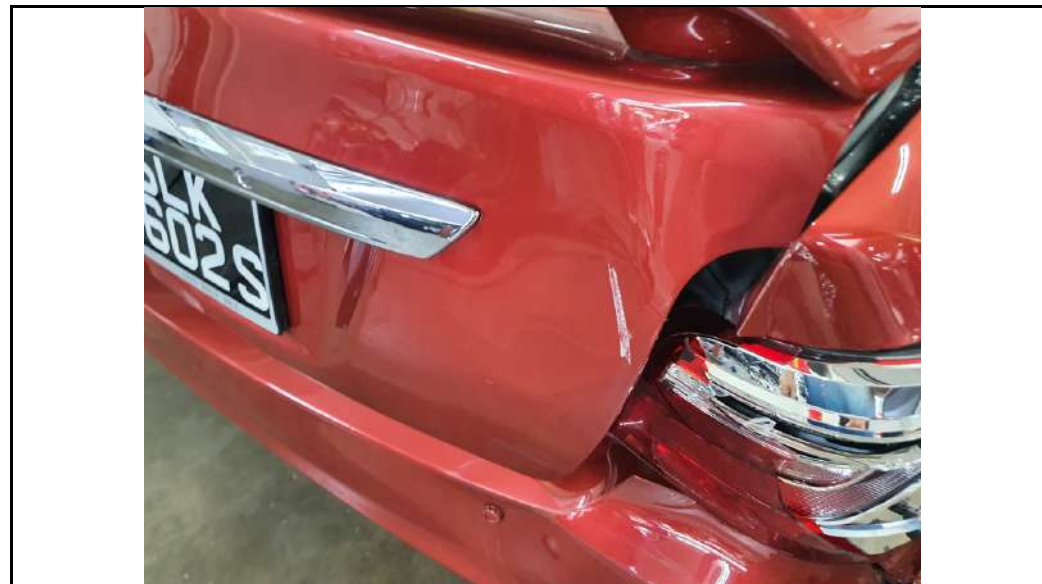




**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

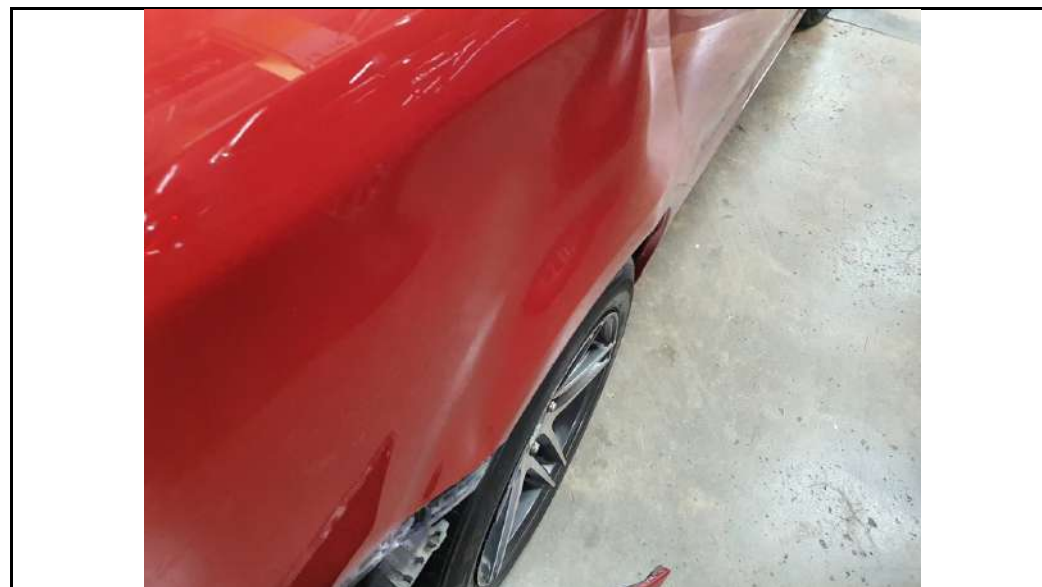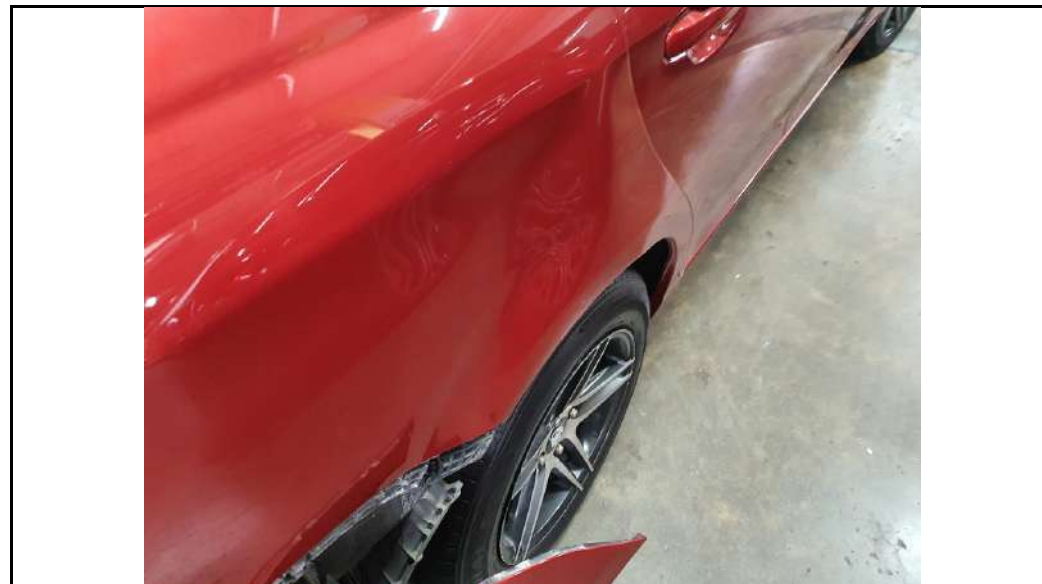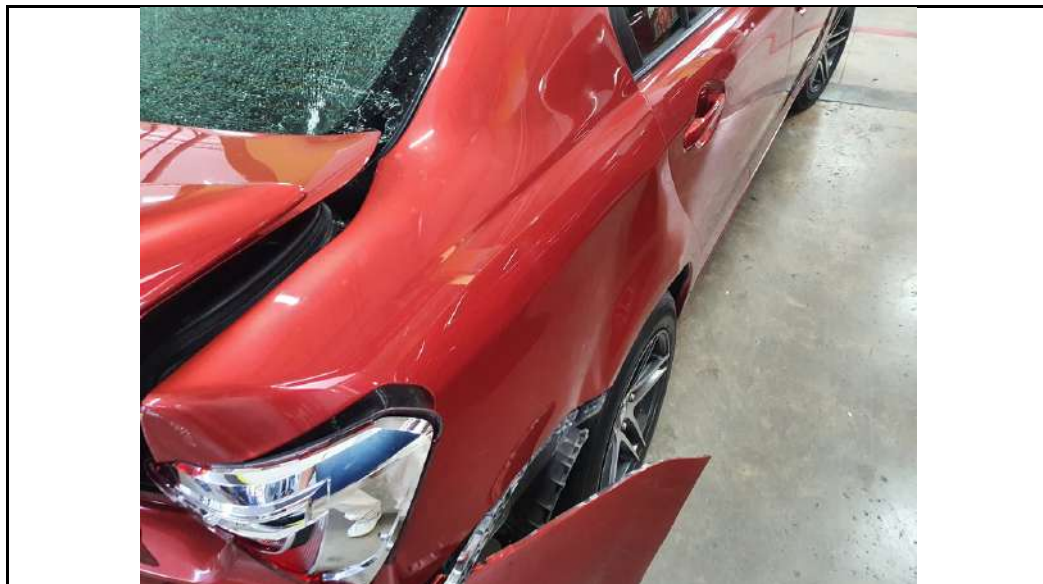


**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**




**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**




**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

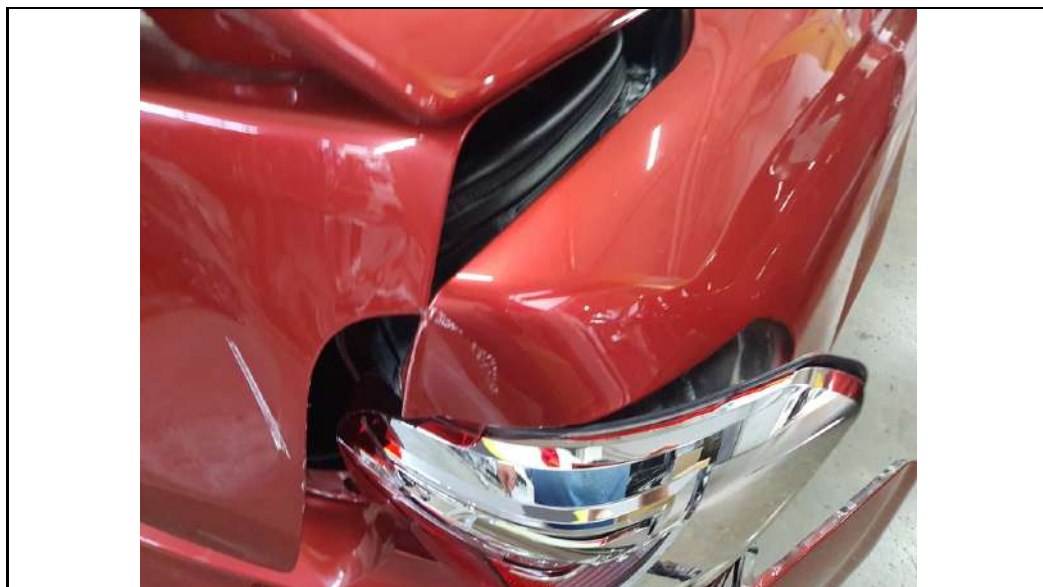

**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

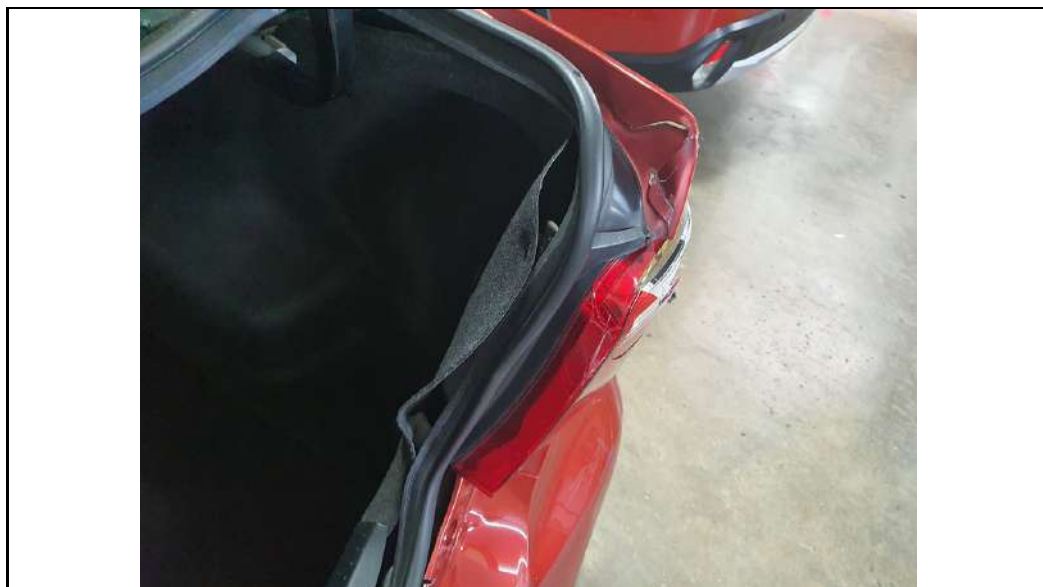



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

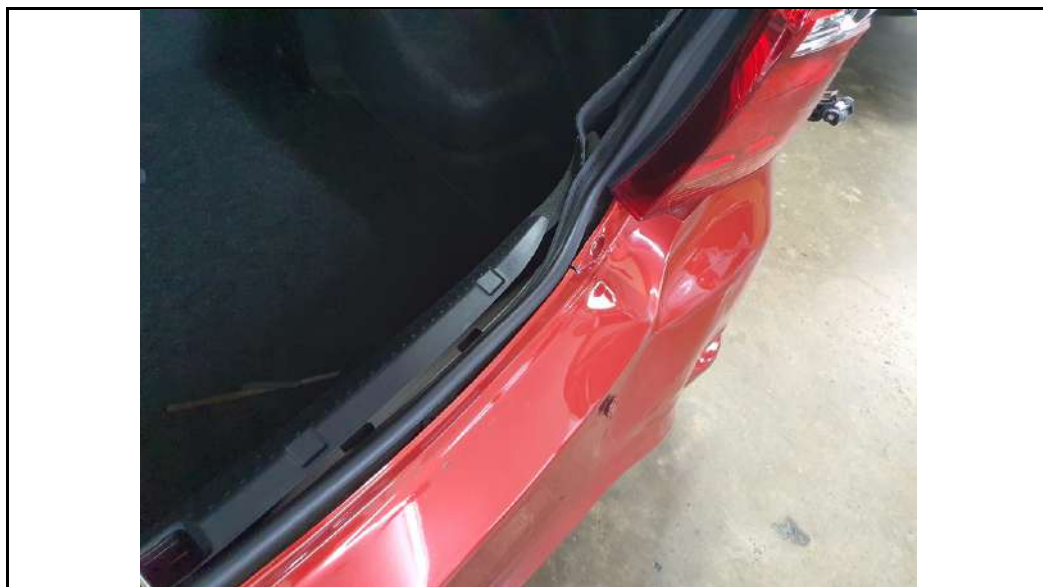


**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**





**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

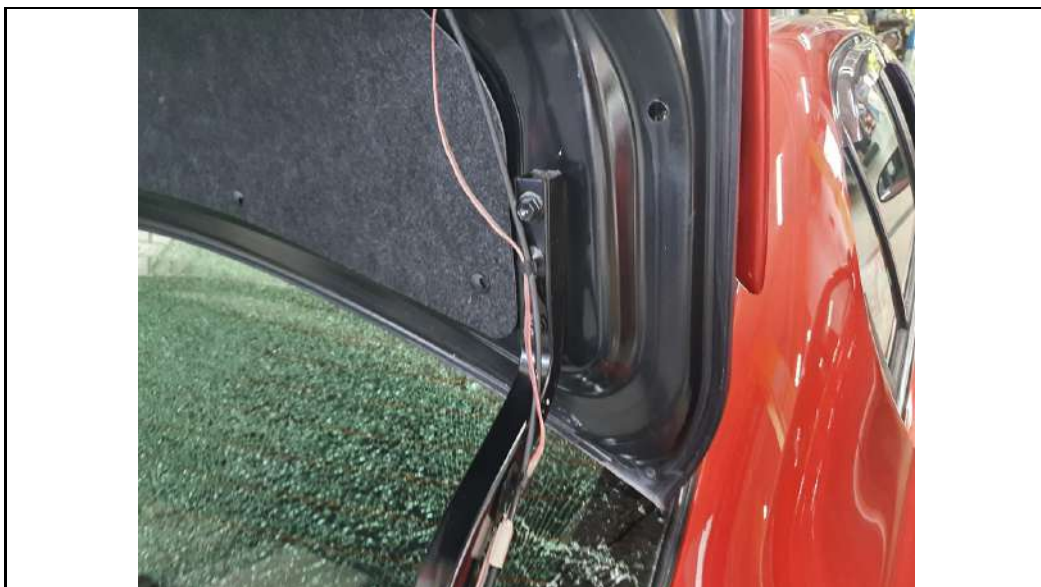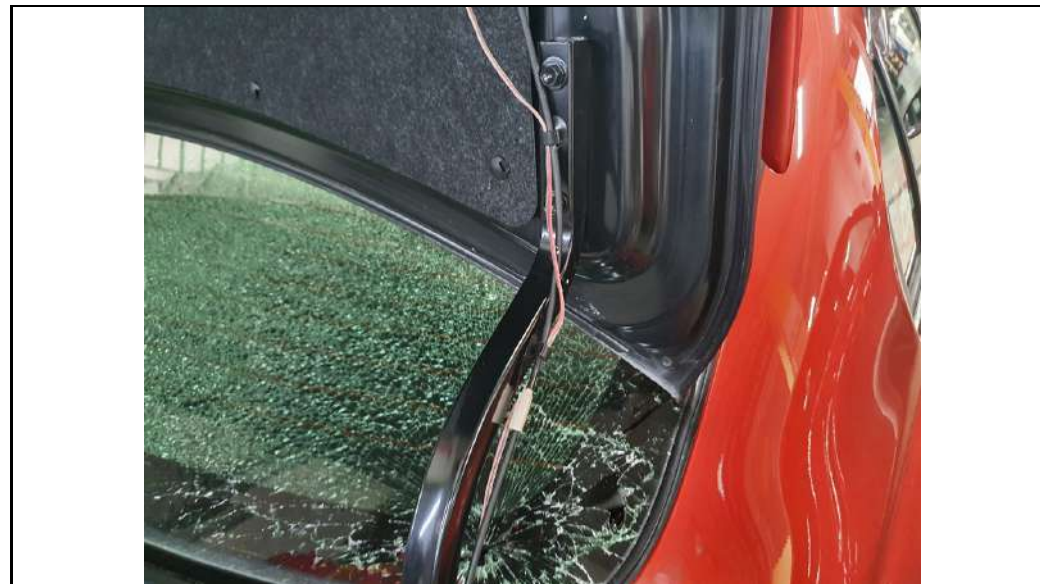


**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

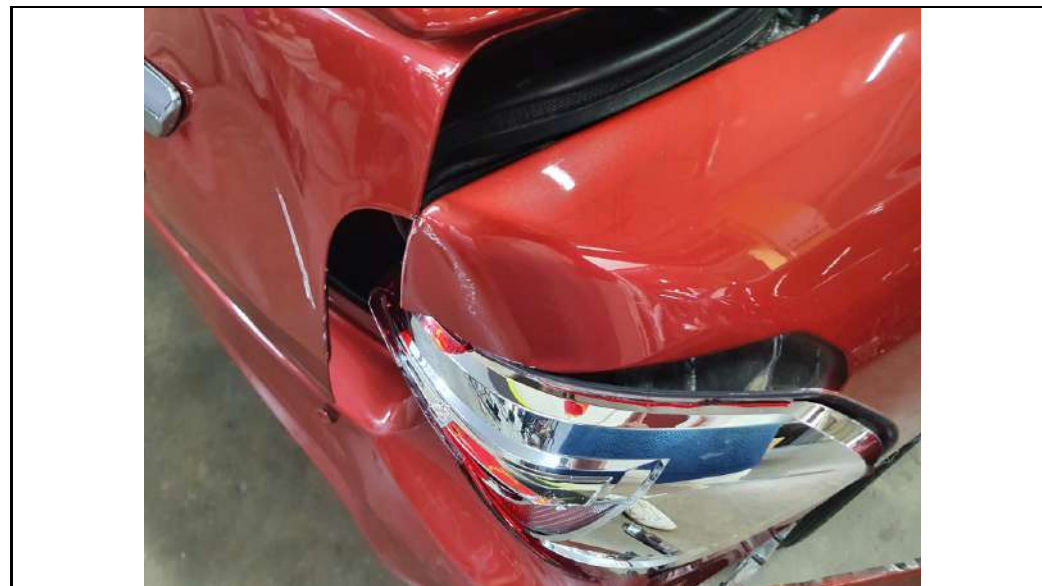


**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

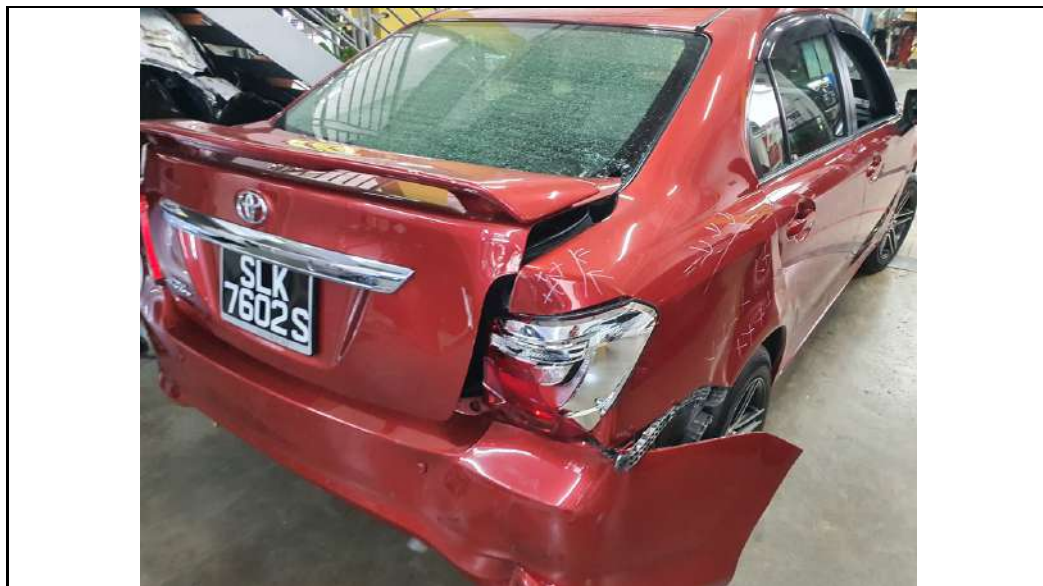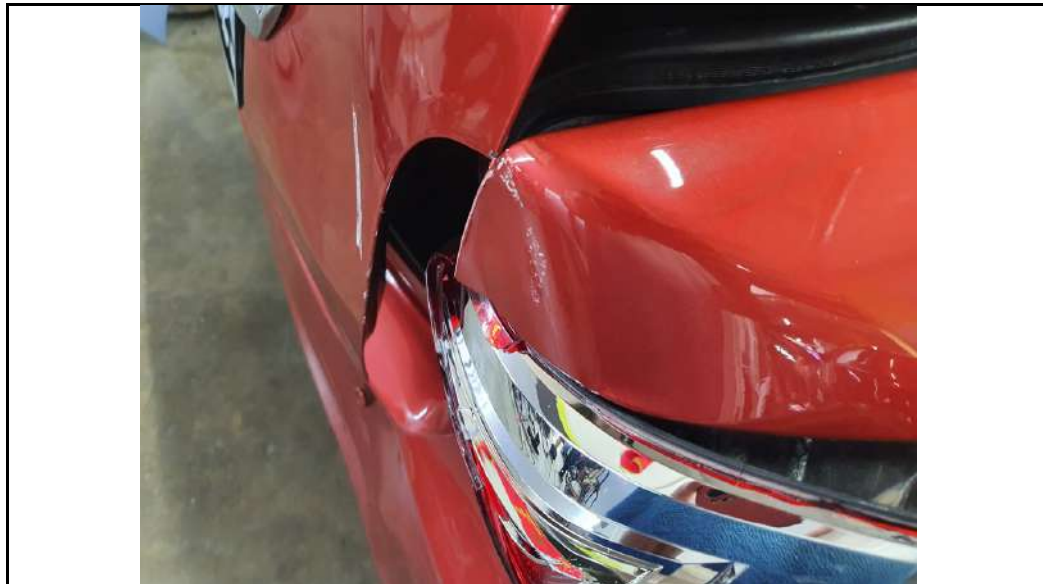

**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

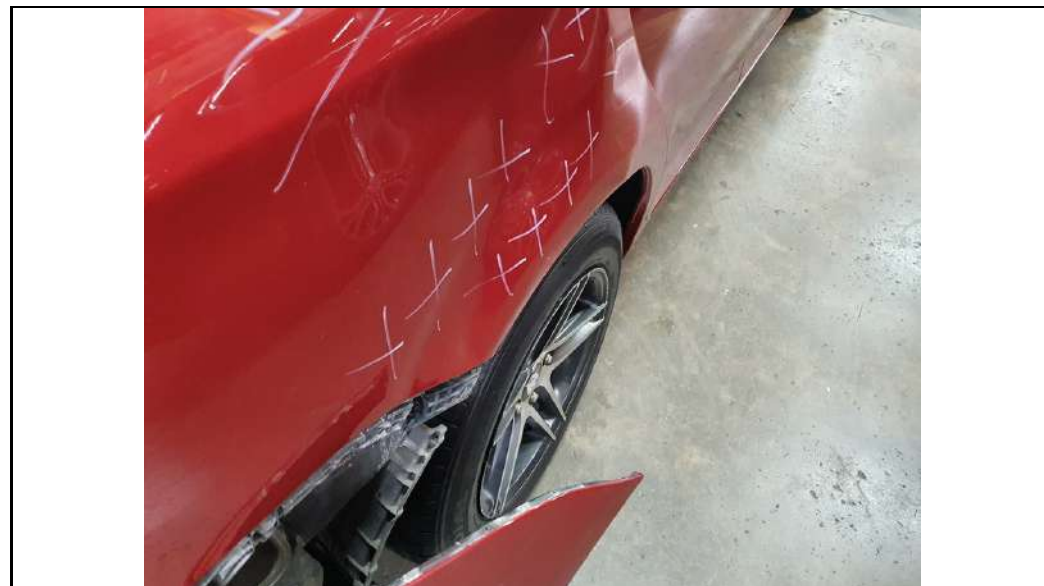

**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

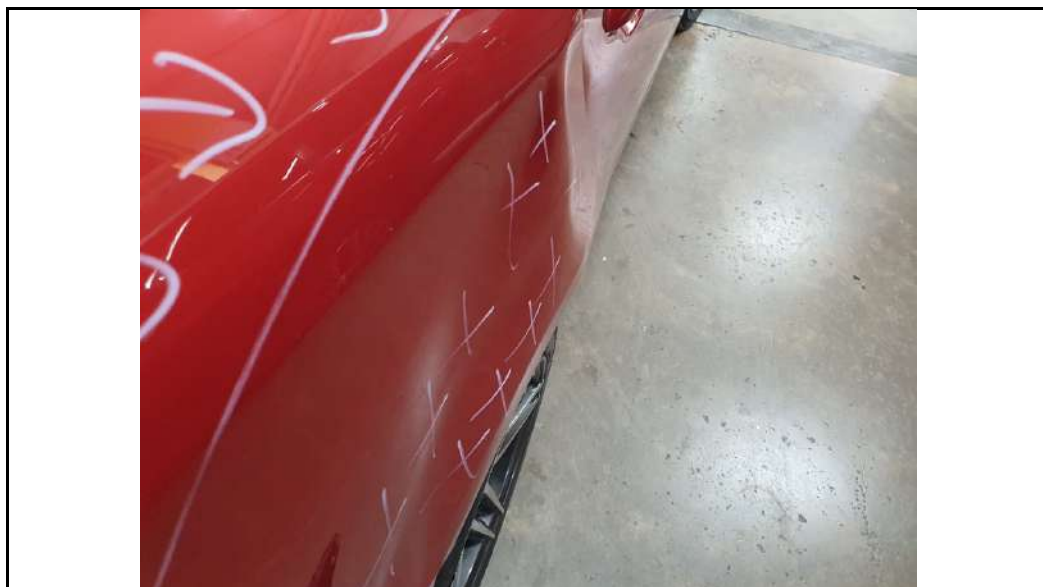

**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**




**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**

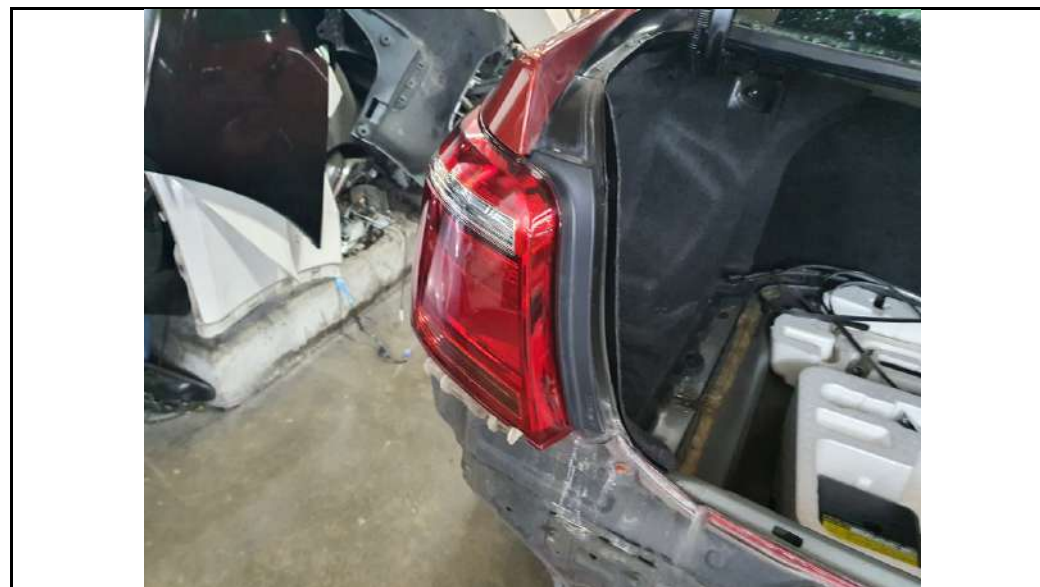

**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**



**PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S**







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

**REINSPECTION PHOTOS (Page 10 of 14)**

---

### PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S









## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

REINSPECTION PHOTOS (Page 11 of 14)

---

### PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

**REINSPECTION PHOTOS (Page 12 of 14)**

---

### PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S









## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

**REINSPECTION PHOTOS (Page 13 of 14)**

---

### PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315




Reg. No: 199607198R GST Reg. No.

19-9607198-R

**REINSPECTION PHOTOS (Page 14 of 14)**

---

### PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

### PHOTOGRAPHS FOR VEHICLE NO. : SLK 7602S

