



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2500402

INV Date 16/01/2025

Reference CD/LPC24110128/Uma3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBH 2989T
Insured Veh. YN 3943P
Claim No. 24/24/24/VC05/030128
Policy No. Z24VC05022610
Accident Date 04/11/2024
Inspection Date 08/11/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS LONPAC INSURANCE BHD	Ref:	CD/LPC24110128/Uma3q2
300 BEACH ROAD	Date:	16/01/2025
#17-04/07 THE CONCOURSE SINGAPORE 199555	Code:	LPC2

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	YN 3943P	Veh. Inspected	GBH 2989T
Policy No.	Z24VC05022610	Coverage	0
Claim No.	24/24/24/VC05/030128	Excess	\$0.00
Assign From	-	Assign Date	07/11/2024

2. Vehicle Details

Make & Model	ISUZU NHR87AUE4AA MT	C.C	1898
Engine No.	RZ4E10D220	Year of Reg.	13/04/2018
Chassis No.	JAANHR87EJ7100043	Colour	WHITE
Odometer	148142 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: NIL		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	185/75R15	KENDA	6
L/H Front Tyre	185/75R15	KENDA	6
R/H Rear Tyre	155R13 (D)	GREEN-MAX	6/6
L/H Rear Tyre	155R13 (D)	GREEN-MAX	6/6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	04/11/2024	Inspection Date	08/11/2024
Survey held at	SPEEDWERKZ PTE LTD 1 KAKI BUKIT AVENUE 6 #01-73, AUTOBAY@KAKI BUKIT, SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 5 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO GBH 2989T

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	FRONT WINDSCREEN RUBBER	NECESSARY	\$231.00	\$231.00
2	FRONT HEADLAMPS L/R	NOT NECESSARY	\$986.00	\$0.00
2	FRONT HEADLAMPS LOWER SEAL L/R	NOT NECESSARY	\$64.20	\$0.00
2	FRONT SIDE LAMP L/R	NOT NECESSARY	\$342.00	\$0.00
1	FRONT PANEL	DENTED / BENT	\$655.00	\$655.00
1	FRONT PANEL LOGO	NECESSARY	\$156.00	\$148.00
1	FRONT PANEL NH STICKER (KIV)	NECESSARY	\$54.00	\$0.00
2	FRONT CORNER PANEL L/R	NOT NECESSARY	\$658.00	\$0.00
1	FRONT MIRROR STAY LH	NOT NECESSARY	\$296.00	\$0.00
1	FRONT MIRROR ROUND LH	NOT NECESSARY	\$91.00	\$0.00
1	FRONT MIRROR STAY RH	NOT NECESSARY	\$285.00	\$0.00
1	FRONT MIRROR RH	NOT NECESSARY	\$168.00	\$0.00
1	FRONT GRILLE	CRACKED	\$612.00	\$612.00
1	FRONT BUMPER	NOT NECESSARY	\$574.00	\$0.00
2	FRONT BUMPER BRACKET L/R	NOT NECESSARY	\$330.00	\$0.00
2	FRONT BUMPER FOG LAMP COVER L/R	NOT NECESSARY	\$142.00	\$0.00
1	AIRCON BLOWER ASSY	NOT NECESSARY	\$457.00	\$0.00
1	HEATER UNIT	NOT NECESSARY	\$1,981.00	\$0.00
	LESS 15.00% DISCOUNT		(\$1,212.33)	(\$246.90)
			\$6,869.87	\$1,399.10
Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	FRONT PANEL SEALANT (SN)	NOT NECESSARY	\$80.00	\$0.00
1	FRONT PANEL COMPANY STICKER (SN) (KIV)	NECESSARY	\$400.00	\$0.00
1	FRONT GRILLE CLIPS (SN)	NOT NECESSARY	\$40.00	\$0.00
1	FRONT NUMBER PLATE (SN)	NOT NECESSARY	\$700.00	\$0.00
			\$1,220.00	\$0.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO REMOVE & REFIT FRONT WINDSCREEN		\$150.00	\$100.00
	TO CHECK FRONT WIRING & HEADLAMP LEVELING		\$60.00	\$20.00
	TO REMOVE & REFIT DASHBOARD ASSY TO FACILITATE REPAIR		\$350.00	\$200.00
	TO REPLACE AIRCON BLOWER AND HEATER UNIT ,RECHARGE A/C GAS		\$180.00	\$100.00
	TO PROVIDE LABOUR WORKMANSHIP		\$1,400.00	\$600.00
	TO SPRAY PAINT ON AFFECTED PANELS		\$1,000.00	\$320.00
	RUST PROOFING		\$200.00	\$30.00
			\$3,340.00	\$1,370.00
GRAND TOTAL			\$11,429.87	\$2,769.10
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$2,200.00
Report Ref No: CD/LPC24110128/Uma3q2				

CKS

MARCUS CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 1 of 8)

PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T



PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T



PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T



PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T




PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T



PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T



PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T

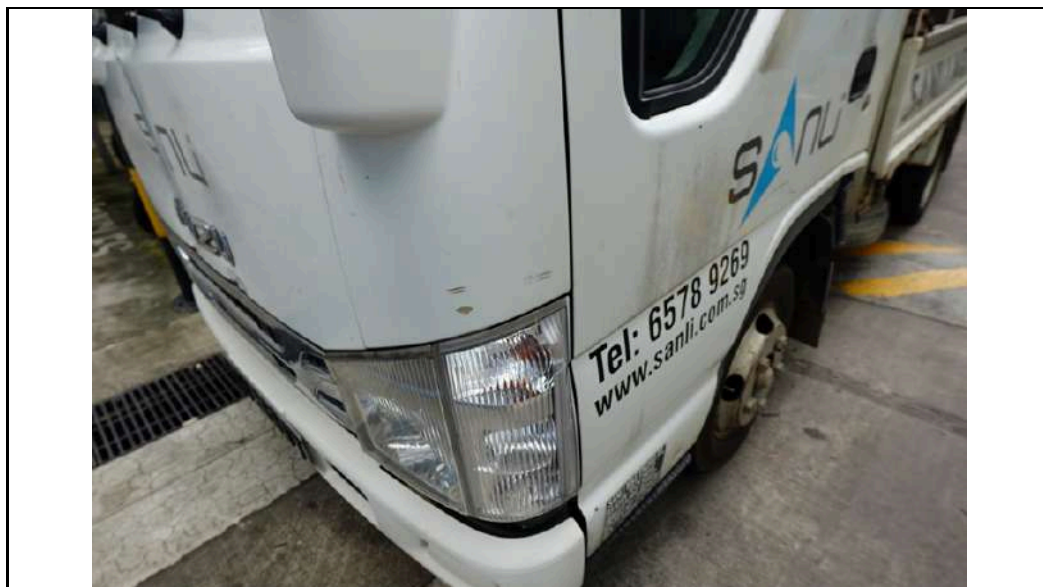

PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T



PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : GBH 2989T

