



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2500121

16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING
SINGAPORE 048581
ATTN:KAREN TAN

INV Date 07/01/2025
Reference CD/FCI24110132/Uma3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMY 2225U
Insured Veh. SHA 6126G
Claim No. D24009581MFCT/CTPL/TPD 2
Policy No. D-24101861MFCT
Accident Date 28/10/2024
Inspection Date 14/11/2024

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (9%)	31.50
Grand Total	381.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS MS FIRST CAPITAL INSURANCE LTD	Ref:	CD/FCI24110132/Uma3q2
16 RAFFLES QUAY	Date:	07/01/2025
#42-01 HONG LEONG BUILDING	Code:	FCI2
SINGAPORE 048581		

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	SHA 6126G	Veh. Inspected	SMY 2225U
Policy No.	D-24101861MFCT	Coverage	0
Claim No.	D24009581MFCT/CTPL/TPD 2	Excess	\$0.00
Assign From	KAREN TAN	Assign Date	07/11/2024

2. Vehicle Details

Make & Model	MERCEDES BENZ E200 AVG (R18 LED)	C.C	1991
Engine No.	27492030723104	Year of Reg.	24/01/2017
Chassis No.	WDD2130422A043754	Colour	GREEN
Odometer	158054 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: SPORTS RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	245/45R18	PIRELLI	6
L/H Front Tyre	245/45R18	PIRELLI	6
R/H Rear Tyre	245/45R18	PIRELLI	6
L/H Rear Tyre	245/45R18	PIRELLI	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	28/10/2024	Inspection Date	14/11/2024
Survey held at	FALCON-AIR AUTO SERVICES PTE LTD BLK 9006 TAMPINES ST 93 #01-200 SINGAPORE 528840		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 3 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SMY 2225U

Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	BOOT COVER LOGO (N)	NOT NECESSARY	\$90.00	\$0.00
1	BOOT COVER EMBLEM -E200 (N)	NOT NECESSARY	\$183.00	\$0.00
1	BOOT COVER EMBLEM -9G-TRONIC (N)	NOT NECESSARY	\$210.00	\$0.00
1	REAR BUMPER (N)	DEFORMED / TORN	\$2,430.00	\$2,332.84
2	REAR BUMPER SIDE RETAINER @\$214.00 (N)	CRACKED	\$428.00	\$230.00
4	REAR BUMPER SENSOR @\$283.00 (N)	SERVICEABLE	\$1,132.00	\$0.00
4	REAR BUMPER SENSOR ORING @\$25.00 (N)	NOT NECESSARY	\$100.00	\$0.00
2	REAR BUMPER SENSOR BRACKET @\$45.00 (N)	NECESSARY	\$90.00	\$90.00
1	REAR BUMPER LOWER (N)	GRAZED	\$623.00	\$481.23
1	REAR BUMPER LOWER CHROME MOULDING (N)	DAMAGED	\$496.00	\$300.50
1	REAR BUMPER REINFORCEMENT (N)	BENT	\$1,328.00	\$1,179.24
	LESS 10.00%		(\$711.00)	(\$461.38)
			\$6,399.00	\$4,152.43

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	BOOT COVER EMBLEM -CYCLE AND CARRIAGE (SN)	NOT NECESSARY	\$250.00	\$0.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	\$40.00	\$40.00
1	SET REAR BUMPER RIVET (SN)	NECESSARY	\$60.00	\$40.00
			\$350.00	\$80.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CHECK REAR PORTION WIRING		\$50.00	\$20.00
	TO FIT REVERSE SENSOR IN BUMPER		\$50.00	\$30.00
	TO RESET CLEARANCE SONAR USING DIAGNOSTIC SCANNER	NOT NECESSARY	\$350.00	\$0.00
	TO RUSTPROOF ON DAMAGED PARTS	NOT NECESSARY	\$250.00	\$0.00
	TO APPLY BODY SEALANT ON BODY JOINTS	NOT NECESSARY	\$250.00	\$0.00
	TO REPAIR INNER PANEL ACCIDENT DAMAGE AREA REPLACEMENT OF PARTS AND ALIGN THE SAME		\$800.00	\$320.00
	TO PUTTY AND SPRAY PAINT ON ACCIDENT DAMAGE AREA		\$800.00	\$400.00
			\$2,550.00	\$770.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

GRAND TOTAL		\$9,299.00	\$5,002.43
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)		\$4,000.00
Report Ref No: CD/FCI24110132/Uma3q2			

CKS


MARCUS CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U

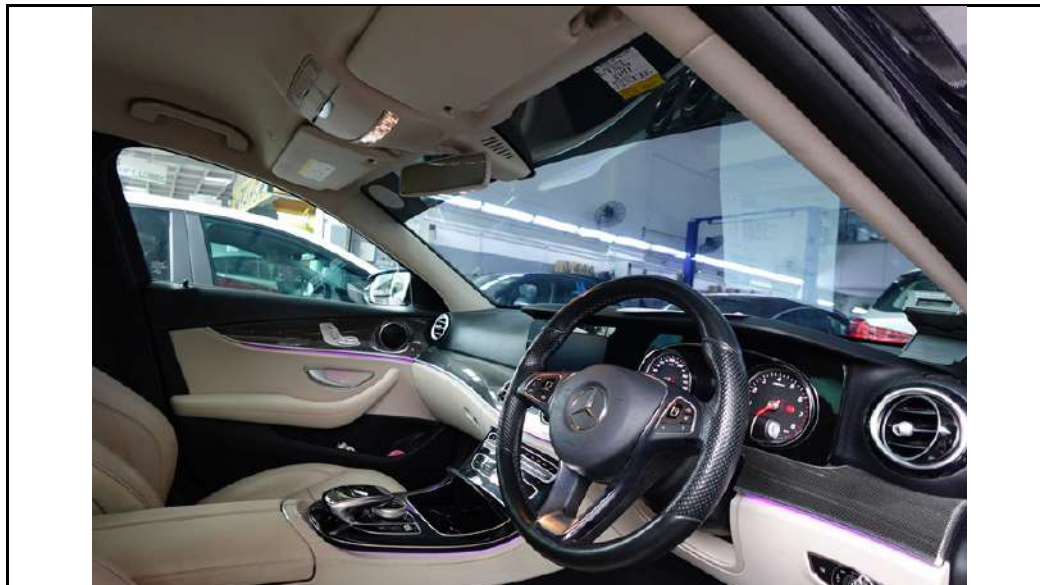

PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U



PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SMY 2225U

