

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

STRIDES PREMIER AUTOMOTIVE SERVICES PL.
60 WOODLANDS INDUSTRIAL PARK E4
SINGAPORE 757705

INV No. : SAC2401874

INV Date : 16-12-2024

Reference CS/SMR24110195/Tnp3m4

Code SMR

PROFESSIONAL SERVICE FEE

Vehicle No. GBH 6572K
Insured Veh. SHB 990L
Claim No. TAX/11/24/2006
Policy No.
Accident Date 02/11/2024
Inspection Date 19/11/2024

Description	Amount
Survey Inspection	128.00
Resurvey Inspection	0.00
Digital Photographs	0.00
Transportation	0.00
Sub-Total	128.00
GST (9%)	11.52
Grand Total	139.52

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

SML



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS STRIDES PREMIER AUTOMOTIVE SERVICES PL.	Ref:	CS/SMR24110195/Tnp3m4
60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705	Date:	16/12/2024
	Code:	SMR

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 990L	Veh. Inspected	GBH 6572K
Policy No.	-	Coverage	0
Claim No.	TAX/11/24/2006	Excess	\$0.00
Assign From	HUA YEN	Assign Date	11/11/2024

2. Vehicle Details

Make & Model	TOYOTA HIACE	C.C	2754
Engine No.	1GD8253512	Year of Reg.	03/08/2018
Chassis No.	GDH2012000313	Colour	WHITE
Odometer	105225 KM	Steering	IN ORDER
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: NIL		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	195/R15	BRIDGESTONE	6
L/H Front Tyre	195/R15	BRIDGESTONE	6
R/H Rear Tyre	195/R15	BRIDGESTONE	6
L/H Rear Tyre	195/R15	BRIDGESTONE	6

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	02/11/2024	Inspection Date	19/11/2024
Survey held at	REGNANT AUTOMOTIVE PTE LTD - 53 UBI AVENUE 1, #01-09, PAYA UBI INDUSTRIAL PARK, SINGAPORE 408934		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 5 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO GBH 6572K

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REAR TAILGATE	BENT	\$3,728.00	\$1,950.00
1	REAR TAILGATE EMBLEM "TOYOTA"	NECESSARY	\$117.10	\$63.00
1	REAR TAILGATE CENTRE GARNISH	NOT NECESSARY	\$215.60	\$0.00
1	REAR TAILGATE LOCK	BENT	\$345.20	\$264.00
1	REAR TAILGATE LOCK COVER	CUT	\$158.90	\$58.10
1	REAR TAILGATE LOCK STRIKER	NOT NECESSARY	\$124.20	\$0.00
1	REAR TAILGATE INNER TRIM BOARD	NOT NECESSARY	\$585.40	\$0.00
1	TAILGATE WEATHERSTRIP	CUT	\$404.30	\$391.00
2	REAR TAILLAMP RH/LH	NOT NECESSARY	\$1,132.00	\$0.00
2	REAR TAILLAMP LOWER CORNER PANEL RH/LH	TO REPAIR SEE LABOUR	\$419.00	\$0.00
1	REAR BUMPER	DEFORMED	\$794.00	\$673.00
4	REAR BUMPER LOWER BRACKETS	BENT	\$263.60	\$263.60
1	REAR BUMPER INNER STEP PANEL	BENT	\$422.50	\$245.50
2	REAR BUMPER SIDE RETAINER RH/LH	NOT NECESSARY	\$136.80	\$0.00
1	REAR END PANEL INNER TOP CHROME GARNISH	BENT	\$289.00	\$185.60
1	REAR END PANEL OUTER	BENT	\$540.00	\$540.00
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	\$621.20	\$0.00
1	REAR SIDE PANEL RH/LH	NOT NECESSARY	\$710.60	\$0.00
1	REAR SPARE TYRE BRACKET	NOT NECESSARY	\$621.80	\$0.00
	LESS 25.00% DISCOUNT		(\$2,907.30)	(\$1,158.45)
			\$8,721.90	\$3,475.35

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	SET REAR BUMPER CLIP (SN)	NECESSARY	\$80.00	\$30.00
1	REAR TAILGATE STICKER "70KM/H" (SN)	NECESSARY	\$50.00	\$30.00
1	REAR TAILGATE STICKER "HIACE" (SN)	NECESSARY	\$50.00	\$40.00
1	REVERSE CAMERA (SN)	NOT NECESSARY	\$350.00	\$0.00
1	SET REVERSE SENSOR (SN)	NOT WORKING	\$200.00	\$200.00
1	REAR CAR PLATE NUMBER WITH BRACKET (SN)	NOT NECESSARY	\$80.00	\$0.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	SET REAR TAILGATE INNER TRIM BOARD CLIP (SN)	NECESSARY	\$80.00	\$20.00
			\$890.00	\$320.00
Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	CHECK REAR WIRING AND LIGHTING SYSTEM	NOT NECESSARY	\$150.00	\$30.00
	REMOVE, REFIT LINING, TRIM AND GARNISH		\$100.00	\$60.00
	DIAGNOSIS CHECK AND CLEAR FAULT CODE		\$100.00	\$0.00
	REMOVE AND RENEW REAR REVERSE SENSOR		\$120.00	\$40.00
	TRANSFER PARTS, ATTACHMENT FROM OLD PART TO NEW		\$200.00	\$60.00
	PANEL BEATING ON AFFECTED AREAS AND RENEW PART. INCLUSIVE OF THE REPAIR OF REAR TAILLAMP LOWER CORNER PANEL RH/LH AND REAR END PANEL INNER		\$800.00	\$700.00
	SPRAY PAINTING ON AFFECTED AREAS		\$800.00	\$700.00
			\$2,270.00	\$1,590.00
GRAND TOTAL			\$11,881.90	\$5,385.35
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$4,300.00
Report Ref No: CS/SMR24110195/Tnp3m4				

MTH

MOHAMAD TAUFIKH

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	04/11/2024 09:24 (SGT)
Reported by	Actual Driver
Date of Accident	02/11/2024 12:00 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	CTE/ SLE (TPE) EXPRESS WAY (WOODLANDS TOWARDS SEMBAWANG)
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBH6572K
-----------------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	MINI TOONS PTE LTD
Company Reg No	.757Z
Email Address	
Mobile Phone No	
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Hiace
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	0
Vehicle Fuel	Diesel
First Registration Date	03/08/2018
Chassis no	GDH2012000313
Effective Date/Time of Ownership	03/08/2018 00:00 (SGT)

INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5110734850-05

DRIVER

Name of Driver	GAN HUAN BIN
NRIC No	-
Date Of Birth	-
Occupation	Outdoor
Driving Pass Date	02/08/2023
Driving License Pass Class	3
Driving License Validity	Valid
Driving experience	1 YEAR AND 3 MONTHS
Gender	Male
Mobile Number	-
Alt. Phone Number	-
Email Address	-
Address	-
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHED

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHB990L
-----------------------------------	---------

Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

Describe Circumstance of the Accident

At 02 November 2024 about around 12 pm,
 I was driving along at CTE then the in front
 vehicle suddenly jam brake. After that @ my vehicle
 A (GBH6572K) also jam brake and able stop in time.
 But the vehicle B (SHB990L) ~~was~~ unable stop in time.
 As the result is the vehicle B (SHB990L) hit to the
 my vehicle A (GBH6572K) rear position.

Declaration

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder)
 / Date & Time

LOH

Witnessed by Reporting Centre Personnel
 (Name as in NRIC/ID card)

PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K




PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K




PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K

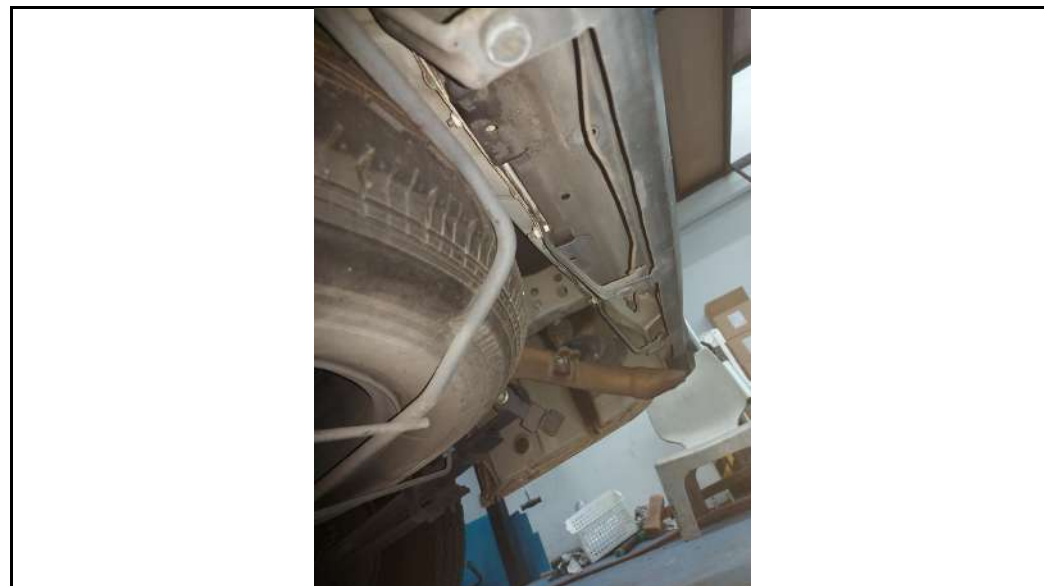

PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K

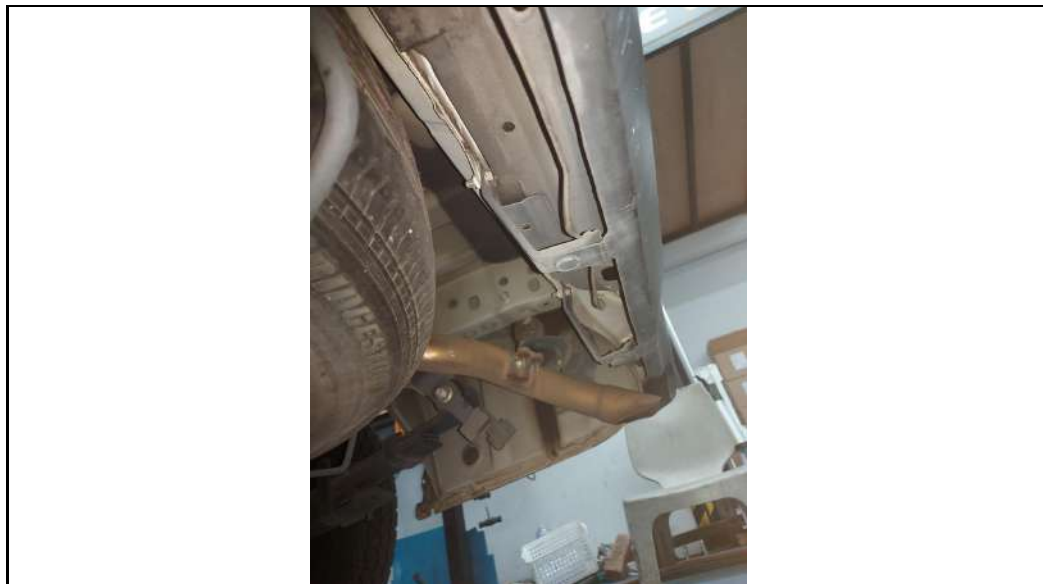


PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K

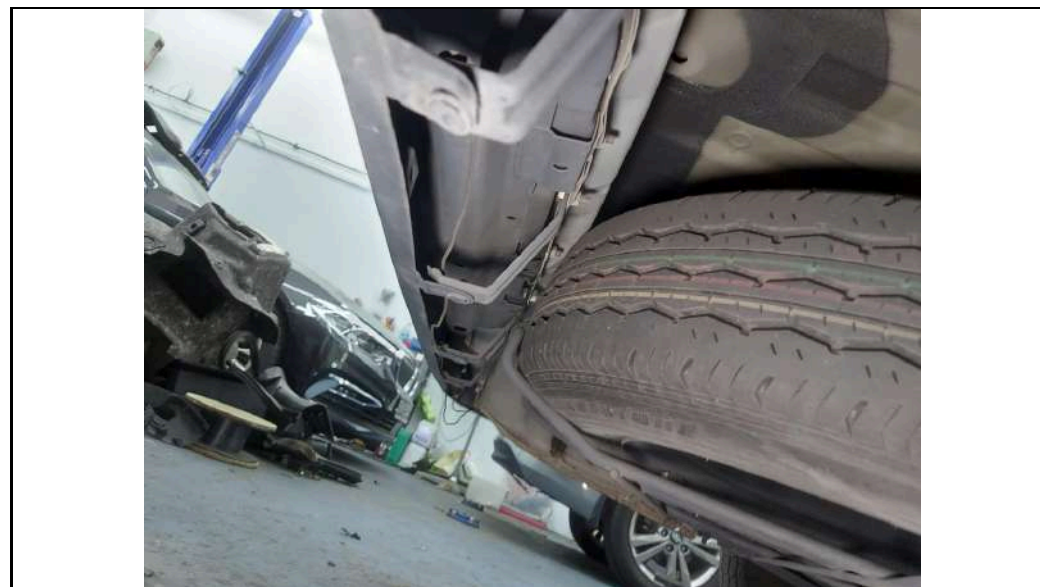

PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K



PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : GBH 6572K

