



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2500401
INV Date 16/01/2025
Reference CD/LPC24110227/Epa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. YN 9642T
Insured Veh. XE 4604X
Claim No. 24/24/24/VC05/030117
Policy No. Z24VC05021330
Accident Date 30/10/2024
Inspection Date 20/11/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS LONPAC INSURANCE BHD	Ref:	CD/LPC24110227/Epa3q2
300 BEACH ROAD	Date:	16/01/2025
#17-04/07 THE CONCOURSE SINGAPORE 199555	Code:	LPC2

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	XE 4604X	Veh. Inspected	YN 9642T
Policy No.	Z24VC05021330	Coverage	0
Claim No.	24/24/24/VC05/030117	Excess	\$0.00
Assign From	GERALD POH	Assign Date	12/11/2024

2. Vehicle Details

Make & Model	ISUZU NHR85AUE4A R1	C.C	2999
Engine No.	4JJ12A9068	Year of Reg.	27/10/2015
Chassis No.	JAANHR85EF7100239	Colour	WHITE
Odometer	202526 KM	Steering	IN ORDER
Brakes	IN ORDER	General	FAIR
Modification(s)	RIMS: STANDARD ALLOY RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	195R15	BRIDGESTONE	5
L/H Front Tyre	195R15	BRIDGESTONE	5
R/H Rear Tyre	195R15	BRIDGESTONE	5
L/H Rear Tyre	195R15	BRIDGESTONE	5

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	30/10/2024	Inspection Date	20/11/2024
Survey held at	MOVA AUTOMOTIVE PTE LTD 15 FAN YONG ROAD SINGAPORE 629792		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 4 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO YN 9642T

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
2	TAILLAMP LH/RH	RH BROKEN	\$500.00	\$220.00
1	TAILLAMP RH, COVER	NOT NECESSARY	\$25.00	\$0.00
1	REAR DECK GATE	DENTED	\$1,250.00	\$1,000.00
1	RH DROP SIDE (SIDE GATE)	DENTED	\$1,650.00	\$1,400.00
1	LH LOCKER	BENT	\$220.00	\$180.00
	LESS 15.00% DISCOUNT		(\$546.75)	(\$420.00)
			\$3,098.25	\$2,380.00

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	REVERSE SENSOR	NOT NECESSARY	\$200.00	\$0.00
1	60KM/H DECAL	NECESSARY	\$40.00	\$25.00
1	6 PAX DECAL	NECESSARY	\$40.00	\$25.00
1	TAILGATE COMPANY LOGO	NECESSARY	\$180.00	\$150.00
1	SIDE GATE COMPANY LOGO	NECESSARY	\$250.00	\$200.00
1	TAILGATE CHECKER PLATE	BENT	\$550.00	\$400.00
1	RIVET SET	NECESSARY	\$40.00	\$30.00
1	REAR BUMPER	TO REPAIR SEE LABOUR	\$650.00	\$0.00
1	REFLECTIVE STICKER	NOT NECESSARY	\$40.00	\$0.00
			\$1,990.00	\$830.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO PANEL BEAT/ KNOCKING AND REPLACE DAMAGED PARTS. TO REALIGN ALL THE CONNECTION.		\$800.00	\$500.00
	TO SPRAY PAINT ON REAR DECK GATE, DROP SIDE, REAR BUMPER.		\$650.00	\$550.00
	TO APPLY ANTI RUST PROOFING ON AFFECTED AREAS.		\$80.00	\$30.00
	TO TRANSFER RH DROP SIDE CHECKER PLATE.		\$150.00	\$80.00
	TO INSTALL TAILLAMP AND FUNCTIONING CHECK.		\$40.00	\$0.00
			\$1,720.00	\$1,160.00

GRAND TOTAL			\$6,808.25	\$4,370.00
--------------------	--	--	-------------------	-------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)		\$3,500.00
Report Ref No: CD/LPC24110227/Epa3q2			

MARKET VALUE: \$14,000.00(EST) LESS LTA REBATE: \$2,094.00(EST) = NETT VALUE :\$11,906.00(EST)


CTY

STEVE CHEN TSUE YEE

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of repositibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T

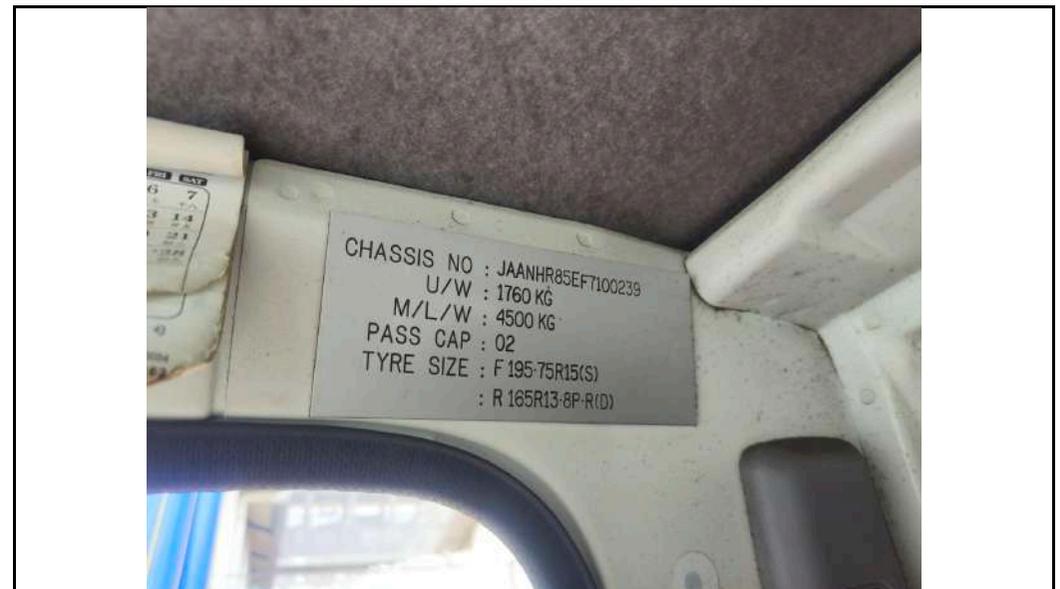

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T



PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 4 of 12)


PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T



PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T

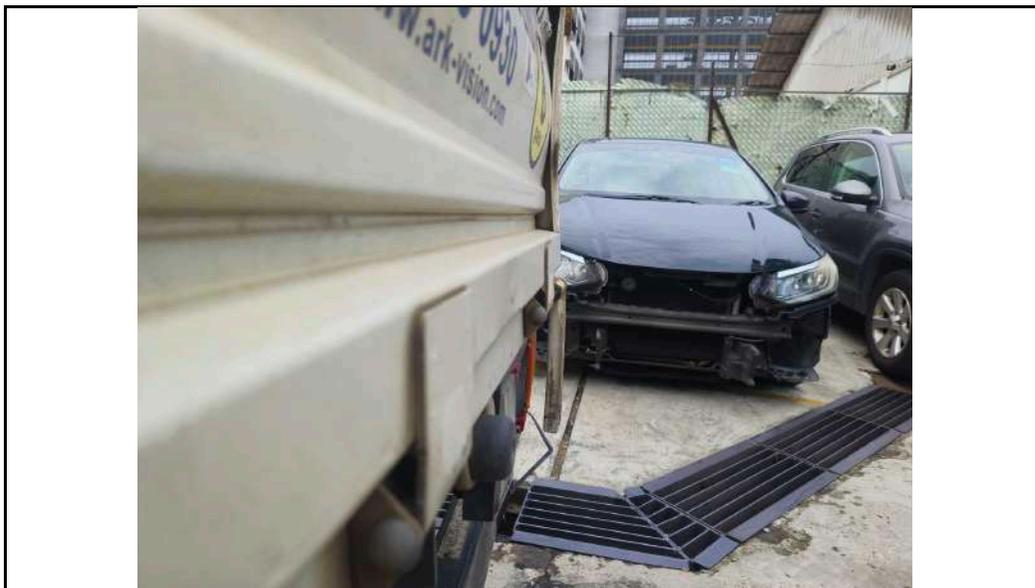

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T

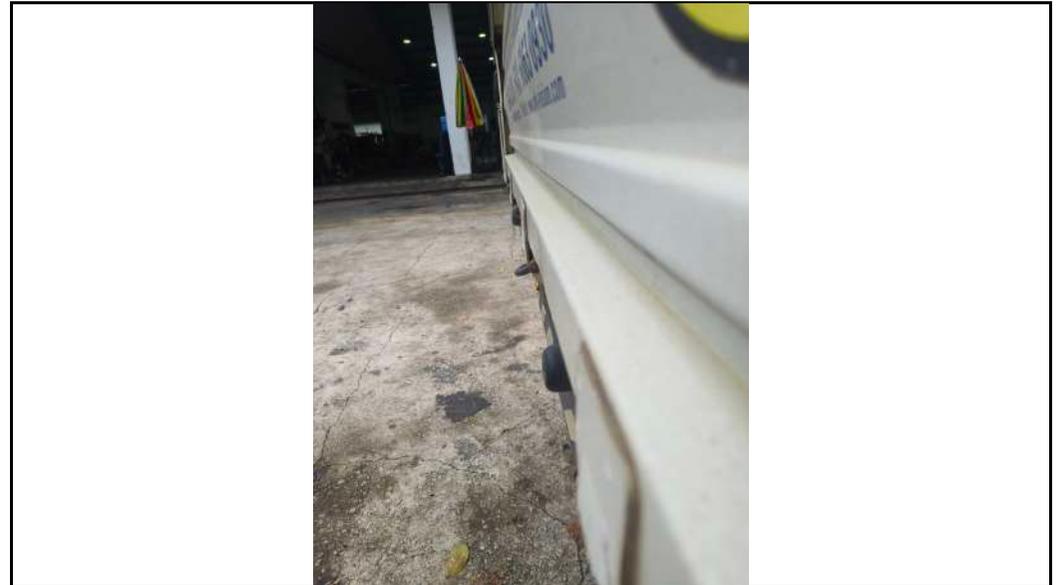

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T



PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T



PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 10 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 11 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T



PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : YN 9642T

