



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2501566

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 17/03/2025
Reference CD/CTI24110414/Kma3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SDH 5573R
Insured Veh. GBC 87K
Claim No. SNM24D206531/
Policy No. DMCVSNA00100172303
Accident Date 19/11/2024
Inspection Date 21/11/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24110414/Kma3q2(N)	
			Date: 17/03/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBC 87K	Veh. Inspected	SDH 5573R
	Policy No.	DMCVSNA00100172303	Coverage (\$)	0.00
	Claim No.	SNM24D206531/	Excess (\$)	0.00
	Assign From		Assign Date	21/11/2024
2. Vehicle Particulars & Condition				
	Make & Model	HYUNDAI ELANTRA (A)	c.c	1591
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	KMHDH41CMGU641483	Colour	WHITE
	Odometer	112513 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	MICHELIN	8 mm
	L/H Front Tyre	195/65 R15	MICHELIN	8 mm
	R/H Rear Tyre	195/65 R15	MICHELIN	8 mm
	L/H Rear Tyre	195/65 R15	MICHELIN	8 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	19/11/2024	Inspection Date	21/11/2024
	Survey held at	ALAN'S UNITED AUTO PTE LTD BLK 7 SIN MING INDUSTRIAL ESTATE #01-76 SINGAPORE 575642		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SDH 5573R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	BENT	1,125.00	1,125.00
1	BONNET STAND	TO REPAIR SEE LABOUR	32.00	-
1	BONNET INSULATOR	SERVICEABLE	175.00	-
1	BONNET INNER LOCK	BENT	105.00	105.00
1	BONNET FRONT RUBBER	CUT	35.00	35.00
1	FRONT GRILLE	CRACKED	128.00	128.00
1	FRONT BUMPER FASCIA	CRACKED	445.00	445.00
2	FRONT BUMPER SIDE TOP BRACKET @\$25.00	DISTORTED	50.00	50.00
1	FRONT BUMPER SPONGE	CRACKED	105.00	105.00
1	FRONT BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	516.00	-
1	FRONT BUMPER LOWER BEAM	TO REPAIR SEE LABOUR	140.00	-
1	FRONT BUMPER LOWER GRILLE	CRACKED	165.00	165.00
2	FRONT BUMPER SIDE RETAINER @\$20.00	SERVICEABLE	40.00	-
2	HEADLAMP @\$880.00	CRACKED	1,760.00	1,760.00
1	FRONT SUPPORT PANEL	BENT	975.00	975.00
1	AIR CON CONDENSER	PUNCTURE	895.00	895.00
2	AIR CON CONDENSER SIDE GUIDE @\$26.00	DISTORTED	52.00	52.00
1	RADIATOR ASSY	HOUSING BROKEN	520.00	520.00
1	RADIATOR TOP HOSE	SERVICEABLE	32.00	-
1	RADIATOR ADAPTOR	CRACKED	48.00	48.00
1	RADIATOR ADAPTOR HOSE	SERVICEABLE	32.00	-
1	RADIATOR FAN ASSY	SERVICEABLE	568.00	-
	LESS 20% DISCOUNT		-1,588.60	-1,281.60
			6,354.40	5,126.40
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NO PLATE WITH BOX (SN)	BENT	50.00	45.00
1	RADIATOR COOLANT (SN)	NECESSARY	30.00	30.00

Report Ref No. CD/CTI24110414/Kma3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	30.00	30.00
			110.00	105.00
	LABOUR			
	TO TOWING.		60.00	60.00
	TO REWIRE DAMAGED PARTS AND REFOCUS HEADLAMP BEAM.		20.00	20.00
	TO REMOVE AIR CON CONDENSER ,PIPES AND DRIER ,VACUUM AND TO RECHARGE GAS.		120.00	100.00
	TO PUTTY AND SPRAY REPLACED PARTS.		900.00	750.00
	TO REMOVE ,CUT OUT DAMAGED PARTS ,PANEL BEATING ,WELDING ,ALIGN,REFIX AND TO RENEW ABOVE PARTS.INCLUSIVE OF THE REPAIR OF BONNET STAND,FRONT BUMPER REINFORCEMENT AND FRONT BUMPER LOWER BEAM .		1,000.00	600.00
			2,100.00	1,530.00
GRAND TOTAL			8,564.40	6,761.40
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,400.00

Report Ref No. CD/CTI24110414/Kma3q2(N)

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933





TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.

19-9607198-R

INSPECTION PHOTOS (Page 1 of 6)

PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R



PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R



PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R



PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R



PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 6 of 6)

PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 2)

PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R

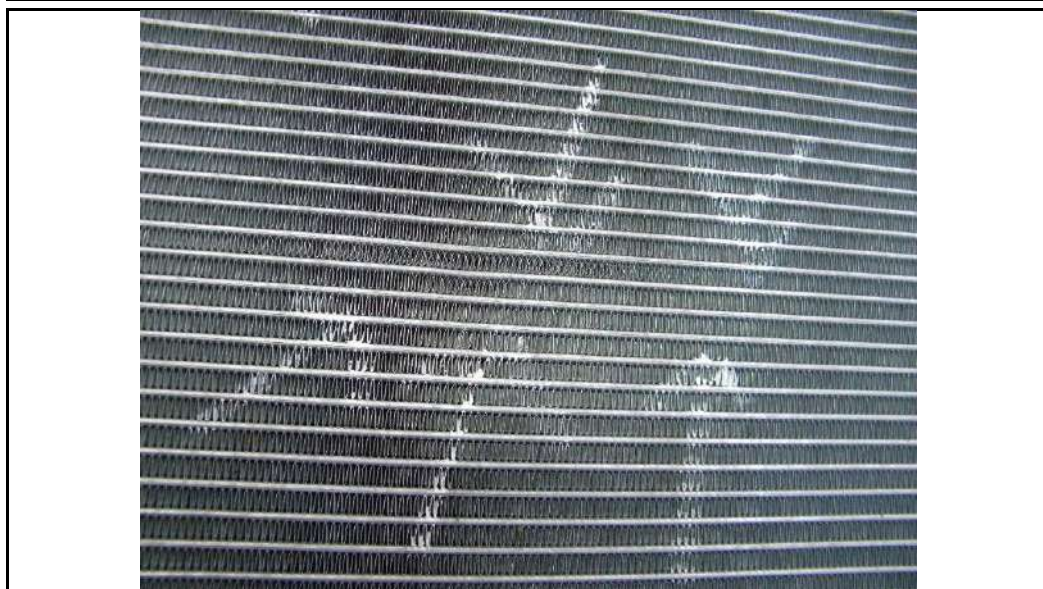

PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SDH 5573R

