Ding Auto Pte Ltd Sin Ming Industrial Est. Sec C, Blk 10,#01-20 575645

Insurer Reference: SNM24D205311 Repairer Reference: 074191

Date calculated: 02/12/2024 9:01 AM

Full Report Registration: GU456A Printed: 02/12/2024 9:01 AM

Summary Information

Claim

Location:

Singapore (SG)

Work Provider:

China Taiping Insurance

(Singapore) Pte Ltd

Printed by:

Claim Reference:

Ding Auto SNM24D205311 Currency:

SGD

Estimated Repair Time: Actual Repair Days:

Date of Incident:

19/09/24

Hire Car Start: Hire Car End:

Vehicle Details

Vehicle

Manufacturer:

NISSAN

Model: Sub Model: NV200 (M20) BASE MODEL

Model Sheet Number:

71 89 01

Registration:

GU456A

VIN number:

JN1YAAM20Z0001296

Odometer:

Model Specs

HEATED DOOR MIRRORS

FULL WHEEL COVERS

PRODUCTION JAPAN

COMBI

PREPARE OFF VEHICLE

Insurer Reference: SNM24D205311 Repairer Reference: 074191

Date calculated: 02/12/2024 9:01 AM

Full Report Registration: GU456A Printed: 02/12/2024 9:01 AM


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

AII Underbody

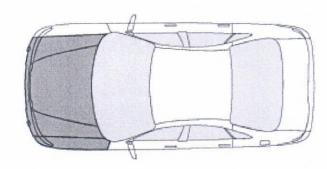

Tyres Condition

Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Tyre Brand

mm

Condition

mm

mm

Middle), mm

Spare Tyre Brand

Tread (Spare), mm

	Time Base 10 WU/h	Price = 42.	Price = 42.00 SGD/h	
Code	Description	WU	Price SGD	
NO NUMBER	JOB ALLOWANCE	5.0	21.00	
UE10A1	RENEW L/F WING INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE, BUMPER MOULDINGS, WHEELHOUSE LINER, HEADLAMP AND NECESSARY ATTACHED PARTS	18.0	75.60	
UA10A1)	RENEW FRONT BUMPER (BUMPER REMOVED) INCLUDES: R + R NECESSARY ATTACHED PARTS, RENEW IF NECESSARY	4.0	16.80	
WH40A1	ADJUST HEADLAMPS	3.0	12.60	
UH40A1)	R + R L/F DOOR TRIM	2.0	8.40	
UJ10A1)	R + R LEFT MIRROR	1.0	4.20	

Insurer Reference: SNM24D205311 Repairer Reference: 074191

Date calculated: 02/12/2024 9:01 AM

Full Report Registration: GU456A Printed: 02/12/2024 9:01 AM

Labour Cost Hrs WU
Panel / Mechanical Labour 3.30 33.0 138.60
Total of Labour 138.60

Paint

Paint Work SYSTEM AZT Time Basis 10 WU/h

Code Description - BASECOAT CLEAR WU Price SGD

L/F WING NEW PART PAINTING 10.0

Paint Material Per Part

CodeDescriptionPrice SGD0741L/F WING NEW PART PAINTING21.67

WU Price SGD Labour Cost - Paint Hrs 42.00 SGD/h Factor 10.0 Time Paint 2.50 25.0 105.00 Preparation Main Work Metal 35.0 147.00 10 WU/h 3.50 **Total**

Material Cost - PaintPrice SGDNew Part Painting21.67Material-constant Metal Preparation28.60Total50.27

Spare Parts

Spare raits				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	
0281	FRONT BUMPER	62022 JX00A	Original	400.00
1737	L/DOOR MIRROR	96302 JX06E	Original	280.00
7211	L/F WHEEL COVER	40315 JX00A	Original	130.00
0741	L/F WING	63101 JX00A	Original	350.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			1,160.00
u: Used parts	Addition(+10.00%)			116.00
	Total			1,276.00

Insurer Reference: SNM24D205311 Repairer Reference: 074191

Date calculated: 02/12/2024 9:01 AM

Full Report Registration: GU456A Printed: 02/12/2024 9:01 AM

Final Calculation

	SGD	SGD
Parts	1,160.00	
Addition(+10.00%)	116.00	
Total Parts		1,276.00
Labour Time Base 10 WU/h		
Total 33.0 WU X 42.00 SGD/h	138.60	
Total of Labour		138.60
Paint Work Time Base 10 WU/h		
Labour Cost 35.0 WU X 42.00 SGD/h	147.00	
Material Cost	50.27	
Total Paint Including Material		197.27
Repair Cost Excludes GST		1,611.87
GST (+9.00%)		145.07
Repair Cost Included GST		1,756.94

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

Author	Date	Text
dingauto	20/11/2024 4:08 PM	Assessment.1