

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference: SLU9006Y
Repairer Reference: SLU9006Y
Date calculated: 01/09/2025 3:32 PM

Full Report
Registration: SLU9006Y
Printed: 01/09/2025 3:32 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:	SLU9006Y	Date of Incident:	06/11/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	KIA
Model:	SORENTO (UM/UMA)
Sub Model:	BASE MODEL
Model Sheet Number:	28 SO 01
Registration:	SLU9006Y
VIN number:	
Odometer:	

Model Specs

SEMIAUTO PARKING AID	DRIVE CAMERA 360 DEG	2.2 LTR 147/142 KW	CRUISE CONT ADAPTIVE
PEDESTRIAN PROTECT	LED FOG LAMPS	TWO COAT METALLIC	PREPARE OFF VEHICLE


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

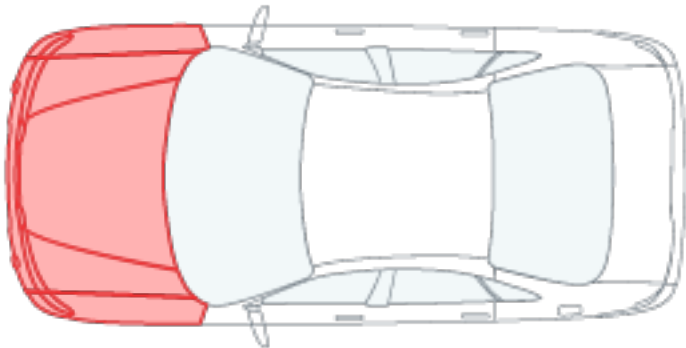

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner),Tread (Right Outer),Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
96401A0A	CALIBRATE FRONT RADAR		10.0	42.00
95774A0A	ADJUST CAMERA 360 GRADE		10.0	42.00
86510R00	R + R FRONT BUMPER		6.0	25.20
86512R00)	RENEW FRONT BUMPER (BUMPER REMOVED) INCLUDES: R + R NECESSARY ATTACHED PARTS		12.0	50.40
NO NUMBER	R + R FRONT BUMPER SUPPORT		4.0	16.80
92000R0B)	R + R BOTH HEADLAMPS		1.0	4.20
18600A00	ADD WORK FOR H-LAMP LEVEL CONTROL		3.0	12.60
25300R00)	R + R RADIATOR INCLUDES: WATER PIPE/S, HORNS, ELECTRIC FAN, AIR GUIDE REMOVE AND REFIT AND COOLING SYSTEM DRAIN / FILL		8.0	33.60
NO NUMBER	RADIATOR/CONDENSOR SEPARATE		2.0	8.40
28100R00	R + R AIR CLEANER CPL		3.0	12.60
97606R00)	R + R AIR CONDITIONING CONDENSER (BUMPER REMOVED)		2.0	8.40

Code	Description	WU	Price SGD
	NOT INCLUDED: AIR CONDITIONING DRAIN AND FILL		
09760A00	DRAIN/REFILL AIR CONDITIONING	5.0	21.00
1002	RADAR/BLINDSPOT RESET SYSTEM		250.00*
Labour Cost			
	Panel / Mechanical Labour	Hrs 6.60	WU 66.0
	Fixed Rate		277.20
			250.00
	Total of Labour		527.20

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC		WU	Price SGD
	FRONT BUMPER NEW PART PAINT K1R		11.0	
	FR LWR BUMPER GRILLE NEW PART PAINT K1R		6.0	
	L/F INNER SENSOR NEW PART PAINT K1R		3.0	
	GRILLE NEW PART PAINT K1R		6.0	
	FRT BUMPER SUPPORT SURFACE PAINT		4.0	
	L/F OUT PARK AID SEN SURFACE PAINT PLAST.		3.0	
	R/F OUT PARK AID SEN SURFACE PAINT PLAST.		3.0	
	R/F INNER SENSOR SURFACE PAINT PLAST.		3.0	

Paint Material Per Part

Code	Description	Price SGD
0283	FRONT BUMPER NEW PART PAINT K1R	53.14
0365	FR LWR BUMPER GRILLE NEW PART PAINT K1R	19.68
0373	L/F INNER SENSOR NEW PART PAINT K1R	0.49
0410	GRILLE NEW PART PAINT K1R	19.68
0340	FRT BUMPER SUPPORT SURFACE PAINT	3.74
0371	L/F OUT PARK AID SEN SURFACE PAINT PLAST.	0.37
0372	R/F OUT PARK AID SEN SURFACE PAINT PLAST.	0.37
0374	R/F INNER SENSOR SURFACE PAINT PLAST.	0.37

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			39.0	
Preparation Main Work Metal		0.50	5.0	21.00
Preparation Comp. Work Plastic		1.50	15.0	63.00
Total	10 WU/h	5.90	59.0	247.80

Material Cost - Paint

New Part Painting - Plastic K1R
 Surface-/Blend Paint
 Surface Painting Plastic
 Material-constant Metal
 Material-constant Plastic
Total

Price SGD
92.99
3.74
1.11
9.00
28.60
135.44

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
0260	FRT NO PLATE BRKT	86519C5500	Original	15.00
0283	FRONT BUMPER	86511C5520	Original	300.00
0287	FRT LWR BUMPER MLDG	86565C6800	Original	35.00
0297	L/F BUMPER COVER	86525C5520	Original	45.00
0341	FRT BUMPER ABSORBER	86520C5500	Original	65.00
0365	FR LWR BUMPER GRILLE	86560C5520	Original	95.00
0373	L/F INNER SENSOR	96890C5500SWP	Original	130.00
0391	FRONT SPOILER	86567C6800	Original	55.00
1007	UP/CVR RADIAT GRILLE	86360C5000	Original	110.00
1003	FRONT BUMPER CLIPS	PARTS	Original	12.00
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 862.00
u: Used parts				Fixed Sundry Parts Price 100.00
Total				962.00

Extras

Code	Description	Price SGD
1004	FRT NO.PLATE	35.00*
1005	FRONT GRILLE	130.00*
Total Extras		165.00

Final Calculation

	SGD	SGD
Parts	862.00	
Fixed Sundry Parts Price	100.00	
Total Parts		962.00
Labour Time Base 10 WU/h		
Total 66.0 WU X 42.00 SGD/h	277.20	
Fixed Rate	250.00	
Total of Labour		527.20
Total Of Extras		165.00
Paint Work Time Base 10 WU/h		
Labour Cost 59.0 WU X 42.00 SGD/h	247.80	
Material Cost	135.44	
Total Paint Including Material		383.24
Repair Cost Excludes GST		2,037.44
GST (+9.00%)		183.37
Repair Cost Included GST		2,220.81

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.