

2 Kaki Bukit Ave 2, #02 19/22 AutoHub @ Kaki Bukit, Singapore 417921

Email: ryderautoworkshop@gmail.com

Tel: 67418277 Fax: 67468277

Xiao Chen.

ESTIMATE OF REPAIR

Veh# SLB4744H

Model:

KIA

Accident Date : 20/11/2024

11/4/2016

Location : 121 paya lebar way carpark

3P:

YP7095A (INCOME)


S/Nos.	Qty	Description	List \$	S/Nett \$	Nett \$
1	2 pcs	Front headlamp R/L <i>RH cut</i>	4539.40	2269.70	
2	4 pcs	Front headlamp lower clip holder R/L <i>new and</i>	28.00	19.	
3	1 pc	Front grille <i>cut</i>	573.30	✓	
4	1 pc	Front bumper <i>Replaced</i>	665.00	485	
5	2 pcs	Front bumper side retainer R/L <i>Replaced</i>	60.00	30	
6	1 pc	Front bumper reinforcement <i>new</i>	497.00	x	
7	1 pc	Front bumper logo 'KIA' <i>new</i>	38.00	✓	
8	1 pc	Front bumper lower grille <i>cut</i>	438.00	210	
9	1 pc	Front bumper lower reinforcement <i>new</i>	125.40	x	
10	1 pc	Front bumper inner sponge <i>cut</i>	92.40	✓	
11	1 pc	Front bumper tow hook cover <i>new</i>	15.00	x	
12	2 pcs	Front bumper foglamp R/L <i>RH Missing</i>	666.00	333.40	
13	2 pcs	Front bumper foglamp cover R/L <i>RH Missing</i>	78.00	39.	
14	1 pc	Front bumper upper cover <i>new</i>	49.00	x	
15	2 pcs	Front bumper lamp cover R/L <i>new</i>	86.00	x	
16	2 pcs	Front bumper lamp cover air duct garnish R/L <i>new</i>	60.00	x	
17	1 set	Front bumper clip <i>new</i>		80.00	30
18	1 pc	Front support panel <i>Replaced</i>	695.00	✓	
19	1 pc	Front washer tank <i>new</i>	166.00	x	
20	1 pc	Front fender R <i>Replaced</i>	593.00	✓	
21	2 pcs	Front fender inner shield R/L <i>new</i>	198.00	x	
22	2 sets	Front fender inner shield clip R/L <i>new</i>		100.00	✓
23	1 pc	Front sport rim LH <i>new</i>	817.00	x	
24	1 pc	Front tyre LH <i>new</i>		280.00	x
25	1 pc	Front shock absorber LH <i>new</i>	308.00	x	
26	1 pc	Front shock absorber top mounting <i>new</i>	126.00	x	
27	1 pc	Front lower arm LH <i>new</i>	368.50	x	

28	1 pc	Front knuckle arm LH	408.10	x	
29	1 pc	Front knuckle arm bearing hub LH	456.00	x	
30	1 pc	Front wiring harness	810.40	x	520
		Sub Total:	12,756.50	460.00	0.00
			10%	0%	0%
		After Less %:	11,480.85	460.00	0.00
		Labour			
1		To remove & refix accident damaged parts & realign accident affected area.	1,000.00	600	
2		To spray paint on accident affected area.	800.00	400	
3		To remove & refix air-con condenser, hose, pipe vacuum & refilling gas.	150.00	60	
4		To remove & refix radiator, fan motor & other attachment parts.	100.00	60	
5		To computerise wheel alignment.	120.00	x	
6		To check wiring	80.00	30	
7		To rust proof accident affected area.	120.00	x	
		Sub Total:	2,370.00		
		Total:	14,310.85		
		After Less 20%:	11,448.68		

Chan San Choon
Director
DipEng, AAE MIMI, MSAE(Aust)



AL 8778 1999
24 hr accident call

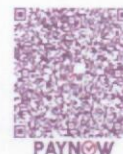

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Adrian L
L/S 21/11/24.
06 Days.

Total: 6497.02

L/S: 5.2K

Wrong Calculation.

5.2K