

REF:

ASSIGNMENT

From: _____ Date: _____

Estn: ~~Est~~OD / ~~TP~~ / TP RES / OD RES / EVA / INV / MVTo in ~~Vehicle~~ NO: _____at ~~Work~~ / ~~Site~~ / ~~Home~~ / ~~Office~~ / _____

of _____

Insured: _____

Policy No: _____

Claims No: _____

Sum Insured: _____

Excess: _____

(Client Record)

Make of Vcl: _____

(Policy Condition)

N/S	O/S

Remarks: Tlrah had commenced its repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SNE2299AYr Regn: 2020 / Dec.Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Mercedes Benz GLB1332Colour: Black

A/C: Insured / Std / NI / NA

Sp. Reading: 107703

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WIN2476872W034/03Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 235/50R19R: 235/50R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / DHTSU / PIR / SUMI /

TOYO / YOKO or Continental

Front

Rear

R/Bal. 06

mm

R/Bal. 06

mm

L/Bal. 06

mm

L/Bal. 06

mm

D.O.A. _____

D.O.A. 19/10/24Survey held at HD PerfectDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>UP AIG</u>
	COE Expiry
	Estimate given during : Yes ☒
	1st Survey : No ☐
	MV :
	PV :
	Nett :
	184C

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Addl Fee:

☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

: Tech. Inve (\$ _____)

Survey Fee:

Transportation:

B + R \$ _____

Photos

Others

Report Format: _____

Report Form: _____


HD Perfect Autowork Pte Ltd

Company Reg No: 202136904Z

8 Kaki Bukit Ave 4, #08-09 Premier@Kaki Bukit
Singapore 415875

Tel : 6341 6789 Fax: 6341 6778

E-mail: hdperfectautowork@gmail.com

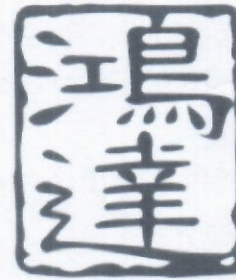

HD PERFECT
AUTOWORK PTE LTD

DATE : 19.11.2024

TO : **AIG** MOTOR CLAIMS DEPTS
VEHICLE NO : **SNE2299A**
MODEL : **MERCEDES BENZ GLB200**
DATE OF ACCIDENT : 19.11.2024
TIME OF ACCIDENT : 09:50 HOURS

WE APPEND HEREUNDER THE ESTIMATED COST OF REPAIRS TO BE CARRIED OUT TO THE ABOVE VEHICLE.

CLAIM DETAIL : PARTS

S/N	DESCRIPTION	QTY	UNIT LIST PRICE	TOTAL LIST PRICE
1	REAR BUMPER (UPPER) <i>Dishbed</i>	1	\$ 1,980.00	\$ 1,980.00
2	REAR BUMPER (UPPER) TOP CHROME <i>new</i>	1	\$ 1,235.00	\$ 1,235.00
3	REAR BUMPER (LOWER) <i>Dishbed</i>	1	\$ 925.00	\$ 925.00
4	REAR BUMPER CHROME (CENTER) <i>new</i>	1	\$ 1,480.00	\$ 1,480.00
5	REAR BUMPER DIFFUSER <i>Dishbed</i>	1	\$ 652.00	\$ 652.00
6	REAR BUMPER REFLECTOR <i>RTN new</i>	2	\$ 78.00	\$ 156.00
7	REAR BUMPER TOWING COVER <i>new</i>	1	\$ 95.00	\$ 95.00
8	REAR BUMPER EXHAUST CHROME <i>RTN new</i>	2	\$ 158.00	\$ 316.00
9	REAR BUMPER EXHAUST CHROME BRACKET <i>RTN new</i>	2	\$ 95.60	\$ 191.20
10	REAR BUMPER SENSOR <i>2 pieces damaged</i>	4	\$ 236.00	\$ 944.00
11	REAR BUMPER SENSOR HOLDER <i>2 pieces new</i>	6	\$ 43.00	\$ 258.00
12	REAR BUMPER SENSOR WIREHARNESS <i>new</i>	1	\$ 268.00	\$ 268.00
13	REAR BUMPER SMART SENSOR CONTROL UNIT <i>new</i>	1	\$ 491.00	\$ 491.00
14	REAR BUMPER SMART SENSOR <i>new</i>	1	\$ 285.00	\$ 285.00
15	REAR BUMPER SMART SENSOR C/W CABLE <i>new</i>	1	\$ 391.00	\$ 391.00
16	REAR BUMPER SIDE RETAINER <i>new</i>	2	\$ 138.00	\$ 276.00
17	REAR BUMPER CENTER TOP BEAM <i>new</i>	1	\$ 280.00	\$ 280.00
18	REAR BUMPER CENTER BOTTOM COVER GARNISH <i>torn new</i>	1	\$ 360.00	\$ 360.00
19	REAR BUMPER LOWER BRACKET <i>new</i>	2	\$ 65.00	\$ 130.00
20	REAR BUMPER REINFORCEMENT <i>Dishbed</i>	1	\$ 899.10	\$ 899.10
21	TAILLAMP <i>new</i>	2	\$ 835.00	\$ 1,670.00

TO : **AIG** MOTOR CLAIMS DEPTS
 VEHICLE NO : **SNE2299A**
 MODEL : **MERCEDES BENZ GLB200**
 DATE OF ACCIDENT : 19.11.2024
 TIME OF ACCIDENT : 09:50 HOURS

22	TAIL LAMP LOWER BRACKET <i>New</i>	2	\$ 98.00	\$ 196.00	+
23	REAR FENDER COWLING <i>New</i>	2	\$ 225.00	\$ 450.00	+
24	REAR WHEEL ARCED GARNISH <i>New</i>	2	\$ 329.00	\$ 658.00	+
25	REAR FENDER INNER TRIM <i>New</i>	2	\$ 520.00	\$ 1,040.00	+
26	TAIL GATE <i>Dented</i>	1	\$ 3,950.00	\$ 3,950.00	✓
27	TAIL GATE LAMP <i>Crack</i>	2	\$ 628.00	\$ 1,256.00	✓
28	TAIL GATE LOGO <i>New</i>	1	\$ 86.00	\$ 86.00	✓
29	TAIL GATE LOCK (POWER) <i>Broken</i>	1	\$ 557.30	\$ 557.30	✓
30	TAIL GATE OUTER SWITCH BUTTOM <i>Broken</i>	1	\$ 358.20	\$ 358.20	✓
31	TAIL GATE NUMBER PLATE LAMP <i>New</i>	2	\$ 158.20	\$ 316.40	+
32	TAIL GATE CATCH <i>New</i>	1	\$ 85.00	\$ 85.00	+
33	TAIL GATE INNER TRIM <i>Crack</i>	1	\$ 398.00	\$ 398.00	✓
34	TAIL GATE STOPPER <i>New</i>	1	\$ 25.00	\$ 25.00	✓
35	TAILGATE WEATHER STRIP <i>cut</i>	1	\$ 365.00	\$ 365.00	✓
36	TAIL GATE DAMPER 'ELETRIC' <i>New</i>	2	\$ 982.00	\$ 1,964.00	+
37	TAIL GATE AUTO SYSTEM <i>New</i>	1	\$ 3,558.00	\$ 3,558.00	+
38	REAR END PANEL <i>Dented</i>	1	\$ 2,550.96	\$ 2,550.96	✓
39	REAR END PANEL INNER GARNISH <i>Crack</i>	1	\$ 369.00	\$ 369.00	✓
40	REAR FLOOR TOP COVER BOARD <i>Dented</i>	1	\$ 658.00	\$ 658.00	✓
41	REAR EXHAUST BOX <i>2</i>	1	\$ 3,566.00	\$ 3,566.00	+
42	REAR EXHAUST GASKET <i>New</i>	1	\$ 94.00	\$ 94.00	+
43	REAR EXHAUST INSULATOR <i>New</i>	2	\$ 288.00	\$ 576.00	+
44	REAR EXHAUST MOUNTING <i>✓</i>	4	\$ 150.00	\$ 600.00	+

TOTAL PRICE \$ 36,959.16
 LESS 10% \$ 3,695.92
SUB TOTAL PRICE \$ 33,263.24

S/N	DESCRIPTION	QTY	UNIT S/NETT	TOTAL S/NETT	
1	REAR NUMBER PLATE <i>Best</i>	1	\$ 50.00	\$ 50.00	✓
2	REAR BUMPER CLIP (SET) <i>New</i>	1	\$ 150.00	\$ 150.00	50
3	REAR BUMPER CENTER WRAPPING <i>New</i>	1	\$ 280.00	\$ 280.00	+
4	REAR BUMPER DIFESSURE WRAPPING <i>New</i>	1	\$ 450.00	\$ 450.00	200
3	TAILLAMP CLIPS (SET) <i>New</i>	1	\$ 80.00	\$ 80.00	+
4	TAIL GATE SEALANT <i>New</i>	1	\$ 150.00	\$ 150.00	+

TO : **AIG** MOTOR CLAIMS DEPTS
 VEHICLE NO : **SNE2299A**
 MODEL : **MERCEDES BENZ GLB200**
 DATE OF ACCIDENT : 19.11.2024
 TIME OF ACCIDENT : 09:50 HOURS

6	TAIL GATE INNER TRIM CLIP (SET) <i>new</i>	1	\$ 80.00	\$ 80.00	<i>30</i>
7	TAIL GATE WINDSCREEN SEALANT <i>new</i>	1	\$ 80.00	\$ 80.00	<i>40</i>
8	TAIL GATE WINDSCREEN INNER SHIELD <i>new</i>	1	\$ 60.00	\$ 60.00	<i>30</i>
9	REAR FENDER COWLING CLIP (SET) <i>new</i>	1	\$ 60.00	\$ 60.00	<i>+</i>
10	REAR FENDER INNER TRIM CLIP (SET) <i>new</i>	1	\$ 60.00	\$ 60.00	<i>+</i>
11	REAR END PANEL INSULATION SEAL <i>new</i>	1	\$ 250.00	\$ 250.00	<i>60</i>
12	REAR END PANEL TOP GARNISH CLIP <i>new</i>	1	\$ 60.00	\$ 60.00	<i>20</i>

TOTAL \$ 1,860.00

CLAIM DETAILS: LABOUR AND SPRAY PAINTING (REAR)

S/N	JOB DESCRIPTION	PRICE	ADJUSTED COST
1	PANEL BEATING, REMOVAL AND REPLACING PARTS	\$ 2,200.00	<i>800</i>
2	TO SPRAY PAINT AFFECTED AREA	\$ 2,000.00	<i>800</i>
3	TUFF COAT	\$ 350.00	<i>60</i>
4	REMOVE AND REFIX CUSHION SEAT/ UPHOLSTRY AND ROOF LINNING TO FACILITATE REPAIR	\$ 350.00	<i>60</i>
5	CONDUCT WATER LEAKAGE TEST	\$ 180.00	<i>+</i>
6	REMOVE AND REFIX AND RESET TAILGATE AUTO SYSTEM	\$ 250.00	<i>+</i>
7	TRANSFER TAILGATE MECHANISM	\$ 150.00	<i>60</i>
8	REMOVE AND REFIX TAILGATE WINDSCREEN	\$ 150.00	<i>120</i>
9	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING	\$ 180.00	<i>50</i>
10	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING	\$ 180.00	<i>50</i>
11	REMOVE AND REFIX VIDEO RECORDER	\$ 80.00	<i>50</i>

TO : **AIG** MOTOR CLAIMS DEPTS
VEHICLE NO : **SNE2299A**
MODEL : **MERCEDES BENZ GLB200**
DATE OF ACCIDENT : 19.11.2024
TIME OF ACCIDENT : 09:50 HOURS

12	REMOVE AND REFIX SMART OPEN SENSOR AND DISTANCE SETTING	\$ 180.00	80
13	REMOVE AND REFIX REAR EXHAUST PIPE	\$ 250.00	x
14	RESET BOOTLID SYSTEM	\$ 350.00	x
15	REAR CHASSIS ALIGNMENT	\$ 250.00	x
16	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS, RESET MEMORIES TO SPECIFICATION ETC.	\$ 580.00	180

TOTAL

\$7,680.00

TOTAL PARTS COST : \$ 35,123.24
TOTAL LABOUR COST : \$ 7,680.00
TOTAL REPAIR COST : \$ 42,803.24

Adrian Ling
1/3 19/11/24.
07 Days

NB: THIS IS ONLY AN ESTIMATE AND SHOULD ADDITIONAL WORK BE FOUND NECESSARY TO BE CARRIED OUT IN THE COURSE OF REPAIRS, EXTRA MATERIALS AND LABOUR COST WILL BE CHARGED ACCORDINGLY WHICH HOWEVER, YOU WILL BE INFORMED PRIOR TO ACTION TAKEN.

PARTS PRICES ARE SUBJECT TO CHANGES.

YOURS FAITHFULLY,

IRENE

SERVICE ADVISOR
IRENE
HP : 8297 9787

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: